

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL086001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 01/07/2016
--	---	---	--

NAME OF PROVIDER OR SUPPLIER

STREET ADDRESS, CITY, STATE, ZIP CODE

CENTRAL CARE

139 APEX LANE
MOUNT AIRY, NC 27030

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of Biennial Construction Survey by Dennis Harrell on 1-7-2016. Records indicate that this facility was first licensed 10-6-1972, for 53 beds. Based on this information, we are requiring the facility to meet the 1967 Edition of the North Carolina State Building Code for Group D-2 Institutional, the 1971 Minimum and Desired Standards and Regulations for Homes for the Aged and Disabled, and the applicable portions of the 2005 Rules for the Licensing of Adult Care Homes of Seven or More Beds.	C 000		
C 166	Housekeeping-Maintained Free of Hazards SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: Based on observation, the building was not maintained in a safe manner by not properly handling portable medical oxygen cylinders. This could affect all residents, staff and visitors if cylinders fall, breaking their valves, propelling the cylinder and turning it into a dangerous projectile. Findings include: A portable medical oxygen cylinder was stored in no container in room B-13.	C 166	Instructed Staff that the oxygen cylinders always be stored in container designed to store oxygen cylinders.	Jan 11 2016

FEB 10 2016

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

David Page

Administrator

2-9-16

STATE FORM

8999

HWT121

If continuation sheet 1 of 3

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL086001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED 01/07/2016
NAME OF PROVIDER OR SUPPLIER CENTRAL CARE		STREET ADDRESS, CITY, STATE, ZIP CODE 139 APEX LANE MOUNT AIRY, NC 27030			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE	
C 189	Continued From page 1	C 189			
C 189	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the heat detector in the basement boiler room was severely damaged and no longer in working condition. Failure to provide a working heat detector in this room could endanger all residents, staff and visitors in the event of a fire. 2. Based on observation, the cross-corridor fire door would not latch closed to resist the passage of fire and smoke. Fire doors that do not close completely and latch present the possibility that a fire that begins in one space can quickly spread through the corridor to the remainder of the facility. 3. Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: a. Holes in ceiling of closet off the laundry, b. Hole in ceiling of laundry beside a	C 189 C 189	Damaged Heat detector in Boiler room replaced Feb 8 2016 Fire door was adjusted to close properly and Latch Feb 3 2016		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL086001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 01/07/2016
NAME OF PROVIDER OR SUPPLIER CENTRAL CARE		STREET ADDRESS, CITY, STATE, ZIP CODE 139 APEX LANE MOUNT AIRY, NC 27030		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 2 disappearing stairway, c. Hole in ceiling of community bath beside a disappearing stairway, d. Ceiling damaged in dining room, e. Unsealed wire penetration in the office. 4. Based on observation, the battery powered emergency light in the corridor to the laundry would not work when tested. Battery powered emergency lights that will not work properly for at least 90 minutes could endanger the residents and staff.	C 189	all holes and penetrations that was found through ceiling repaired with fire rated caulk and/or fire rated sheet rock. Battery replaced in emergency light in corridor to the Laundry room.	Feb, 3 2016 Jan, 22 2016