

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL074042	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 04/26/2016
NAME OF PROVIDER OR SUPPLIER CYPRESS GLEN RETIREMENT COMMUNITY M		STREET ADDRESS, CITY, STATE, ZIP CODE 100 HICKORY STREET GREENVILLE, NC 27858		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of a Biennial Construction Survey by Ed Miller April 26, 2016. Records indicate that this Facility was licensure as a Home for the Aged serving 12 residents in a special care unit on or about February 17, 2004. Therefore the facility must meet the 1996 and the applicable portions of the 2005 Rules for the Licensing of Adult Care Homes, and, the 2002 North Carolina State Building Code, Section 407, Institutional Occupancy, Group I-2 Physical plant deficiencies were noted which require a plan of correction.	C 000		
C 135	Bathrooms-Not to Be Utilized for Storage SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (e) The requirements for bathrooms and toilet rooms are: (10) Resident toilet rooms and bathrooms shall not be utilized for storage or purposes other than those indicated in Item (4) of this Rule; This Rule is not met as evidenced by: 1. Based on observation, the facility failed to ensure that resident toilet rooms and bathrooms are not utilized for storage or purposes other than those indicated in the Rule. This deficiency affects all residents and staff who would not have the fixtures and/or space for the services needed. Findings on April 26, 2016: a. Spa - this area was being used to store wheelchairs and other devices,	C 135		

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL074042	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 04/26/2016
NAME OF PROVIDER OR SUPPLIER CYPRESS GLEN RETIREMENT COMMUNITY M		STREET ADDRESS, CITY, STATE, ZIP CODE 100 HICKORY STREET GREENVILLE, NC 27858		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 150	Continued From page 1	C 150		
C 150	Corridors-Free of equipment and Obstructions SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (g) The requirements for corridors are: (4) Corridors shall be free of all equipment and other obstructions. This Rule is not met as evidenced by: 1. Based on observation, the Building was not maintained in a safe manner by not maintaining clear and unobstructed exit paths to the outside. NC State Building Code requires a six-foot wide corridor. This would affect all residents, staff and visitors by obstructing egress during an emergency. Findings on April 26, 2016: a. Corridor outside Office - a piano and chair was in the corridor restricts the effective corridor width to thirty-six inches,	C 150		
C 164	Housekeeping and Furnishings-Clean, Repaired SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (1) have walls, ceilings, and floors or floor coverings kept clean and in good repair; (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1. Based on Observation, the facility failed to provide an environment in accordance with this Rule, by not maintaining the HVAC/ventilation,	C 164		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL074042	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 04/26/2016
NAME OF PROVIDER OR SUPPLIER CYPRESS GLEN RETIREMENT COMMUNITY M		STREET ADDRESS, CITY, STATE, ZIP CODE 100 HICKORY STREET GREENVILLE, NC 27858		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 164	Continued From page 2 grilles and their associated dampers free of hazards. This could affect all residents, staff and visitors if in the event of a fire the dampers do not close completely to contain the fire within the room of origin. Findings on April 26, 2016: a. Spa - the ventilation grille with their radiation damper have an excessive accumulation of dust/lint.	C 164		
C 189	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the Building was not maintained in a safe and operating condition, by not maintaining the fire and smoke resistance of doors keeping rooms the NC State Building Code defines as "Hazardous Area" separated from the rest of the Building. This could affect all residents, staff and visitors if smoke/fire is not contained in Room or fire compartment of origin. Findings on April 26, 2016: a. Soiled Linen - the corridor door (45 min rated, self-closing) did not latch into its frame, 2. Based on observations, the Building was not maintained in a safe and operating condition,	C 189		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL074042	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 04/26/2016
NAME OF PROVIDER OR SUPPLIER CYPRESS GLEN RETIREMENT COMMUNITY M		STREET ADDRESS, CITY, STATE, ZIP CODE 100 HICKORY STREET GREENVILLE, NC 27858		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 3 because some fire sprinkler heads have obstructed. This could affect all residents, staff and visitors if fire is not contained in Room or compartment of origin. Findings on April 26, 2016: a. Carport - the sidewall fire sprinkler heads were loaded (covered) with spider webs and leafs. Deficiency corrected before Construction Surveyor departed site 3. Based on observation and testing, the Building was not maintained in a safe and operating condition, because the emergency lighting, which illuminates the egress pathways during power outages, did not work properly. This would affect all residents, staff and visitors if the egress pathways were not illuminated during power outages and there is no other illumination available. Findings on April 26, 2016: a. Service Entrance - the exterior wall-mounted self-contained emergency light did not work on backup power when the test button was pushed, 4. Based on observation, the building was not maintained in a safe manner by failing to ensure that clothes dryer duct can exhaust to and open free area. This could affect all residents, staff and visitors by allowing lint to accumulate (fuel for a fire) Findings on April 26, 2016: a. Carport - the clothes dryer terminates outside into a bird screen that was catching the lint and was nearly clogged. Deficiency corrected before Construction Surveyor departed site. 5. Based on observations, the Building was not maintained in a safe and operating condition, because of holes and gaps around penetration through the fire-resistance-rated construction,	C 189		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL074042	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 04/26/2016
NAME OF PROVIDER OR SUPPLIER CYPRESS GLEN RETIREMENT COMMUNITY M		STREET ADDRESS, CITY, STATE, ZIP CODE 100 HICKORY STREET GREENVILLE, NC 27858		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 4 invalidating its integrity. This could affect all residents, staff and visitors if smoke/fire is not contained in Room or compartment of origin. Findings on April 26, 2016: a. Time Clock Room (telephone room) - there was a gap around a cable that penetrates through the fire-resistance-rated ceiling assembly, b. Time Clock Room (telephone room) - there were two cable bundles penetrating the wall that were sealed with only gypsum joint compound, c. Time Clock Room (telephone room) - there were two open-ended sleeves with cable bundles that were penetrating the fire-resistance-rated ceiling assembly, 6. Based on observation, the Building was not maintained in a safe and operating condition, because the fire sprinkler escutcheon plates were impaired, exposing openings through the fire-resistance-rated construction. This could affect all residents, staff and visitors if smoke/fire is not contained in the Room or compartment of origin. Findings on April 26, 2016: a. Corridor near Bedroom 105 - the fire sprinkler escutcheon plate had dropped down from the ceiling. Deficiency corrected before Construction Surveyor departed site. 7. Based on Observation, and interview with Administrator, the Building was not maintained accessible for inspection. This deficiency affects all residents, staff and visitors by not preventing any deficiency that may be discovered with regular inspections from being corrected. Findings on April 26, 2016: a. Kitchen - a closet with an electrical rollup door was broken, denying inspection access to this area,	C 189		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL074042	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 04/26/2016
NAME OF PROVIDER OR SUPPLIER CYPRESS GLEN RETIREMENT COMMUNITY M		STREET ADDRESS, CITY, STATE, ZIP CODE 100 HICKORY STREET GREENVILLE, NC 27858		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 199	Continued From page 5	C 199		
C 199	Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on Observation and testing with a thin plastic sheet, the facility failed to maintain the ventilation system in proper working order. This could affect all residents, staff and visitors by preventing the exhausting of odors. Findings on April 26, 2016: a. Bedroom 11's Bathroom - the exhaust ventilation system did not remove any air to dissipate odors,	C 199		