

PRINTED: 01/05/2017
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001024	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED R 12/14/2016
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON AL (NC)		STREET ADDRESS, CITY, STATE, ZIP CODE 3615 SOUTH MEBANE STREET BURLINGTON, NC 27215			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE	
(C 000)	Initial Comments Report of a Biennial Follow Up Construction Survey by Ed Miller, conducted on December 14, 2016. The following deficiencies cited during the previous Construction Section Biennial Survey, have not been satisfactorily corrected and will require a new Plan of Correction.	(C 000)			
(C 101)	Existing Licensed Fac- No less than '71 Rules SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0301 APPLICATION OF PHYSICAL PLANT REQUIREMENTS The physical plant requirements for each adult care home shall be applied as follows: (2) Except where otherwise specified, existing licensed facilities or portions of existing licensed facilities shall meet licensure and code requirements in effect at the time of construction, change in service or bed count, addition, renovation, or alteration; however in no case shall the requirements for any licensed facility where no addition or renovation has been made, be less than those requirements found in the 1971 "Minimum and Desired Standards and Regulations" for "Homes for the Aged and Infirm", copies of which are available at the Division of Health Service Regulation at no cost; This Rule is not met as evidenced by: 1. Based on observation, the Building failed to meet NC State Building Code at the time of initial Licensing by not having all the required components of a properly operational delayed egress locking system. This could affect all residents, staff and visitors by potentially delaying exiting in an emergency for more than an	(C 101)			

Division of Health Service Regulation
LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

STATE FORM

6888

MC9022

If continuation sheet 1 of 5

1/18/17

Received

1/18/17 @ 2:58pm

PRINTED: 01/05/2017
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001024	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED R 12/14/2016
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON AL (NC)		STREET ADDRESS, CITY, STATE, ZIP CODE 3615 SOUTH MEBANE STREET BURLINGTON, NC 27215			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE	
{C 101}	Continued From page 1 acceptable time. Findings on September 29, 2016: a. Front Door - the door has delayed egress locking, which requires a readily visible sign on the door near the release device that reads "PUSH UNTIL ALARM SOUNDS. DOOR CAN BE OPENED IN 15 SECONDS". b. Kitchen Exterior Door - the door has delayed egress locking, which requires a readily visible sign on the door near the release device that reads "PUSH UNTIL ALARM SOUNDS. DOOR CAN BE OPENED IN 15 SECONDS".	{C 101}			
{C 166}	Housekeeping-Maintained Free of Hazards SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 2. Based on Observation, the facility failed to maintain the building in an uncluttered, clean and orderly manner. Findings on September 29, 2016: a. Entire Building - the HVAC return and ventilation grilles throughout the Facility with their radiation dampers have an excessive accumulation of dust/lint.	{C 166}			
{C 188}	Electrical Outlets in Wet Locations SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0310 ELECTRICAL OUTLETS	{C 188}			

PRINTED: 01/05/2017
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001024	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED R 12/14/2016
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON AL (NC)		STREET ADDRESS, CITY, STATE, ZIP CODE 3816 SOUTH MEBANE STREET BURLINGTON, NC 27215			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETE DATE
{C 188}	Continued From page 2 All adult care home electrical outlets in wet locations at sinks, bathrooms and outside of building shall have ground fault interrupters. This Rule is not met as evidenced by: 1. Based on Observation, the facility failed to provide electrical outlets in wet locations at sinks, bathrooms and outside of building with ground fault interrupters. This would affect residents, staff and visitors by not providing ground fault protection to these devices. Findings on September 29, 2016: a. Exterior near Kitchen Door- the ground-fault circuit-interrupter (GFCI) electrical power receptacle did not trip with a push of the test button and when tested with a circuit tester.	{C 188}			
{C 189}	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 2. Based on observation, the building's emergency equipment was not maintained in a safe and in operating condition. This would affect residents, staff and visitors if they could not promptly find their way to an exit during an emergency.	{C 189}			

PRINTED: 01/05/2017
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HA1001024	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED R 12/14/2016
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON AL (NC)		STREET ADDRESS, CITY, STATE, ZIP CODE 3615 SOUTH MEBANE STREET BURLINGTON, NC 27215		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 189}	Continued From page 3 Findings on September 29, 2016: b. Exit near Bedroom 43- the exit sign did not illuminate on backup power when tested. Exit signs must work on backup power to provide directions during power outages. c. Corridor near Bedroom 50 - the ceiling-mounted remote headlight on the emergency lighting system did not illuminate on backup power when tested. Emergency lighting must illuminate the egress pathway during power outages. 3. Based on Observation, the Building was not maintained in a safe condition. This could affect residents, staff and visitors by not containing smoke and fire in the room of origin. Findings on September 29, 2016: b. Kitchen - the Kitchen to Dining Room - the door did not latch into its frame when closed. c. Therapy - the corridor door had a wedge holding the door open, preventing the rapid release of the door with a push or pull of the door, to close and latch	{C 189}		
{C 199}	Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms;	{C 199}		

Division of Health Service Regulation

STATE FORM

6899

MC9G22

If continuation sheet 4 of 5

PRINTED: 01/05/2017
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL001024	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED R 12/14/2016
NAME OF PROVIDER OR SUPPLIER BROOKDALE BURLINGTON AL (NC)		STREET ADDRESS, CITY, STATE, ZIP CODE 3615 SOUTH MEBANE STREET BURLINGTON, NC 27215		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
{C 199}	Continued From page 4 (4) housekeeping closets; and (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on Observation and testing with a thin plastic sheet, the facility failed to maintain the ventilation system in proper working order. This could affect all residents, staff and visitors by preventing the exhausting of odors. Findings on September 29, 2016: a. Mech Room with Clinical Sink - the exhaust ventilation system did not work.	{C 199}		