

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL007001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/06/2019
NAME OF PROVIDER OR SUPPLIER AUTUMFIELD OF BELHAVEN		STREET ADDRESS, CITY, STATE, ZIP CODE 1345 SEED TICK NECK ROAD PINETOWN, NC 27865		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of a Construction Section Biennial Survey by Suzanna Fay conducted on March 6, 2019. Records indicate that this facility was first licensed or submitted for licensure as a Home for the Aged serving 64 residents on May 13, 1988. Therefore the facility must meet the 1987 and the applicable components of the 2005 Rules for the Licensing of Adult Care Homes, and the 1978 (w/revisions) North Carolina State Building Code; Group I - Unrestrained Occupancy. Deficiencies were cited that require a Plan of Correction.	C 000		
C 164	Housekeeping and Furnishings-Clean, Repaired SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (1) have walls, ceilings, and floors or floor coverings kept clean and in good repair; (2) have no chronic unpleasant odors; (3) have furniture clean and in good repair; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1: Observations revealed that the furnishings were not maintained in good repair. Findings on March 6, 2019: a. Room 109 - the veneer on the corridor door has split and peeled at the top right corner of the door. This was repaired at the time of survey. b. Linen Storage at Nurses' Station - the door hardware was loose. This was corrected at the	C 164	C 164 Housekeeping + Furnishings - Clean, Repaired Section .0300 - Physical Plant 10A NCAC 13F .0306 Housekeeping + Furnishings a) Adult care homes shall: 1) have walls, ceilings, + floors or floor coverings kept clean + in good repair; 2) have no chronic unpleasant odors; 3) have furniture clean + in good repair; e) This rule shall apply to new + existing facilities. This Rule is not met as evidenced by: 1: observations revealed that the furnishings were not maintained in good repair. Findings on March 6, 2019: a. Room 109 was repaired at the time of Survey. b. Linen Storage at Nurses Station was repaired at time of Survey.	3/6/19 3/6/19

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X6) DATE

STATE FORM

6899

KMQ321

If continuation sheet 1 of 4

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL007001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/06/2019
NAME OF PROVIDER OR SUPPLIER AUTUMFIELD OF BELHAVEN		STREET ADDRESS, CITY, STATE, ZIP CODE 1345 SEED TICK NECK ROAD PINETOWN, NC 27865		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 164	Continued From page 1 time of survey. c. Exit door by Break Room - the exterior veneer of the door has splintered and is peeling across the entire surface of the door.	C 164	C164 Exit door by break room was repaired on 3/21/19.	3/21/19
C 166	Housekeeping-Maintained Free of Hazards SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall: (5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards; (e) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1. Observations revealed that the facility was not maintained free of hazards. Findings on March 6, 2019: a. Room 109 Bath - one of the towel bars has broken off leaving the sharp metal edges of the mounting bracket exposed. The towel bar was repaired at the time of survey.	C 166	Section .0300-Physical Plant 10A NCAC 13F .0306 Housekeeping + Furnishings a) Adult care homes shall: 5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions + hazards; e) This Rule shall apply to new + existing facilities. This Rule is not met as evidenced by: 1. Observations revealed that the facility was not maintained free of hazards. Findings on March 6, 2019: a. Room 109 Bath - towel bar repaired at time of survey.	3/6/19
C 189	Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e)	C 189	Section .0300-Physical Plant 10A NCAC 13F .0311 OTHER Requirements a) The building + all fire safety, electrical, mechanical, + plumbing equipment in an adult care home shall be maintained in a safe + operating condition. k) This Rule shall apply to new + existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities.	

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL007001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/06/2019
NAME OF PROVIDER OR SUPPLIER AUTUMFIELD OF BELHAVEN		STREET ADDRESS, CITY, STATE, ZIP CODE 1345 SEED TICK NECK ROAD PINETOWN, NC 27865		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 2 which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation the facility did not maintain electrical emergency/safety lighting equipment in safe operating condition. This could effect occupants of the facility if egress paths and exits were not illuminated during a power outage. Findings on March 6, 2019: a. Dining Room - the emergency light did not illuminate on battery test. b. Service Hall - the emergency light did not illuminate on battery test. 2. Based on observation there is a failure to maintain the building's fire safety systems in a safe condition. Holes or gaps at penetrations through fire resistant rated ceilings could allow fire and smoke to spread beyond the area of origin. Findings on March 6, 2019: a. Service Hall - the conduit for the emergency light was not protected where it penetrated the ceiling. b. Diaper Storage - there is a 2" hole in the ceiling. 3. Based on observation there is a failure to install and maintain required plumbing safety devices or equipment. This could effect all occupants of the facility if the absence of the plumbing safety devices or equipment caused the domestic water supply to become contaminated. Findings on March 6, 2019: a. 200 Hall Bath - the tub has a hand held spray nozzle that reaches into the tub and is not	C 189	C189 This Rule is not met as evidenced by: 1. Based on observation the facility did not maintain electrical emergency/safety lighting equipment in safe operating condition. This could effect occupants of the facility if egress paths + exits were not illuminated during a power outage. Findings on March 6, 2019: a. Dining Room - New batteries will be installed on 3/27/19. 3/27/19 b. Service Hall - New batteries will be installed on 3/27/19. 3/27/19 2. Based on observation there is a failure to maintain the building's fire safety systems in a safe condition. Holes or gaps at penetrations through fire resistant rated ceilings could allow fire + smoke to spread beyond the area of origin. Findings on March 6, 2019: a. Service Hall - Fire retardant has been placed around the conduit. 3/8/19 b. Diaper Storage - 2" hole in ceiling has been repaired. 3/9/19 3. Based on observation there is a failure to install + maintain required plumbing safety devices or equipment. This could effect all occupants of the facility if the absence of the plumbing safety devices or equipment caused the domestic waste supply to become contaminated. Findings on March 6, 2019: a) 200 Hall Bath - Tub had hand held spray nozzle that reached into tub without a vacuum breaker. Installed vacuum breakers on ALL bathtubs. 3/11/19 b) 215 Bath - Tub had hand-held spray nozzle that reached into tub without a vacuum breaker. Installed vacuum breakers on ALL bathtubs. 3/11/19	

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL007001	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/06/2019
NAME OF PROVIDER OR SUPPLIER AUTUMFIELD OF BELHAVEN		STREET ADDRESS, CITY, STATE, ZIP CODE 1345 SEED TICK NECK ROAD PINETOWN, NC 27865		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 3 equipped with a vacuum breaker. b. Room 215 Bath - the tub has a hand held spray nozzle that reaches into the tub and is not equipped with a vacuum breaker. 4. Observations revealed that the fire safety equipment is not maintained in a safe and operating condition. Findings on March 6, 2019: a. The wall magnetic device is not secure to the wall on the right side door of the cross corridor doors at Room 101. 5. Observations revealed that the mechanical equipment is not maintained in a safe and operating condition. Findings on March 6, 2019: a. Beauty Shop - there is a heavy build up of mildew on the HVAC supply vent.	C 189	C189 4. Observations revealed that the fire safety equipment is not maintained in a safe + operating condition. Findings on March 6, 2019: a) wall magnetic device on the right side door of the cross corridor doors at Room 101 has been secured. 3/21/19 5. Observations revealed that the mechanical equipment is not maintained in a safe + operating condition. Findings on March 6, 2019: a) Beauty Shop - The heavy build up of mildew on the HVAC supply vent has been cleaned. 3/7/19	

Your Amazon.com order of 4 x "American Standard..."

From: Amazon.com (auto-confirm@amazon.com)

To: emti4u2wreck@yahoo.com

Date: Monday, March 11, 2019, 10:37 AM EDT



Order Confirmation

Hello Brenda Wright,

Thank you for shopping with us. You ordered 4 of "American Standard..." . We'll send a confirmation when your items ship.

 
Details

Order #112-0750384-9941803

VACUUM BREAKERS

Arriving:
Tuesday, March 12

Ship to:
Brenda Wright Wright
1277 Seed Tick Neck Rd...



Total Before Tax: \$76.72
Estimated Tax: \$5.16
Order Total: \$81.88

We hope to see you again soon.

Amazon.com

Trending near you



Kasa Smart WiFi Plug
Mini by...
\$24.49 ✓prime



Ring Video Doorbell 2
\$199.00 ✓prime

By placing your order, you agree to Amazon.com's Privacy Notice and Conditions of Use. Unless otherwise noted, items sold by Amazon.com are subject to sales tax in select states in accordance with the applicable laws of that state. If your order contains one or more items from a seller other than Amazon.com, it may be subject to state and local sales tax, depending upon the seller's business policies and the location of their operations. Learn more about tax and seller information.

This email was sent from a notification-only address that cannot accept incoming email. Please do not reply to this message.