

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL075011	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 07/31/2019
--	--	--	---

NAME OF PROVIDER OR SUPPLIER RIDGE REST ASSISTED LIVING	STREET ADDRESS, CITY, STATE, ZIP CODE 354 WOODLAND DRIVE COLUMBUS, NC 28722
---	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
--------------------------	--	---------------------	--	--------------------------

C 000 Initial Comments	Report of Construction Section Biennial Survey by Dennis Harrell on 7-31-2019. Records indicate that this facility was first licensed for 12 beds on 8-1-1979. An old fire inspection report provided by the Owner indicates that the oldest portion of the building was in operation as early as 1968 as Ridgecrest. There were 5 bedrooms added to the building in 2006 but the capacity stayed at 12 beds. Based on this information, the facility was surveyed for conformance with the applicable portions of the 2005 Rules for Licensing of Adult Care Homes of Seven or More Beds, and the older portion of the facility was surveyed using the 1967 NC Building Code, Intentional Occupancy, and the 1971 Minimum and Desired Standards and Regulations for Homes for the Aged and Infirm. The newer portion of the building was reviewed using the 2002 NC State Building Code Section 421.5 as a Large Residential Care Facility, and the 2000 rules for Adult Care Homes of Seven or More Beds. Deficiencies were cited.	C 000	Inspected Wednesday August 7, 2019 by Bobby Arledge Fire Marshal. Documentation attached to show current fire safety inspection report.	8-7-19
C 111	SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION) f) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review. This Rule is not met as evidenced by: Based on a review of documents, the required annual fire alarm system inspection report was	C 111	Must Have Current San. & Fire Safety Reports	8-21-19

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE <i>G. H. Felt</i>	TITLE <i>Owner/Administrator</i>	(X6) DATE <i>8-21-19</i>
--	---	---------------------------------

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL075011	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 07/31/2019
--	--	--	--	---

NAME OF PROVIDER OR SUPPLIER _____

STREET ADDRESS, CITY, STATE, ZIP CODE
**354 WOODLAND DRIVE
COLUMBUS, NC 28722**

(X4) ID TAG PREFIX	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)
--------------------------	--	---------------------	--

C 111	Continued From page 1 dated 5-17-2018. Fire alarm systems that are not inspected and approved as required could result in the fire alarm system not operating properly in the event of an actual fire.	C 111	
C 148	Corridors-Handrails SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (g) The requirements for corridors are: (2) Handrails shall be provided on both sides of corridors at 36 inches above the floor and be capable of supporting a 250 pound concentrated load; This Rule is not met as evidenced by: Based on observation, the corridor handrails failed to meet the Rule listed above. Findings on 7-31-2019: a. There was no hand grip provided on the right side of the corridor between the dining room and room 1. b. The handrail in the corridor near room 7 lacked enough supports to be capable of supporting a 250 pound concentrated load.	C 148	C 148 A) Handrail on right side of corridor added between dining room and room 1 to provide handrail on both sides of corridor B) Handrail near room 7 added supports to support a 250lb load 8-19-19
C 185	Fire Safety-Rehearsals on Each Shift SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0309 PLAN FOR EVACUATION (b) There shall be rehearsals of the fire plan quarterly on each shift in accordance with the requirement of the local Fire Prevention Code Enforcement Official. (c) Records of rehearsals shall be maintained and copies furnished to the county department of social services annually. The records shall	C 185	C 185 B) Implement fire rehearsals quarterly on each shift that include: date, time, list of employees present with a description of rehearsal to include

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL075011	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING _____	(X3) DATE SURVEY COMPLETED 07/31/2019
NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 354 WOODLAND DRIVE COLUMBUS, NC 28722				

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
--------------------------	--	---------------------	--	--------------------------

C 185 Continued From page 2 include the date and time of the rehearsals, the shift, staff members present, and a short description of what the rehearsal involved. (f) This Rule shall apply to new and existing facilities. This Rule is not met as evidenced by: 1. Based on a review of documents, only one record was available onsite for the rehearsals of the fire plan since February of this year. At least 12 months of records must be maintained and available for review. 2. Based on a review of documents, the record available onsite included no description of what the rehearsal involved. 3. Based on interview and review of documents, fire drill rehearsals are not being done regularly with at least one per shift each quarter. Failure to rehearse the fire plan could lead to confusion and delay in an actual emergency.	C 189 Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F.0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: Based on observation, the required one-hour fire	C 185 C 189	C 185 cont. location, staff response, and how long it took. A) Seal penetration in room to using Intumescent Caulk that is approved for one-hour fire rating B) Remove orange foam and replace with intumescent caulk that is approved for one-hour fire rating around	8-21-19 8-19-19 8-19-19
--	--	---------------------------	--	--

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL075011	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 07/31/2019
NAME OF PROVIDER OR SUPPLIER RIDGE REST ASSISTED LIVING				
STREET ADDRESS, CITY, STATE, ZIP CODE 354 WOODLAND DRIVE COLUMBUS, NC 28722				

(X4) ID TAG PREFIX	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 3 rated ceilings were compromised in locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings on 7-31-2019: a. Unsealed penetration in the ceiling of room 6, b. Gaps around ceiling duct penetrations in the basement were sealed using unrated orange foam.	C 189	<i>the ceiling duct penetrations in the basement.</i>	8-19-19