


DEPARTMENT OF HEALTH AND HUMAN SERVICES
CENTERS FOR MEDICARE & MEDICAID SERVICES

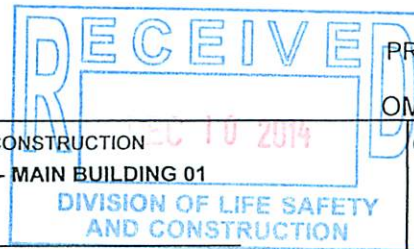

PRINTED: 11/20/2014
FORM APPROVED
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 355041	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01 B. WING _____	(X3) DATE SURVEY COMPLETED 11/18/2014
---	---	--	---

NAME OF PROVIDER OR SUPPLIER LUTHERAN HOME OF THE GOOD SHEPHERD	STREET ADDRESS, CITY, STATE, ZIP CODE 1226 1ST AVE N NEW ROCKFORD, ND 58356
--	---

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE
K 000	INITIAL COMMENTS This survey used the 2000 edition of NFPA 101, Life Safety Code, Chapter 18 - New Health Care Occupancies and Chapter 19 - Existing Health Care Occupancies in compliance with 42CFR 483.70(a). The findings that follow demonstrate noncompliance with these standards. The original building of Lutheran Home of the Good Shepherd was one-story of Type II (111) construction protected with a wet/dry automatic fire sprinkler system designed to meet the requirements of NFPA 13, Standard for the Installation of Sprinkler Systems. The Garage was separated from the original building by an occupancy separation wall having a two (2) hour fire resistance rating. Two wings (Medora Wing and Angel Wing) of the same construction type were added onto the original building in the late 1980's. A chapel/day care addition of Type V (000) construction was built in 2003. The addition had a wet/dry automatic fire sprinkler system designed to meet the requirements of NFPA 13, Standard for the Installation of Sprinkler Systems. Attached to the nursing home and chapel/day care addition was an apartment building. A combustibile link connected the nursing home and chapel/day care addition to the apartments at an occupancy separation wall having a two (2) hour fire resistance rating. The 2009 and the 2010 additions were Type V (111) construction and protected with a wet/dry automatic fire sprinkler system designed to meet the requirements of NFPA 13, Standard for the Installation of Sprinkler Systems.	K 000	It is always the intent of the Lutheran Home of the Good Shepherd to stay compliant with all Life Safety code Standards	

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE <i>Kenneth Jensen</i>	TITLE <i>Administrator</i>	(X6) DATE 12-2-14
--	-------------------------------	----------------------

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

*emailed
12-10-14*

DEPARTMENT OF HEALTH AND HUMAN SERVICES
CENTERS FOR MEDICARE & MEDICAID SERVICES

PRINTED: 11/20/2014
FORM APPROVED
OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: 355041	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01 B. WING _____		(X3) DATE SURVEY COMPLETED 11/18/2014
NAME OF PROVIDER OR SUPPLIER LUTHERAN HOME OF THE GOOD SHEPHERD			STREET ADDRESS, CITY, STATE, ZIP CODE 1226 1ST AVE N NEW ROCKFORD, ND 58356		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETION DATE	
K 054 SS=D	NFPA 101 LIFE SAFETY CODE STANDARD All required smoke detectors, including those activating door hold-open devices, are approved, maintained, inspected and tested in accordance with the manufacturer's specifications. 9.6.1.3 This STANDARD is not met as evidenced by: Smoke detectors should not be located in a direct airflow nor closer than 3 ft. (1 m) from an air supply diffuser or return air opening. NFPA 72 A-2-3.5.1 The facility failed to ensure smoke detectors were installed in accordance with NFPA72. Observation determined that one (1) of two (2) smoke detectors located in the Chapel was mounted on the ceiling directly above a ceiling fan. Failure to install smoke detectors in accordance with NFPA 72 increases the risk of death or injury due to fire. This deficiency affected one (1) of two (2) smoke detectors in the Chapel and one (1) of numerous smoke detectors throughout the facility. The smoke detection system serves the entire facility.	K 054	1. Lutheran home of the good Shepherd contacted an electrician to move the smoke detector to the required distance of 3 feet from air supply diffuser or air exchange. 2. Lutheran Home of the Good shepherd inspected other areas and did not find any other concerns. In the future, if smoke detectors are installed they will be required to be 3 ft. from any air source as directed by K-054. 3. Smoke detector inspections upon installations in the future will be performed by the maintenance department to stay compliant with K-054. 4. On 12/1/14 the electrician was on premise and made required changes in the location of the smoke detector. No further monitoring will need to occur to stay compliant. 5. The electrician completed the move of the smoke detector to be in substantial compliance as of 12/2/14 for Ktag-054.		