



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Bayview Manor Homes	Provider Number	000162
Address	11 ALOHA ,	Approval Status	Approved
City, State, Zip	Seattle, WA 98119	Facility Type	Residential Care

On 03/31/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121

Alan Harlan
Digitally signed by Alan Harlan
Date: 2026.03.31 06:09:38 -07'00'
Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Bayview Manor Homes	Provider Number	000162
Address	11 ALOHA ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA	Facility Type	Residential Care

On 10/7/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Contents

Fire safety, evacuation and lockdown plan contents shall be in accordance with Sections 404.2.1 through 404.2.3.2. (IFC 404.2 2021)	Findings during the reinspection were: Facility cannot provide documentation for the completion of unannounced fire drills, one drill per shift, per quarter, in the previous 12 months
--	--

2 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	Findings during the reinspection were: There was no documentation provided to verify that the facility is conducting the required annual inspection of fire-resistance-rated construction.
--	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Bayview Manor Homes	Provider Number	000162
Address	11 ALOHA ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA	Facility Type	Residential Care

On 10/7/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

3 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	Findings during the reinspection were: 1. The fire door in the AL dinning room 263 was blocked. 2. Facility is unable to provide documentation that the annual fire door inspection has been completed. NFPA 80 (2016) 5.2.3.5.2 As a minimum, the following items shall be verified: (1) Labels are clearly visible and legible. (2) No open holes or breaks exist in surfaces of either the door or frame. (3) Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped. (4) The door, frame, hinges, hardware, and noncombustible threshold are secured, aligned, and in working order with no visible signs of damage. (5) No parts are missing or broken. (6) Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7. (7) The self-closing device is operational; that is, the active door completely closes when operated from the full open position. (8) If a coordinator is installed, the inactive leaf closes before the active leaf. (9) Latching hardware operates and secures the door when it is in the closed position. (10) Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame. (11)* No field modifications to the door assembly have been performed that void the label. (12) Meeting edge protection, gasketing and edge seals, where required, are inspected to verify their presence and integrity. (13) Signage affixed to a door meets the requirements listed in 4.1.4
---	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Bayview Manor Homes	Provider Number	000162
Address	11 ALOHA ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA	Facility Type	Residential Care

On 10/7/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

4 Inspection, Testing and Maintenance

Fire protection and life safety systems shall be maintained in an operative condition at all times, and shall be replaced or repaired where defective. Nonrequired fire protection and life safety systems and equipment shall be inspected, tested and maintained or removed in accordance with Section 901.8. (IFC 901.6 2021)	Corrected
---	-----------

5 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	Findings during the reinspection were: Facility was unable to provide documentation that the Fire Department Connection has been hydrostatically tested in accordance with NFPA 25. NFPA 25 (2017) 13.8.5 The piping from the fire department connection to the fire department check valve shall be hydrostatically tested at 150 psi (10 bar) for 2 hours at least once every 5 years.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Bayview Manor Homes	Provider Number	000162
Address	11 ALOHA ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA	Facility Type	Residential Care

On 10/7/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

6 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10. Exceptions: 1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies. 2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met: 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed. 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal. 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment. 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed. 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10. 3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations. (IFC 906.2 2021)	Corrected
---	------------------

7 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Findings during the reinspection were: Facility is unable to provide documentation for the monthly single or multi station smoke alarm testing.
---	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Bayview Manor Homes
Address 11 ALOHA ,
City, State, Zip Seattle, WA

Provider Number 000162
Approval Status Disapproved
Facility Type Residential Care

On 10/7/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

8 Carbon Monoxide Detection - General

Carbon monoxide detection shall be installed in new buildings in accordance with Sections 915.1.1 through 915.6. Carbon monoxide detection shall be installed in existing buildings in accordance with Chapter 11 of the International Fire Code.

(IFC 0915.1 2021 WAC 51-54A)

Findings during the reinspection were:

Facility is unable to provide documentation for the monthly carbon monoxide detector testing.

NFPA 720

8.7.1 Single - and multiple-station carbon monoxide alarms and all connected appliances shall be inspected and tested in accordance with the manufacturer's published instructions at least monthly.

9 Means of Egress Continuity

The path of egress travel along a means of egress shall not be interrupted by any building element other than a means of egress component as specified in this chapter. Obstructions shall not be placed in the minimum width or required capacity of a means of egress component except projections permitted by this chapter. The minimum width or required capacity of a means of egress system shall not be diminished along the path of egress travel.

(IFC 1003.6 2021)

Findings during the reinspection were:

The 2nd floor Memory Care Activity exit is blocked.

The dinning room area exit was blocked.

10 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Findings during the reinspection were:

Facility is unable to provide documentation for the annual 90 minute power test for the emergency lights.

11 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Findings during the reinspection were:

The facility failed to provide documentation indicating a monthly generator battery test was being conducted in accord with NFPA 110 2021 edition section 8.3.6.1



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Bayview Manor Homes	Provider Number	000162
Address	11 ALOHA ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA	Facility Type	Residential Care

On 10/7/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

Next inspection scheduled on or after: 11/20/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative



Signature



Print Name and Title

Deputy State Fire Marshal Damon Roberson
2803 156 AVE SE
Bellevue WA 98007
(360) 584-4392



Signature