



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

 
Business Name	Ridge an Encore Community (The)	Provider Number	2231
Address	1501 TOWER VIEW CIR NW,	Approval Status	Approved
City, State, Zip	Silverdale, WA 98383	Facility Type	Residential Care

On 07/19/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

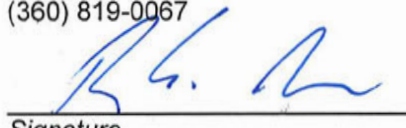
All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Ridge an Encore Community (The)	Provider Number	2231
Address	1501 TOWER VIEW CIR NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA 98383	Facility Type	Residential Care

On 05/24/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Working Space and Clearance

A working space of not less than 30 inches (762 mm) in width, 36 inches (914 mm) in depth and 78 inches (1981 mm) in height shall be provided in front of electrical service equipment. Where the electrical service equipment is wider than 30 inches (762 mm), the working space shall be not less than the width of the equipment. Storage of materials shall not be located within the designated working space.

Exceptions:

1. Where other dimensions are required or allowed by NFPA 70.
2. Access openings into attics or under-floor areas that provide a minimum clear opening of 22 inches (559 mm) by 30 inches (762 mm).

(IFC 604.3 2018)

Findings during the inspection were:

Facility failed to maintain electrical panel in kitchen, blocked by various items.

2 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2009, 2012, 2015, 2018)

Findings during the inspection were:

Facility failed to provide documentation showing quarterly inspections of sprinkler system.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Ridge an Encore Community (The)	Provider Number	2231
Address	1501 TOWER VIEW CIR NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA 98383	Facility Type	Residential Care

On 05/24/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

3 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.

2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:

2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.

2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.

2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.

2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.

2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.

3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2015, 2018)

Findings during the inspection were:

Facility failed to maintain K extinguisher in kitchen, no annual inspection conducted.

4 Single- and Multiple- Station Smoke Alarms

Listed single- and multiple-station smoke alarms complying with UL 217 shall be installed in accordance with Sections 907.2.10.1 through 907.2.10.7 and NFPA 72.

(IFC 907.2.10 2018)

Findings during the inspection were:

Facility failed to maintain smoke detector by room B6, smoke detector less than 3 feet from vent.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Ridge an Encore Community (The)	Provider Number	2231
Address	1501 TOWER VIEW CIR NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA 98383	Facility Type	Residential Care

On 05/24/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.

(IFC 907.8.3 2012, 2015, 2018)

Findings during the inspection were:

Facility failed to provide documentation showing sensitivity test has been conducted for the fire alarm system.

6 Inspection and Maintenance

Fire department connections shall be periodically inspected, tested and maintained in accordance with NFPA 25. Records of inspection, testing and maintenance shall be maintained.

(IFC 912.7 2018)

Findings during the inspection were:

Facility failed to provide documentation showing fire department connection five-year hydrostatic test.

7 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2018)

Findings during the inspection were:

Facility failed to provide documentation showing annual 1.5 hour (90 minute) power test for exit signs and emergency lighting.

8 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2018)

Findings during the inspection were:

Facility failed to provide documentation showing annual servicing of generator.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Ridge an Encore Community (The)	Provider Number	2231
Address	1501 TOWER VIEW CIR NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA 98383	Facility Type	Residential Care

On 05/24/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

Next inspection scheduled on or after: 06/27/2023

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

NOT AVAILABLE
Signature

Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067

[Signature]
Signature

This document was prepared by Residential Care Services for the Locator website.