



 
Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

 
Business Name	South Pointe Assisted Living	Provider Number	2610
Address	10330 4TH AVE W,	Approval Status	Approved
City, State, Zip	Everett, WA 98204	Facility Type	Residential Care

On 09/23/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

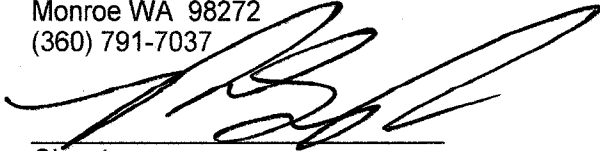
All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	South Pointe Assisted Living	Provider Number	2610
Address	10330 4TH AVE W,	Approval Status	Disapproved
City, State, Zip	Everett, WA 98204	Facility Type	Residential Care

On 08/19/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A. (IFC 0603.5.1, 2021)	1. There was multi-plug adapter that does not have over current protection in use in room 215 2. There was multi-plug adapter that does not have over current protection in use in room 217
--	--

2 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3. (IFC 606.3.3 2021)	Facility is unable to provide documentation for the semi-annual hood cleaning.
---	--

3 Smoke Barriers

The fire-resistance rating and smoke-resistant characteristics of smoke barriers shall be maintained. (IFC 701.3 2021)	1. There was a 5 feet by 12 feet hole in the ceiling of room 119 where a leak has been repaired but the ceiling fire barrier has not been repaired. There was a 12 feet by 12 feet hole in the ceiling of the beauty shop where a leak has been repaired but the ceiling fire barrier has not been repaired.
---	---

4 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2018 WAC 51-54A)	Facility is unable to provide documentation that the annual fire resistance rated construction material inspection has been completed.
---	--



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name South Pointe Assisted Living
Address 10330 4TH AVE W,
City, State, Zip Everett, WA 98204

Provider Number 2610
Approval Status Disapproved
Facility Type Residential Care

On 08/19/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The fire rated door from the resident laundry room to the corridor would not close and latch from a fully open position.

6 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

1. As per documents provided the annual sprinkler inspection had deficiencies noted that have not been corrected.

2. Facility is unable to provide documentation for the 5 year internal piping inspection.

7 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

As per documents provided the semi-annual kitchen suppression system inspection had deficiencies noted that have not been corrected.

8 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

The power breaker #28 in panel P-3 for the fire alarm system is missing locking device.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name South Pointe Assisted Living
Address 10330 4TH AVE W,
City, State, Zip Everett, WA 98204

Provider Number 2610
Approval Status Disapproved
Facility Type Residential Care

On 08/19/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

9 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.

(IFC 907.8.3 2021)

Facility is unable to provide documentation for the required smoke detector sensitivity testing. No nuisance log is being maintained.

10 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2021 WAC)

Facility is unable to provide documentation for the monthly carbon monoxide detector testing.

11 Means of Egress Continuity

The path of egress travel along a means of egress shall not be interrupted by any building element other than a means of egress component as specified in this chapter. Obstructions shall not be placed in the minimum width or required capacity of a means of egress component except projections permitted by this chapter. The minimum width or required capacity of a means of egress system shall not be diminished along the path of egress travel.

(IFC 1003.6 2021)

There was a trash and supplies blocking the emergency exit in the rear exit pathway (sidewalk) near the sprinkler room.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name South Pointe Assisted Living
Address 10330 4TH AVE W,
City, State, Zip Everett, WA 98204

Provider Number 2610
Approval Status Disapproved
Facility Type Residential Care

On 08/19/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

12 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.

(IFC 1032.10.1 2021)

Facility is unable to provide documentation for the monthly 30 second activation test for the emergency lights.

13 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Facility is unable to provide documentation for the annual 90 minute power test for the emergency lights.

14 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

1. Oxygen cylinders in room #221 are not secured to prevent the cylinders from falling.

2. Oxygen cylinders in room #218 are not secured to prevent the cylinders from falling.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name South Pointe Assisted Living
Address 10330 4TH AVE W,
City, State, Zip Everett, WA 98204

Provider Number 2610
Approval Status Disapproved
Facility Type Residential Care

On 08/19/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

15 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.
(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.
(2) A detailed written record of all fire drills shall be maintained and available for inspection.
(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

Facility cannot provide documentation for the completion of twelve planned and unannounced fire drills in the previous 12 months.

The following Drills are missing.
1st Shift - Quarter 2 and 3
2nd Shift - Quarter 1, 2 and 4
3rd Shift - Quarter 1, 2 and 4

Next inspection scheduled on or after: 09/18/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037

Signature

Initials of Authorized Facility Representative: _____