



 
Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Weatherly Inn - Renton	Provider Number	2670
Address	4550 TALBOT RD S,	Approval Status	Approved
City, State, Zip	Renton, WA 98055	Facility Type	Residential Care

On 10/07/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Cozetta Christian
2502 112TH E
Tacoma WA 984455104
(360) 584-5796


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Administration

On 08/21/2024 an unannounced Fire and Life Safety Code re-inspection was conducted at Weatherly Inn - Renton by a representative of the Washington State Patrol, State Fire Marshal's Office to determine compliance with all applicable codes.

The following deficiencies were cited as a result of this re-inspection:

2 Installation

Relocatable power tap cords shall not extend through walls, ceilings, floors, under doors or floor coverings, or be subject to environmental or physical damage.

(IFC 603.5.3, 2021)

Corrected

3 Records

Records for inspections shall state the individual and company performing the inspection, a description of the inspection and when the inspection took place. Records for cleanings shall state the individual and company performing the cleaning and when the cleaning took place. Such records shall be completed after each inspection or cleaning and maintained.

(IFC 606.3.3.3 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Weatherly Inn - Renton	Provider Number	2670
Address	4550 TALBOT RD S,	Approval Status	Disapproved
City, State, Zip	Renton, WA 98055	Facility Type	Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Corrected

5 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.

(IFC 703.1 2021)

The following violation was observed at the time of re-inspection:

The furnace closet in the Activity room has a penetration in the wall. - 3rd floor

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

The following violation was observed at the time of re-inspection:

The facility had a partial fire door inspection. The facility will need to complete a full inspection of all fire doors by next re-inspection.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton

Address 4550 TALBOT RD S,

City, State, Zip Renton, WA 98055

Provider Number 2670

Approval Status Disapproved

Facility Type Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

7 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The following violation was observed at the time of re-inspection:

The following cross corridors did not close / latch properly when tested:

1. Cross corridor W4B - 4th floor
2. Tea room door A - by reception

8 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.

(IFC 706.1 2018)

Corrected

9 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following violation was observed at the time of re-inspection:

The facility was unable to provide documentation for the following:

1. Forward flow
2. Quarterly sprinkler inspections - scheduled for 8/26/24

10 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton

Address 4550 TALBOT RD S,

City, State, Zip Renton, WA 98055

Provider Number 2670

Approval Status Disapproved

Facility Type Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Hangers and Brackets

Hand-held portable fire extinguishers, not housed in cabinets, shall be installed on the hangers or brackets supplied. Hangers or brackets shall be securely anchored to the mounting surface in accordance with the manufacturer's installation instructions.

(IFC 906.7 2021)

Corrected

12 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Corrected

13 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.

(IFC 907.8.3 2021)

The following violation was observed at the time of re-inspection:

The facility was unable to provide documentation for their last smoke detector sensitivity test report.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton

Address 4550 TALBOT RD S,

City, State, Zip Renton, WA 98055

Provider Number 2670

Approval Status Disapproved

Facility Type Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

14 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 720. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2018)

Corrected

15 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The following violation was observed at the time of re-inspection:

The facility was unable to provide documentation for the following:

1. Annual generator - waiting on report
2. Weekly generator inspections - facility said the generator needs to be programmed first.

16 Inspection Frequency

Fire extinguishers shall be inspected when initially placed in service and thereafter at approximately 30-day intervals. Fire extinguishers shall be inspected, manually or by electronic monitoring, at more frequent intervals when circumstances require.

(NFPA Standard 10 Section 6.2.1)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Business Name Weatherly Inn - Renton

Address 4550 TALBOT RD S,

City, State, Zip Renton, WA 98055

Provider Number 2670

Approval Status Disapproved

Facility Type Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

17 Circuit identification and Accessibility

10.6.5.2 Circuit Identification and Accessibility.
10.6.5.2.1 The location of the branch circuit disconnecting means shall be permanently identified at the control unit.
10.6.5.2.2 System circuit disconnecting means shall be permanently identified as to its purpose in accordance with the following:
(1) "FIRE ALARM" for fire alarm systems
(2) "EMERGENCY COMMUNICATIONS" for emergency communications systems
(3) "FIRE ALARM/ECS" for combination fire alarm and emergency communications systems
10.6.5.2.3 For fire alarm and/or signaling systems, the circuit disconnecting means shall have a red marking.
10.6.5.2.4 The red marking shall not damage the overcurrent protective devices or obscure the manufacturer's markings.
10.6.5.2.5 The circuit disconnecting means shall be accessible only to authorized personnel.
10.6.5.3 Mechanical Protection. The branch circuit(s) and connections shall be protected against physical damage.
10.6.5.4 Circuit Breaker Lock. Where a circuit breaker is the disconnecting means, a listed breaker locking device shall be installed.
10.6.5.5 Overcurrent Protection. An overcurrent protective device of suitable current-carrying capacity that is capable of interrupting the maximum short-circuit current to which it can be subject shall be provided in each ungrounded conductor.

(NFPA 72 10.6.5.2)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton

Address 4550 TALBOT RD S,

City, State, Zip Renton, WA 98055

Provider Number 2670

Approval Status Disapproved

Facility Type Residential Care

On 08/21/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

18 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state, at least twelve planned and unannounced fire drills shall be held every year. Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. A detailed written record of all fire drills shall be maintained and available for inspection at all times. When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms. Fire drills shall include the transmission of a fire alarm signal and simulation of emergency conditions. The fire alarm monitoring company shall be notified prior to the activation of the fire alarm system for drill purposes and again at the conclusion of the transmission and restoration of the fire alarm system to normal mode.

(WAC 212-12-044)

Corrected

Next inspection scheduled on or after: 09/20/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

AVERY WASHINGTON MAINTENANCE
Print Name and Title

Deputy State Fire Marshal Cozetta Christian
2502 112TH E
Tacoma WA 984455104
(360) 584-5796


Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Administration

	On 07/1/2024 an unannounced Fire and Life Safety Code inspection was conducted at Weatherly Inn - Renton by a representative of the Washington State Patrol, State Fire Marshal's Office to determine compliance with all applicable codes. The following deficiencies were cited as a result of this inspection:
--	---

2 Installation

Relocatable power tap cords shall not extend through walls, ceilings, floors, under doors or floor coverings, or be subject to environmental or physical damage. (IFC 603.5.3. 2021)	The following violation was observed at the time of inspection: The facility has a power strip that has been tied up and is dangling by it's cord. - In the front reception area by the lamps.
--	--

3 Records

Records for inspections shall state the individual and company performing the inspection, a description of the inspection and when the inspection took place. Records for cleanings shall state the individual and company performing the cleaning and when the cleaning took place. Such records shall be completed after each inspection or cleaning and maintained. (IFC 606.3.3.3 2021)	The following violation was observed at the time of inspection: The facility was unable to provide documentation for their annual and semi annual hood cleaning. All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide record of their annual fire wall inspection and/or repairs for all fire-resistant-rated construction.

5 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.

(IFC 703.1 2021)

The following violation was observed at the time of inspection:

The following locations have penetrations in the walls:

1. Electrical room - by 322
2. Furnace closet - Activity room - 3rd floor
3. Outside - Electrical room
4. Furnace closet - Fireside room - 2nd floor

The following locations have unsealed conduits:

1. Electrical room 469
2. Electrical room - by 322
3. Outside Electrical room

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80.
Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105.
Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide inventory record of their annual inspection and/or repairs for all fire-resistant-rated doors.

The following locations have penetrations in the fire doors:

1. Resident Laundry 374 - 3rd floor
2. Kitchen door

7 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The following violation was observed at the time of inspection:

The following doors did not close / latch properly when tested:

1. Cross corridor W4B - 4th floor
2. Conference room door - 2nd floor by patio exit
3. Outside Electrical room door
4. Cross corridor W2A - by 233
5. Cross corridor S2A - by 225
6. Tea room door A - by reception
7. Cross corridor W1B - by 111

This document was prepared by Residential Care Services for the Locator website.



Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.

(IFC 706.1 2018)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation for their last fire/smoke damper testing.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

19.4 Periodic Inspection and Testing.

19.4.1 Each damper shall be tested and inspected 1 year after installation.

19.4.1.1 The test and inspection frequency shall then be every 4 years, except in hospitals, where the frequency shall be every 6 years.

9 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation for the following:

1. Forward flow test
2. Quarterly sprinkler inspections

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

10 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide service reports showing that the kitchen suppression system has been serviced annually and semi-annually in the past 12 months.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Hangers and Brackets

Hand-held portable fire extinguishers, not housed in cabinets, shall be installed on the hangers or brackets supplied. Hangers or brackets shall be securely anchored to the mounting surface in accordance with the manufacturer's installation instructions.

(IFC 906.7 2021)

The following violation was observed at the time of inspection:

The Class K extinguisher in the kitchen was sitting on a table shelf instead of being properly mounted.

12 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation for their annual fire alarm servicing.

13 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.

(IFC 907.8.3 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation for their last smoke detector sensitivity test report--due one year after installation.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

14 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 720. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2018)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation showing that testing of their CO detectors have been performed in the past 12 months.

15 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation for the following:

1. Annual generator servicing
2. Weekly generator inspections
3. Monthly 30 min load test

16 Inspection Frequency

Fire extinguishers shall be inspected when initially placed in service and thereafter at approximately 30-day intervals. Fire extinguishers shall be inspected, manually or by electronic monitoring, at more frequent intervals when circumstances require.

(NFPA Standard 10 Section 6.2.1)

The following violation was observed at the time of inspection:

The fire extinguishers on floor 3 and 2 floor did not have the required monthly inspection for June.

The Elevator Mechanical room (room 161) extinguisher did not receive any monthly inspections.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

17 Circuit identification and Accessibility

10.6.5.2 Circuit Identification and Accessibility.
10.6.5.2.1 The location of the branch circuit disconnecting means shall be permanently identified at the control unit.
10.6.5.2.2 System circuit disconnecting means shall be permanently identified as to its purpose in accordance with the following:
(1) "FIRE ALARM" for fire alarm systems
(2) "EMERGENCY COMMUNICATIONS" for emergency communications systems
(3) "FIRE ALARM/ECS" for combination fire alarm and emergency communications systems
10.6.5.2.3 For fire alarm and/or signaling systems, the circuit disconnecting means shall have a red marking.
10.6.5.2.4 The red marking shall not damage the overcurrent protective devices or obscure the manufacturer's markings.
10.6.5.2.5 The circuit disconnecting means shall be accessible only to authorized personnel.
10.6.5.3 Mechanical Protection. The branch circuit(s) and connections shall be protected against physical damage.
10.6.5.4 Circuit Breaker Lock. Where a circuit breaker is the disconnecting means, a listed breaker locking device shall be installed.
10.6.5.5 Overcurrent Protection. An overcurrent protective device of suitable current-carrying capacity that is capable of interrupting the maximum short-circuit current to which it can be subject shall be provided in each ungrounded conductor.

(NFPA 72 10.6.5.2)

The following violation was observed at the time of inspection:

Unable to locate the fire alarm breaker in the facility. The facility will need to locate and identify the breaker. The fire alarm breaker will need a fire alarm lockout device, locking it into the "on" position.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name Weatherly Inn - Renton
Address 4550 TALBOT RD S,
City, State, Zip Renton, WA 98055

Provider Number 2670
Approval Status Disapproved
Facility Type Residential Care

On 07/01/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

18 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state, at least twelve planned and unannounced fire drills shall be held every year. Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. A detailed written record of all fire drills shall be maintained and available for inspection at all times. When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms. Fire drills shall include the transmission of a fire alarm signal and simulation of emergency conditions. The fire alarm monitoring company shall be notified prior to the activation of the fire alarm system for drill purposes and again at the conclusion of the transmission and restoration of the fire alarm system to normal mode.

(WAC 212-12-044)

The following violation was observed at the time of inspection:

The facility was unable to provide documentation for the completion of twelve planned and unannounced fire drills in the previous 12 months.

Next inspection scheduled on or after: 07/31/2024

 
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

AVERY WASHINGTON MAINTENANCE DIRECTOR
Print Name and Title

Deputy State Fire Marshal Cozetta Christian
2502 112TH E
Tacoma WA 984455104
(360) 584-5796


Signature