 
 


NAME OF FACILITY	FACILITY ADDRESS	DATE OF SURVEY
Pointe Frontier Retirement Community	1406 Prairie Avenue Cheyenne, WY 82009	1/21/2009
SUMMARY OF DEFICIENCY	FACILITY PLAN OF CORRECTION	FACILITY COMPLETION DATE
A survey was conducted at your facility on January 21, 2009, by the Office of Healthcare Licensing and Surveys, (OHLS). Rules and Regulations for Licensure of Assisted Living Facilities Section 10. Life Safety and Electrical Safety. The requirements in the Department of Health Chapter III, Construction Rules for Health Facilities apply. (ii) Assisted Living Facilities operating prior to the effective date of these rules, shall meet the Life Safety Code of the National Fire Protection Association that was in effect at the time the facility was licensed as an Assisted Living Facility. <i>This regulation was NOT MET as evidence by:</i> A. Based on observation and staff interview the facility failed to ensure manual fire alarm stations were unobstructed in two of five smoke compartments. The findings were: Observation on 1/21/09 between 10 AM and 11:30 AM revealed the manual fire alarm pull station near the west and east nurses' stations were obstructed by straight backed chairs. Interview with the plant operations director at the time of observation revealed the pull stations were inspected monthly, and each month the stations were blocked due to residents moving the chairs. <i>"Reference NFPA 101 Life Safety Code, 1994"</i>	POC TESTED W/ JAMES OLIVER. C.M. on 2/19/09.  PLAN of CORRECTION: All chairs have been removed away from the manual fire alarm pull stations on the East and West side of the community. Our Plant Operations Director and Housekeeping will monitor each day to ensure compliance. Plant Operation Director will provide written instruction to our nursing staff for further compliance.	22 Jan 09

 (13 FEB 09)
Provider Representative's Signature/Title

RECEIVED
Wyoming Dept of Health

13 FEB 09
Date

NAME OF FACILITY	FACILITY ADDRESS	DATE OF SURVEY
Pointe Frontier Retirement Community	1406 Prairie Avenue Cheyenne, WY 82009	1/21/2009 <i>[Signature]</i> 2/18/09
C. Based on observation and staff interview the facility failed to ensure sprinklers were unobstructed in three of five smoke compartments. The findings were: 1. Observation on 1/21/09 between 9:30 AM and 11 AM revealed the following sprinklers spray patterns were obstructed: Three sprinklers in the dining room were obstructed by fluorescent lights. The bottom edges of the lights were lower than the sprinklers and were located within twelve inches of the sprinklers. The sprinklers in the living rooms of resident room #31 and #26 were obstructed by smoke detectors. The bottom edges of the detectors were lower than the sprinklers and were located within twelve inches of the sprinklers. 2. Interview with the plant operations director on 1/21/09 at 9:50 AM revealed the sprinkler system had not been inspected at least annually. <i>"Reference NFPA 101 Life Safety Code, 1994 Edition:"</i> <i>"23.3.3.5.1 Automatic Extinguishing Systems. Where an automatic sprinkler system is installed either for total or partial building coverage, the system shall be installed in accordance with Section 7-7..."</i> <i>"7-7.1.1 Each automatic sprinkler system required by another section of this Code shall be installed in accordance with NFPA 13 Standard for the Installation of Sprinkler Systems...."</i> <i>"NFPA 13, Standard for the Installation of Sprinkler Systems, 1994 Edition:"</i> <i>5-6.5.1.2 Distance from sprinkler to side of obstruction.</i> <i>0-1 foot from obstruction...allowable distance above the bottom of the obstruction 0 inches.</i> D. Based on observation and staff interview	<u>PLAN OF CORRECTION:</u> Each fluorescent light and smoke detectors will be adjusted to meet NFPA specifications. Estimated Smoke detectors in Apartments #31 & 26 will be adjusted to meet NFPA specifications. Outside contractor has been hired to perform the work. Quarterly contract Inspections and Plant Operation Director will maintain records of all inspections. These inspection will ensure proper distance and Compliance.	20 MAR 2009