



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Country Meadow Village
Address 1501 COLLINS RD ,
City, State, Zip Sedro-Woolley, WA

Provider Number 001020
Approval Status Approved
Facility Type Residential Care

On 08/28/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

S. Cortez
Signature

Susan Cortez Maintenance
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037

[Signature]
Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Country Meadow Village
Address 1501 COLLINS RD ,
City, State, Zip Sedro-Woolley, WA 98284

Provider Number 001020
Approval Status Disapproved
Facility Type Residential Care

On 06/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

Facility is unable to provide documentation for the previous 2 semi-annual hood cleaning.

2 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

1. The fire rated cross corridor door near room 611 would not close and latch from the fully open position.
2. Resident room 105 fire door would not close and latch from the fully open position.
3. The fire rated door from the laundry room near 205 to the corridor would not close and latch from a fully open position.

3 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25.

4 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.

(IFC 907.8.3 2021)

Facility is unable to provide documentation for the required smoke detector sensitivity testing.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Country Meadow Village	Provider Number	001020
Address	1501 COLLINS RD ,	Approval Status	Disapproved
City, State, Zip	Sedro-Woolley, WA 98284	Facility Type	Residential Care

On 06/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes. (IFC 1031.10.2 2021)	Facility is unable to provide documentation for the annual 90 minute power test for the emergency lights. Outside vendor conducted a load test which does not meet the testing requirement.
---	---

6 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods: 1. Securing containers, cylinders and tanks to a fixed object with one or more restraints. 2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks. 3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress. 4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use. Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing. (IFC 5303.5.3 2021)	5 oxygen cylinders in room 614 are not secured to prevent the cylinders from falling.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Country Meadow Village
Address 1501 COLLINS RD,
City, State, Zip Sedro-Woolley, WA 98284

Provider Number 001020
Approval Status Disapproved
Facility Type Residential Care

On 06/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

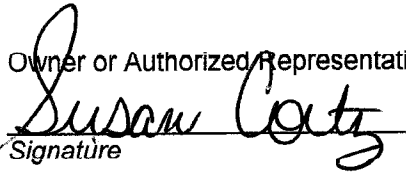
Code Requirement

Statement of Violation

Next inspection scheduled on or after: 07/23/2025

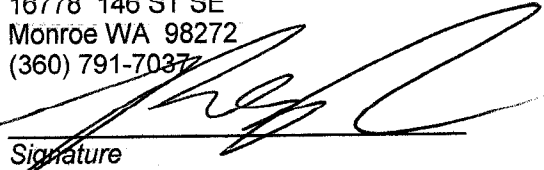
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Susan Cortez Maintenance
Print Name and Title Director

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

This document was prepared by Residential Care Services for the Locator website.