



Washington State Patrol
Fire Protection Bureau

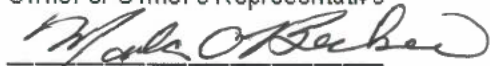
Phone: (360) 596-3900

Business Name	Aljoya Mercer Island	Provider Number	2019
Address	2430 76TH AVE SE,	Approval Status	Approved
City, State, Zip	Mercer Island, WA	Facility Type	Residential Care

On 04/30/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

Marla A. Becker EID
Print Name and Title

Deputy State Fire Marshal Kimberly Bloor
PO Box 42600
Olympia WA 985042600
(360) 596-3922

Kimberly Bloor Digitally signed by Kimberly Bloor
Date: 2026.05.01 15:01:35 -07'00'
Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aljoya Mercer Island	Provider Number 2019
Address 2430 76TH AVE SE,	Approval Status Disapproved
City, State, Zip Mercer Island, WA 98040	Facility Type Residential Care

On 03/10/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A.

(IFC 603.5.1, 2021)

Findings during the inspection were:

Multi plug power taps were found in the following locations:

1. Multiple in Room 510
2. Room 309

*The facility will need to verify whether these are UL listed..

2 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle.

Exceptions:

1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment.

2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices.

(IFC 603.5.2, 2021)

Findings during the inspection were:

In Room 510, multiple relocatable power taps were plugged into other relocatable power taps.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aljoya Mercer Island	Provider Number	2019
Address	2430 76TH AVE SE,	Approval Status	Disapproved
City, State, Zip	Mercer Island, WA 98040	Facility Type	Residential Care

On 03/10/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

3 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors.. (IFC 603.6 2021)	Findings during the inspection were: Extension cord used as permanent wiring in the following locations: 1. Room 536 2. 2nd Floor Gallery Bistro
---	---

4 Listed and Labeled

Only listed and labeled portable, electric space heaters shall be used. (IFC 603.9.1, 2021)	Corrected
--	-----------

5 Inspection

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be inspected at intervals specified in Table 607.3.3.1 or as approved by the fire code official. Inspections shall be completed by qualified individuals. (IFC 606.3.3.1 2021)	Corrected
--	-----------

6 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions. (IFC 606.4 2021)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aljoya Mercer Island	Provider Number 2019
Address 2430 76TH AVE SE,	Approval Status Disapproved
City, State, Zip Mercer Island, WA 98040	Facility Type Residential Care

On 03/10/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

7 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.

Corrected

(IFC 703.1 2021)

8 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

Findings during the inspection were:

The following fire doors did not close and latch properly due to being propped open:

1. Private Dining into Kitchen
2. Employee lounge

(IFC 705.2 2021)

9 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Findings during the inspection were:

1) The facility was unable to provide documentation on the following inspection, testing and maintenance reports:

1. 5 year Fire Department Connection Hydro Test
- 2) Loaded sprinkler head in front Kitchen grill.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aljoya Mercer Island
Address 2430 76TH AVE SE,
City, State, Zip Mercer Island, WA 98040

Provider Number 2019
Approval Status Disapproved
Facility Type Residential Care

On 03/10/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

10 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.

2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:

2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.

2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.

2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.

2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.

2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.

3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Corrected

11 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aljoya Mercer Island
Address 2430 76TH AVE SE,
City, State, Zip Mercer Island, WA 98040

Provider Number 2019
Approval Status Disapproved
Facility Type Residential Care

On 03/10/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

12 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Corrected

13 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Corrected

14 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aljoya Mercer Island
Address 2430 76TH AVE SE,
City, State, Zip Mercer Island, WA 98040

Provider Number 2019
Approval Status Disapproved
Facility Type Residential Care

On 03/10/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

15 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state, at least twelve planned and unannounced fire drills shall be held every year. Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. A detailed written record of all fire drills shall be maintained and available for inspection at all times. When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms. Fire drills shall include the transmission of a fire alarm signal and simulation of emergency conditions. The fire alarm monitoring company shall be notified prior to the activation of the fire alarm system for drill purposes and again at the conclusion of the transmission and restoration of the fire alarm system to normal mode.

(WAC 212-12-044)

Findings during the inspection were:

The facility was unable to provide documentation confirming completion of required fire drills for the following quarters and shifts:

Q4: Day and Night Shifts, paperwork not completed properly.

Next inspection scheduled on or after: 04/09/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121

Signature