



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Stanwood
Address 7212 265th ST ,
City, State, Zip Stanwood, WA

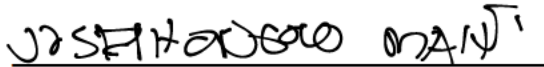
Provider Number 2276
Approval Status Approved
Facility Type Residential Care

On 01/14/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

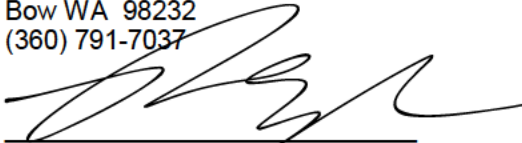
All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title
JOSEPH ANGELO
8M9

Deputy State Fire Marshal Brandon G. Brown
MP 235 SB Interstate 5
Bow WA 98232
(360) 791-7037


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Stanwood
Address 7212 265th ST ,
City, State, Zip Stanwood, WA

Provider Number 2276
Approval Status Disapproved
Facility Type Residential Care

On 11/17/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5.

(IFC 315.2.3 2021)

There was combustible storage within the elevator equipment room.

2 Attic, Under-Floor & Concealed Spaces - Storage in Buildings

Attic, under-floor and concealed spaces used for storage of combustible materials shall be protected on the storage side as required for 1-hour fire-resistance-rated construction. Openings shall be protected by assemblies that are self-closing and are of noncombustible construction or solid wood core not less than 1 3/4 inches (44.5 mm) in thickness. Storage shall not be placed on exposed joists.

Exceptions:

1. Areas protected by approved automatic sprinkler systems.
2. Group R-3 and Group U occupancies.

(IFC 315.3.4 2015, 2018)

There was combustible storage under the stairs on the 1st floor stairwell near 161.

3 Equipment and Fixtures

Equipment and wiring. All electrical equipment, wiring, devices and appliances shall be tested; listed and labeled; and installed, used and maintained in accordance with NFPA 70 and all instructions included as part of such listing.

(IFC 603.1.1, 2021)

The light cover was missing from the light fixture in the stairwell near 253, exposing the electrical wiring.

4 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

There was a spliced wire not in a junction box for the overhead light in the janitor closet near 207.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Stanwood
Address 7212 265th ST ,
City, State, Zip Stanwood, WA

Provider Number 2276
Approval Status Disapproved
Facility Type Residential Care

On 11/17/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

There was an extension cord utilized as permanent wiring in the kitchen.

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Resident room 316 fire door that opens to the corridor was blocked open using a rock, preventing it from closing and latching.

7 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

1. Facility is unable to provide documentation for the annual sprinkler system inspection.

2. Facility is unable to provide documentation for the 3 year dry system full flow trip test.

8 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Facility is unable to provide documentation for the annual fire alarm system testing.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Stanwood

Provider Number 2276

Address 7212 265th ST ,

Approval Status Disapproved

City, State, Zip Stanwood, WA

Facility Type Residential Care

On 11/17/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

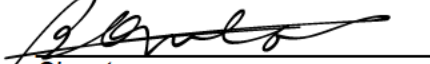
Code Requirement

Statement of Violation

Next inspection scheduled on or after: 12/17/2025

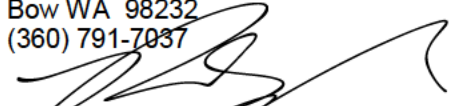
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

BONICNO OSUKU CALVO
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
MP 235 SB Interstate 5
Bow WA 98232
(360) 791-7037


Signature

This document was prepared by Residential Care Services for the Locator website.