



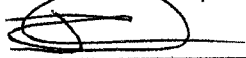
Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Everett	Provider Number	2285
Address	11333 3RD PL W,	Approval Status	Approved
City, State, Zip	Everett, WA 98204	Facility Type	Residential Care

On 04/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

John Domann
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Everett	Provider Number 2285
Address 11333 3RD PL W,	Approval Status Disapproved
City, State, Zip Everett, WA 98204	Facility Type Residential Care

On 03/03/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated..

(IFC 603.2 2021)

No cover for the outlet to the left of the Executive Director's desk.

2 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A.

(IFC 0603.5.1, 2021)

Relocatable power taps does not have current over protection in the following locations:

1. Salon
2. two in the clean linen

3 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle.

Exceptions:

1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment.
2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices.

(IFC 603.5.2, 2021)

There is a power strip plugged into another power strip in the clean linen room.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Everett
Address 11333 3RD PL W,
City, State, Zip Everett, WA 98204

Provider Number 2285
Approval Status Disapproved
Facility Type Residential Care

On 03/03/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
4 Extension Cords	
Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors.. (IFC 603.6 2021)	Extension cord in use as permeant wiring in the clean linen room.
5 Inspection and Maintenance	
Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	Deficiencies found on 11/1/24 during fire door annual inspection was not corrected.
6 Door Operation	
Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	The following doors did not latch while testing the fire doors: 1. Room 105 2. Room 229 3. Dinning room
7 Testing and Maintenance	
Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	Loaded fire sprinkler head found in the laundry room near room 110.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Everett
Address 11333 3RD PL W,
City, State, Zip Everett, WA 98204

Provider Number 2285
Approval Status Disapproved
Facility Type Residential Care

On 03/03/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

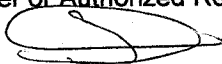
(IFC 907.8 2021)

Circuit break for fire alarm panel number 10 and 12 in Panel XP is not locked.

Next inspection scheduled on or after: 04/02/2025

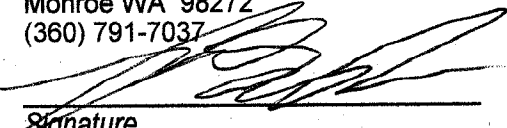
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

John Domann MM
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

This document was prepared by Residential Care Services for the Locator website.