



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Mountain Glen Retirement Center	Provider Number	2328
Address	1810 Division ST ,	Approval Status	Disapproved
City, State, Zip	Mount Vernon, WA	Facility Type	Residential Care

On 05/06/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5.

(IFC 315.2.3 2021)

Corrected

2 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated..

(IFC 603.2 2021)

Electrical panel in the electrical room near 423 has the wrong face plate installed which allows access to electrical components behind the face plate.

3 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

Corrected

4 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Mountain Glen Retirement Center

Provider Number 2328

Address 1810 Division ST ,

Approval Status Disapproved

City, State, Zip Mount Vernon, WA

Facility Type Residential Care

On 05/06/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

The following resident room fire door that opens to the corridor was blocked open using various items, preventing it from closing and latching:

- a. 507 has a trash can in doorway
- b. 543 using a door wedge
- c. 429 using a door wedge

6 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The fire rated door from the stairwell to the corridor near 421 has a disabled door closure.

7 Access

Automatic sprinkler system risers, fire pumps and controllers shall be provided with ready access. Where located in a fire pump room or automatic sprinkler system riser room, the door shall be permitted to be locked provided that the key is available at all times.

(IFC 901.4.7.1 2018)

Corrected

8 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Corrected

9 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Mountain Glen Retirement Center	Provider Number	2328
Address	1810 Division ST ,	Approval Status	Disapproved
City, State, Zip	Mount Vernon, WA	Facility Type	Residential Care

On 05/06/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

10 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10. Exceptions: 1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies. 2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met: 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed. 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal. 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment. 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed. 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10. 3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations. (IFC 906.2 2021)	Corrected
---	-----------

11 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Mountain Glen Retirement Center

Provider Number 2328

Address 1810 Division ST ,

Approval Status Disapproved

City, State, Zip Mount Vernon, WA

Facility Type Residential Care

On 05/06/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

12 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.

(IFC 907.8.3 2021)

Facility is unable to provide documentation for the required smoke detector sensitivity testing.

Update: documentation was provided, 117 smoke detectors failed testing. The replacement of smoke detector has been submitted for permits by the vendor.

13 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2021 WAC)

Corrected

14 Internally Illuminated Exit Signs

Electrically powered, self-luminous and photoluminescent exit signs shall be listed and labeled in accordance with UL 924 and shall be installed in accordance with the manufacturer's instructions and Section 1203. Exit signs shall be illuminated at all times.

(IFC 1013.5 2021)

Corrected

15 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Mountain Glen Retirement Center
Address 1810 Division ST,
City, State, Zip Mount Vernon, WA
Provider Number 2328
Approval Status Disapproved
Facility Type Residential Care

On 05/06/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

16 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.

(2) A detailed written record of all fire drills shall be maintained and available for inspection.

(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

Corrected

Next inspection scheduled on or after: 06/05/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

MOLLY CROOK, A-ED
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
MP 235 SB Interstate 5
Bow WA 98232
(360) 791-7037

Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Mountain Glen Retirement Center	Provider Number	2328
Address	1810 Division ST ,	Approval Status	Disapproved
City, State, Zip	Mount Vernon, WA	Facility Type	Residential Care

On 03/31/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5.

(IFC 315.2.3 2021)

There was combustible storage within the mechanical furnace room near 423.

2 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated..

(IFC 603.2 2021)

1. Electrical panel in the electrical room near 423 has the wrong face plate installed which allows access to electrical components behind the face plate.

2. The electrical power cord on the food warmer in the kitchen has been melted by the toaster.

3 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

Facility is unable to provide documentation for the 12 months of semi-annual hood cleanings.

4 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

The gas appliances on casters in the kitchen are not limited by a restraining device.

AMB



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Mountain Glen Retirement Center

Provider Number 2328

Address 1810 Division ST ,

Approval Status Disapproved

City, State, Zip Mount Vernon, WA

Facility Type Residential Care

On 03/31/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

The following resident room fire door that opens to the corridor was blocked open using various items, preventing it from closing and latching:

- a. 507 has a trash can in doorway
- b. 540 using a door wedge
- c. 543 using a door wedge
- d. 429 using a door wedge
- e. 407 has a laundry basket in doorway

6 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

1. The fire rated cross corridor door #22 near room 202 would not close and latch from the fully open position.

2. The fire rated door from the stairwell to the corridor near 421 has a disabled door closure.

7 Access

Automatic sprinkler system risers, fire pumps and controllers shall be provided with ready access. Where located in a fire pump room or automatic sprinkler system riser room, the door shall be permitted to be locked provided that the key is available at all times.

(IFC 901.4.7.1 2018)

There was storage items in the riser room blocking access to the sprinkler system.

8 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

1. Facility is unable to provide documentation for the annual sprinkler system inspection.

2. Facility is unable to provide documentation for the 3 year dry system full flow trip test.

3. Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25.

[Handwritten initials]



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Mountain Glen Retirement Center	Provider Number	2328
Address	1810 Division ST ,	Approval Status	Disapproved
City, State, Zip	Mount Vernon, WA	Facility Type	Residential Care

On 03/31/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

9 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Facility is unable to provide documentation for the semi-annual kitchen suppression system servicing.

10 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Facility was unable to provide the required documentation for monthly fire extinguisher maintenance in accordance with NFPA 10.

HB



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Mountain Glen Retirement Center	Provider Number	2328
Address	1810 Division ST ,	Approval Status	Disapproved
City, State, Zip	Mount Vernon, WA	Facility Type	Residential Care

On 03/31/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
11 Inspection, Testing and Maintenance	
The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Facility is unable to provide documentation for the annual fire alarm system testing.
12 Smoke Detector Sensitivity	
Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed. (IFC 907.8.3 2021)	Facility is unable to provide documentation for the required smoke detector sensitivity testing.
13 Maintenance	
Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Facility is unable to provide documentation for the monthly carbon monoxide detector testing.
14 Internally Illuminated Exit Signs	
Electrically powered, self-luminous and photoluminescent exit signs shall be listed and labeled in accordance with UL 924 and shall be installed in accordance with the manufacturer's instructions and Section 1203. Exit signs shall be illuminated at all times. (IFC 1013.5 2021)	The internally illuminated exit signs A19 near 423 would not illuminate when the activation test button was pushed.

[Signature]



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Mountain Glen Retirement Center	Provider Number	2328
Address	1810 Division ST ,	Approval Status	Disapproved
City, State, Zip	Mount Vernon, WA	Facility Type	Residential Care

On 03/31/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

15 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required. (IFC 1203.4 2021)	Facility is unable to provide documentation for the weekly inspections and Monthly 30 minute full load testing.
--	---

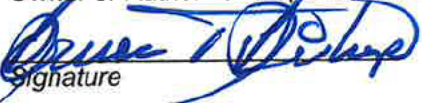
16 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year. (1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. (2) A detailed written record of all fire drills shall be maintained and available for inspection. (3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.	Facility cannot provide documentation for the completion of twelve planned and unannounced fire drills in the previous 12 months. The following Drills are missing. 1st Shift - Quarter 1 and 4 2nd Shift - Quarter 1 and 4 3rd Shift - Quarter 4
---	---

Next inspection scheduled on or after: 05/01/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
MP 235 SB Interstate 5
Bow WA 98232
(360) 791-7037

Brandon Brown Digitally signed by Brandon Brown
Date: 2026.04.01 09:18:47 -07'00'
Signature

