



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Approved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 10/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

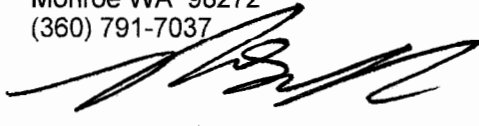
All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

Pamela K Joselyn Kitchen Supervisor
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A.

(IFC 0603.5.1, 2021)

Corrected

2 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle.

Exceptions:

1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment.

2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices.

(IFC 603.5.2, 2021)

There is a power strip plugged into another power strip at the reception desk.

3 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

Corrected

5 Fire-Resistance-Rated Construction

The fire-resistance rating of the following fire-resistance-rated construction shall be maintained:

1. Structural members.
2. Exterior walls.
3. Fire walls, fire barriers, fire partitions.
4. Horizontal assemblies.
5. Shaft enclosures.

(IFC 701.2 2021)

Corrected

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility is unable to provide documentation that the annual fire door inspection has been completed.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

1. Facility is unable to provide documentation for the annual sprinkler system inspection.

2. Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25.

3. The hydraulic calculation placard or pipe schedule system signage is missing from the sprinkler system.

4. Facility replaced all the sprinkler heads a year ago but did not replace the spare sprinkler heads with current heads installed. NFPA 25(2020) - 5.4.1.5

8 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Facility is unable to provide documentation for the semi-annual kitchen suppression system servicing.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

9 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Corrected

10 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Facility is unable to provide documentation for the monthly single station smoke alarm testing.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

11 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2021 WAC)

Corrected

12 Emergency Power for Illumination - General

In the event of power supply failure in rooms and spaces that require two or more exits or access to exits, an emergency electrical system shall automatically illuminate all of the following areas:

1. Aisles
2. Corridors
3. Exit access stairways and ramps

(IFC 1008.3.1 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

13 Lock and Latches

Locks and latches shall be permitted to prevent operation of doors where any of the following exists:

1. Places of detention or restraint.
2. In buildings in occupancy Group A having an occupant load of 300 or less, Groups B, F, M, and S, and in places of religious worship, the main door or doors are permitted to be equipped with key-operated locking devices from the egress side provided:
 - 2.1. The locking device is readily distinguishable as locked;
 - 2.2. A readily visible sign is posted on the egress side on or adjacent to the door stating: THIS DOOR TO REMAIN UNLOCKED WHEN BUILDING IS OCCUPIED. The sign shall be in letters 1 inch (25 mm) high on a contrasting background; and
 - 2.3. The use of the key-operated locking device is revocable by the building official for due cause.
3. Where egress doors are used in pairs, approved automatic flush bolts shall be permitted to be used, provided that the door leaf having the automatic flush bolts has no doorknob or surface-mounted hardware.
4. Doors from individual dwelling or sleeping units of Group R occupancies having an occupant load of 10 or less are permitted to be equipped with a night latch, dead bolt, or security chain, provided such devices are openable from the inside without the use of a key or a tool.
5. Fire doors after the minimum elevated temperature has disabled the unlatching mechanism in accordance with listed fire door test procedures.
6. Doors serving roofs not intended to be occupied shall be permitted to be locked preventing entry to the building from the roof.
7. Approved, listed locks without delayed egress shall be permitted in Group I-1 condition 2 assisted living facilities licensed under chapter 388-78A WAC and Group I-1 Condition 2 residential treatment facilities licensed under chapter 246-337 WAC by the state of Washington, provided that:
 - 7.1. The clinical needs of one or more patients require specialized security measures for their safety.
 - 7.2. The doors unlock upon actuation of the automatic sprinkler system or automatic fire detection system.

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
7.3. The doors unlock upon loss of electrical power controlling the lock or lock mechanism. 7.4. The lock shall be capable of being deactivated by a signal from a switch located in an approved location. 7.5. There is a system, such as a keypad and code, in place that allows visitors, staff persons and appropriate residents to exit. Instructions for exiting shall be posted within six feet of the door. 8. Other than egress courts, where occupants must egress from an exterior space through the building for means of egress, exit access doors shall be permitted to be equipped with an approved locking device where installed and operated in accordance with all of the following: 8.1. The occupant load of the occupied exterior area shall not exceed 300 as determined by IBC Section 1004. 8.2. The maximum occupant load shall be posted where required by Section 1004.9. Such sign shall be permanently affixed inside the building and shall be posted in a conspicuous space near all the exit access doorways. 8.3. A weatherproof telephone or two-way communication system installed in accordance with Sections 1009.8.1 and 1009.8.2 shall be located adjacent to not less than one required exit access door on the exterior side. 8.4. The egress door locking device is readily distinguishable as locked and shall be a key-operated locking device. 8.5. A clear window or glazed door opening, not less than 5 square feet (0.46 m2) sq. ft. in area, shall be provided at each exit access door to determine if there are occupants using the outdoor area. 8.6. A readily visible durable sign shall be posted on the interior side on or adjacent to each locked required exit access door serving the exterior area stating: THIS DOOR TO REMAIN UNLOCKED WHEN THE OUTDOOR AREA IS OCCUPIED. The letters on the sign shall be not less than 1 inch high on a contrasting background. 9. Locking devices are permitted on doors to balconies, decks, or other exterior spaces serving individual dwelling or sleeping units. 10. Locking devices are permitted on doors to balconies,	



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
decks, or other exterior spaces of 250 square feet or less, serving a private office space.oor. (IFC 1010.2.4 2021 WAC 51-54A)	

14 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired. (IFC 1032.10.1 2021)	Corrected
---	-----------

15 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods: 1. Securing containers, cylinders and tanks to a fixed object with one or more restraints. 2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks. 3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress. 4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use. Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing. (IFC 5303.5.3 2021)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 09/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

16 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.

(2) A detailed written record of all fire drills shall be maintained and available for inspection.

(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

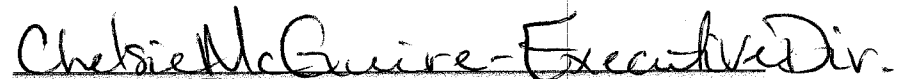
Corrected

Next inspection scheduled on or after: 10/03/2024

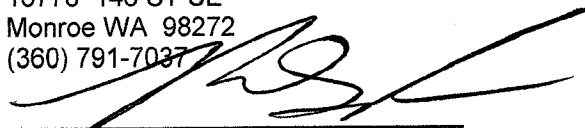
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Chelsie McGuire - Executive Dir.
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A.

(IFC 0603.5.1, 2021)

There was multi-plug adapter that does not have over current protection in use in room 27

2 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle.

Exceptions:

1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment.

2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices.

(IFC 603.5.2, 2021)

1. There is a power strip plugged into another power strip in the resident service directors office.

2. There is a power strip plugged into another power strip at the reception desk.

3 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

1. There was an extension cord utilized as permanent wiring in room 27.

2. There was an extension cord utilized as permanent wiring on the exterior sprinkler piping near the kitchen.

3. There was an extension cord utilized as permanent wiring in the kitchen.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

4 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3. (IFC 606.3.3 2021)	Facility is unable to provide documentation for the semi-annual hood cleaning.
---	--

5 Fire-Resistance-Rated Construction

The fire-resistance rating of the following fire-resistance-rated construction shall be maintained: 1. Structural members. 2. Exterior walls. 3. Fire walls, fire barriers, fire partitions. 4. Horizontal assemblies. 5. Shaft enclosures. (IFC 701.2 2021)	1. The attic access door in the media room is not installed. 2. The attic access door in the fire riser room is not installed.
--	---

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	1. Facility is unable to provide documentation that the annual fire door inspection has been completed. 2. Resident room 27 fire door that opens to the corridor was blocked open by a cabinet, preventing it from closing and latching.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	1. Facility is unable to provide documentation for the annual sprinkler system inspection. 2. Facility is unable to provide documentation for the 5 year internal piping inspection. 3. Facility is unable to provide documentation for the 3 year dry system full flow trip test. 4. Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25. 5. The hydraulic calculation placard or pipe schedule system signage is missing from the sprinkler system. 6. Facility replaced all the sprinkler heads a year ago but did not replace the spare sprinkler heads with current heads installed.
---	---

8 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion. (IFC 904.13.5.2 2021)	Facility is unable to provide documentation for the semi-annual kitchen suppression system servicing.
--	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

9 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10. Exceptions: 1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies. 2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met: 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed. 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal. 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment. 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed. 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10. 3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations. (IFC 906.2 2021)	1. Facility was unable to provide the required documentation for monthly fire extinguisher maintenance in accordance with NFPA 10. 2. The portable fire extinguisher near room 31 is missing the tamper seal. 3. The portable fire extinguisher in laundry is missing the tamper seal.
--	---

10 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	1. Facility is unable to provide documentation for the annual fire alarm system testing. 2. Facility is unable to provide documentation for the monthly single station smoke alarm testing.
---	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

11 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Facility is unable to provide documentation for the monthly carbon monoxide detector testing.
--	---

12 Emergency Power for Illumination - General

In the event of power supply failure in rooms and spaces that require two or more exits or access to exits, an emergency electrical system shall automatically illuminate all of the following areas: 1. Aisles 2. Corridors 3. Exit access stairways and ramps (IFC 1008.3.1 2021)	The emergency egress light near room 1 would not illuminate when the test button was pressed.
---	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

13 Lock and Latches

Locks and latches shall be permitted to prevent operation of doors where any of the following exists:

1. Places of detention or restraint.
2. In buildings in occupancy Group A having an occupant load of 300 or less, Groups B, F, M, and S, and in places of religious worship, the main door or doors are permitted to be equipped with key-operated locking devices from the egress side provided:
 - 2.1. The locking device is readily distinguishable as locked;
 - 2.2. A readily visible sign is posted on the egress side on or adjacent to the door stating: THIS DOOR TO REMAIN UNLOCKED WHEN BUILDING IS OCCUPIED. The sign shall be in letters 1 inch (25 mm) high on a contrasting background; and
 - 2.3. The use of the key-operated locking device is revocable by the building official for due cause.
3. Where egress doors are used in pairs, approved automatic flush bolts shall be permitted to be used, provided that the door leaf having the automatic flush bolts has no doorknob or surface-mounted hardware.
4. Doors from individual dwelling or sleeping units of Group R occupancies having an occupant load of 10 or less are permitted to be equipped with a night latch, dead bolt, or security chain, provided such devices are openable from the inside without the use of a key or a tool.
5. Fire doors after the minimum elevated temperature has disabled the unlatching mechanism in accordance with listed fire door test procedures.
6. Doors serving roofs not intended to be occupied shall be permitted to be locked preventing entry to the building from the roof.
7. Approved, listed locks without delayed egress shall be permitted in Group I-1 condition 2 assisted living facilities licensed under chapter 388-78A WAC and Group I-1 Condition 2 residential treatment facilities licensed under chapter 246-337 WAC by the state of Washington, provided that:
 - 7.1. The clinical needs of one or more patients require specialized security measures for their safety.
 - 7.2. The doors unlock upon actuation of the automatic sprinkler system or automatic fire detection system.

The back gate from the yard is lock from the outside with a padlock, prevent resident and staff from exiting to a safe area.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
7.3. The doors unlock upon loss of electrical power controlling the lock or lock mechanism. 7.4. The lock shall be capable of being deactivated by a signal from a switch located in an approved location. 7.5. There is a system, such as a keypad and code, in place that allows visitors, staff persons and appropriate residents to exit. Instructions for exiting shall be posted within six feet of the door. 8. Other than egress courts, where occupants must egress from an exterior space through the building for means of egress, exit access doors shall be permitted to be equipped with an approved locking device where installed and operated in accordance with all of the following: 8.1. The occupant load of the occupied exterior area shall not exceed 300 as determined by IBC Section 1004. 8.2. The maximum occupant load shall be posted where required by Section 1004.9. Such sign shall be permanently affixed inside the building and shall be posted in a conspicuous space near all the exit access doorways. 8.3. A weatherproof telephone or two-way communication system installed in accordance with Sections 1009.8.1 and 1009.8.2 shall be located adjacent to not less than one required exit access door on the exterior side. 8.4. The egress door locking device is readily distinguishable as locked and shall be a key-operated locking device. 8.5. A clear window or glazed door opening, not less than 5 square feet (0.46 m2) sq. ft. in area, shall be provided at each exit access door to determine if there are occupants using the outdoor area. 8.6. A readily visible durable sign shall be posted on the interior side on or adjacent to each locked required exit access door serving the exterior area stating: THIS DOOR TO REMAIN UNLOCKED WHEN THE OUTDOOR AREA IS OCCUPIED. The letters on the sign shall be not less than 1 inch high on a contrasting background. 9. Locking devices are permitted on doors to balconies, decks, or other exterior spaces serving individual dwelling or sleeping units. 10. Locking devices are permitted on doors to balconies,	

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
decks, or other exterior spaces of 250 square feet or less, serving a private office space.oor. (IFC 1010.2.4 2021 WAC 51-54A)	

14 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired. (IFC 1032.10.1 2021)	Facility is unable to provide documentation for the monthly 30 second activation test for the emergency lights.
---	---

15 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods: 1. Securing containers, cylinders and tanks to a fixed object with one or more restraints. 2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks. 3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress. 4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use. Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing. (IFC 5303.5.3 2021)	5 oxygen cylinders in oxygen strage room are not secured to prevent the cylinders from falling.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Welcome Home (Oak Harbor Senior Memory Care)	Provider Number	2424
Address	235 6TH ,	Approval Status	Disapproved
City, State, Zip	Oak Harbor, WA 98277	Facility Type	Residential Care

On 07/22/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

16 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.

(2) A detailed written record of all fire drills shall be maintained and available for inspection.

(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

Facility cannot provide documentation for the completion of twelve planned and unannounced fire drills in the previous 12 months.

The following Drills are missing.
1st Shift - Quarter 1, 2, and 4
2nd Shift - Quarter 1, 2, and 4
3rd Shift - Quarter 1, 2, and 4

Next inspection scheduled on or after: 08/21/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

M. Word
Signature

Melissa Word LPN, WD
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037

[Signature]
Signature

This document was prepared by Residential Care Services for the Locator website.