



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

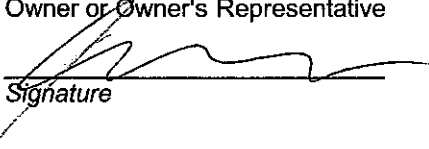
Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Approved
Facility Type Residential Care

On 06/12/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

Jim Nicholson - Maintenance Director
Print Name and Title

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(509) 406-7209

Jason Van Date:
Gorkum 2025.06.12
Signature 12:55:31 -07'00'

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Bellevue	Provider Number	2491
Address	148 102ND AVE SE,	Approval Status	Disapproved
City, State, Zip	Bellevue, WA 98005	Facility Type	Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Administration

Drills shall be held at unexpected times and under varying conditions to simulate the unusual conditions that occur in case of fire.

Exceptions:

1. In severe climates, the fire code official shall have the authority to modify the emergency evacuation drill termination points and frequency.
2. In Groups I-1, I-2, I-3 and R-4, where staff-only emergency evacuation drills are conducted after visiting hours or where care recipients are expected to be asleep, a coded announcement shall be an acceptable alternative to audible alarms.

(IFC 405.5 (2021))

Records shall be maintained of required emergency evacuation drills and include the following information:

1. Identity of the person conducting the drill.
2. Date and time of the drill.
3. Notification method used.
4. Employees on duty and participating.
5. Number of occupants evacuated.
6. Special conditions simulated.
7. Problems encountered.
8. Weather conditions when occupants were evacuated.
9. Time required to accomplish complete evacuation.

(IFC 0405.6 2021)

Where a fire alarm system is provided, emergency evacuation drills shall be initiated by activating the fire alarm system.

(IFC 405.8, 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005
Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

2 Appliance connection to fuel supply piping

Appliance connection to fuel supply piping. Gas cooking appliances shall be secured in place and connected to fuel-supply piping with an appliance connector complying with ANSI Z21.69/CSA 6.16. The connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances shall be limited by restraining devices installed in accordance with the connector and appliance manufacturer's instructions.

IFC 319.5 - 2021

Corrected

3 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

Corrected

4 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

Corrected

5 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Bellevue	Provider Number	2491
Address	148 102ND AVE SE,	Approval Status	Disapproved
City, State, Zip	Bellevue, WA 98005	Facility Type	Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Corrected

7 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.

(IFC 703.1 2021)

Corrected

8 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

9 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

Corrected

10 Testing

Horizontal and vertical sliding and rolling fire doors shall be inspected and tested annually to confirm proper operation and full closure. Records of inspections and testing shall be maintained.

(IFC 705.2.6 2018)

Corrected

11 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

Corrected 1. 3-Year Dry System Full flow trip test (NFPA 25 13.1.1.2)

2. Annual forward flow test (NFPA 25 13.7.2)

3. Quarterly inspections

Corrected 4. report from 3/26.2024 shows a deficiency on report.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

12 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First semi-annual servicing **6/21/24** ✓
Corrected
2. Second semi-annual service
3. Heat Test will need to be performed last report showing links from 12/2023 has 5-450

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

13 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Corrected

14 Carbon Monoxide Detection - General

Carbon monoxide detection shall be installed in new buildings in accordance with Sections 915.1.1 through 915.6. Carbon monoxide detection shall be installed in existing buildings in accordance with Chapter 11 of the International Fire Code.

(IFC 0915.1 2021 WAC 51-54A)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

15 Exit Signs - Where Required

Exits and exit access doors shall be marked by an approved exit sign readily visible from any direction of egress travel. The path of egress travel to exits and within exits shall be marked by readily visible exit signs to clearly indicate the direction of egress travel in cases where the exit or the path of egress travel is not immediately visible to the occupants. Intervening means of egress doors within exits shall be marked by exit signs. Exit sign placement shall be such that any point in an exit access corridor or exit passageway is within 100 feet (30 480 mm) or the listed viewing distance of the sign, whichever is less, from the nearest visible exit sign.

Exceptions:

1. Exit signs are not required in rooms or areas that require only one exit or exit access.
2. Main exterior exit doors or gates that are obviously and clearly identifiable as exits need not have exit signs where approved by the fire code official.
3. Exit signs are not required in occupancies in Group U and individual sleeping units or dwelling units in Group R-1, R-2 or R-3.
4. Exit signs are not required in dayrooms, sleeping rooms or dormitories in occupancies in Group I-3.
5. In occupancies in Groups A-4 and A-5, exit signs are not required on the seating side of vomitories or openings into seating areas where exit signs are provided in the concourse that are readily apparent from the vomitories. Egress lighting is provided to identify each vomitory or opening within the seating area in an emergency.

(IFC 1013.1 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

16 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.

(IFC 1032.10.1 2021)

Corrected

17 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Corrected

18 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Corrected

19 Security

Compressed gas containers, cylinders, tanks and systems shall be secured against accidental dislodgement and against access by unauthorized personnel in accordance with Sections 5303.5.1 through 5303.5.3.

(IFC 5303.5 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

20 NFPA 80 Fire /Smoke Dampers Inspection and Testing

19.4 Periodic Inspection and Testing.
19.4.1 Each damper shall be tested and inspected 1 year after installation.
19.4.1.1 The test and inspection frequency shall then be every 4 years, except in hospitals, where the frequency shall be every 6 years.

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Fire/smoke damper inspection will need to be performed and documented

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

At time of inspection the following was observed:

1. damper found on 2nd floor between corridor and activities office was not on report.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

21 NFPA 80 Fire Door Inspection and Testing

5.2.1 Inspection and Testing. Upon completion of the installation, door, shutters, and window assemblies shall be inspected and tested in accordance with 5.2.4.

5.2.4 Periodic Inspection and Testing.

5.2.4.1 Periodic inspections and testing shall be performed not less than annually.

5.2.2.4 A record of all inspections and testing shall be provided that includes, but is not limited to, the following information:

1. Date of inspection
2. Name of facility
3. Address of facility
4. Name of person(s) performing inspections and testing
5. Company name and address of inspecting company
6. Signature of inspector of record
7. Individual record of each inspected and tested fire door assembly
8. Opening identifier and location of each inspected and tested fire door assembly
9. Type and description of each inspected and tested fire door assembly
10. Verification of visual inspection and functional operation
11. Listing of deficiencies in accordance with 5.2.3, Section 5.3, and Section 5.4

And the following shall be checked:

1. Labels are clearly visible and legible
2. No open holes or breaks exist in surfaces of wither the door or frame
3. Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped.
4. The door, frame, hinges, hardware, and non combustible threshold are secured, aligned and in working order with no visible, signs of damage
5. No parts are missing or broken
6. Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7
7. The self-closing device is operational,; that is, the active door completely closes when operated from the full open position
8. If a coordinator is installed, the inactive lead close before the active lead

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Facility will need to identify and establish a schedule for inspection of Fire Doors. Annual inspection of fire doors will need to be performed and completed.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Bellevue	Provider Number	2491
Address	148 102ND AVE SE,	Approval Status	Disapproved
City, State, Zip	Bellevue, WA 98005	Facility Type	Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
9. Latching hardware operates and secures the door when it is in the closed position 10. Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame 11. No field modification to the door assembly have been performed that void the label. 12. Meeting edge protection, gasketing and edge seals where required, are inspected to verify their presence and intertie 13. Signage affixed to a door meets the requirements listed in 4.1.4	

Next inspection scheduled on or after: 04/21/2025

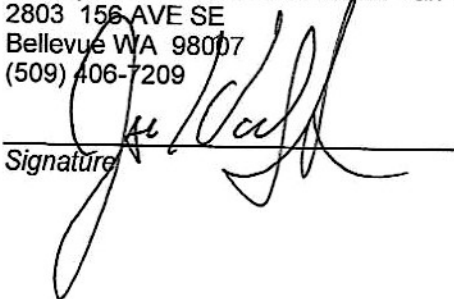
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Jim Nicholson Maintenance Director
Print Name and Title

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(509) 406-7209


Signature

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Bellevue	Provider Number	2491
Address	148 102ND AVE SE,	Approval Status	Disapproved
City, State, Zip	Bellevue, WA 98005	Facility Type	Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Administration

Drills shall be held at unexpected times and under varying conditions to simulate the unusual conditions that occur in case of fire.

Exceptions:

1. In severe climates, the fire code official shall have the authority to modify the emergency evacuation drill termination points and frequency.
2. In Groups I-1, I-2, I-3 and R-4, where staff-only emergency evacuation drills are conducted after visiting hours or where care recipients are expected to be asleep, a coded announcement shall be an acceptable alternative to audible alarms.

(IFC 405.5 (2021)

Records shall be maintained of required emergency evacuation drills and include the following information:

1. Identity of the person conducting the drill.
2. Date and time of the drill.
3. Notification method used.
4. Employees on duty and participating.
5. Number of occupants evacuated.
6. Special conditions simulated.
7. Problems encountered.
8. Weather conditions when occupants were evacuated.
9. Time required to accomplish complete evacuation.

(IFC 0405.6 2021)

Where a fire alarm system is provided, emergency evacuation drills shall be initiated by activating the fire alarm system.

(IFC 405.8, 2021)

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Aegis of Bellevue	Provider Number	2491
Address	148 102ND AVE SE,	Approval Status	Disapproved
City, State, Zip	Bellevue, WA 98005	Facility Type	Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

2 Appliance connection to fuel supply piping

Appliance connection to fuel supply piping. Gas cooking appliances shall be secured in place and connected to fuel-supply piping with an appliance connector complying with ANSI Z21.69/CSA 6.16. The connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances shall be limited by restraining devices installed in accordance with the connector and appliance manufacturer's instructions.

IFC 319.5 - 2021

At time of inspection the following was observed:

1. Safety cable missing between wall and kitchen appliance

3 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

At time of inspection the following was observed:

1. Missing receptacle cover found behind appliance under hood
2. Open junction box with exposed wires found behind appliances under hood
3. Life's neighborhood directors office has missing receptacle cover.

4 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

At time of inspection the following was observed:

1. Pizza oven area has 3 extension cords in permanent use



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3.

(IFC 606.3.3 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First quarterly servicing
2. Second quarterly servicing
3. Third quarterly servicing
4. Fourth quarterly servicing

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

6 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Facility will need to identify and establish a schedule for inspection of Fire-Rated construction. Annual inspection of fire-resistance-rated construction will need to be performed and completed.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

7 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.

(IFC 703.1 2021)

At time of inspection the following was observed:

1. 1st floor copier room has penetration found in wall.

8 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

At time of inspection the following was observed:

1. 2nd floor resident laundry door found held open with a wedge.

9 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

At time of inspection the following was observed:

1. 4th floor resident laundry door will need adjustment
2. 2nd floor double doors by resident door 213 will not latch

10 Testing

Horizontal and vertical sliding and rolling fire doors shall be inspected and tested annually to confirm proper operation and full closure. Records of inspections and testing shall be maintained.

(IFC 705.2.6 2018)

At time of inspection the following was observed:

1. 2nd floor has a horizontal smoke wall that needs to show tested.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. 3-Year Dry System Full flow trip test (NFPA 25 13.1.1.2)
2. Annual forward flow test (NFPA 25 13.7.2) ☐
3. Quarterly inspections ☐
4. report from 3/26.2024 shows a deficiency on report. ✓

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

12 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. First semi-annual servicing ☐
2. Second semi-annual service ✓ ☐
3. Heat Test will need to be performed last report showing links from 12/2023 has 5-450 ☐

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

13 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Sensitivity Testing (IFC 907.8.3) ✓
2. Monthly single and multiple station alarms test (IFC 907.8) ✓

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

14 Carbon Monoxide Detection - General

Carbon monoxide detection shall be installed in new buildings in accordance with Sections 915.1.1 through 915.6. Carbon monoxide detection shall be installed in existing buildings in accordance with Chapter 11 of the International Fire Code.

(IFC 0915.1 2021 WAC 51-54A)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Carbon Monoxide Alarms and Detectors will need to be tested, maintained and documented on an monthly schedule ✓

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

15 Exit Signs - Where Required

Exits and exit access doors shall be marked by an approved exit sign readily visible from any direction of egress travel. The path of egress travel to exits and within exits shall be marked by readily visible exit signs to clearly indicate the direction of egress travel in cases where the exit or the path of egress travel is not immediately visible to the occupants. Intervening means of egress doors within exits shall be marked by exit signs. Exit sign placement shall be such that any point in an exit access corridor or exit passageway is within 100 feet (30 480 mm) or the listed viewing distance of the sign, whichever is less, from the nearest visible exit sign.

Exceptions:

1. Exit signs are not required in rooms or areas that require only one exit or exit access.
2. Main exterior exit doors or gates that are obviously and clearly identifiable as exits need not have exit signs where approved by the fire code official.
3. Exit signs are not required in occupancies in Group U and individual sleeping units or dwelling units in Group R-1, R-2 or R-3.
4. Exit signs are not required in dayrooms, sleeping rooms or dormitories in occupancies in Group I-3.
5. In occupancies in Groups A-4 and A-5, exit signs are not required on the seating side of vomitories or openings into seating areas where exit signs are provided in the concourse that are readily apparent from the vomitories. Egress lighting is provided to identify each vomitory or opening within the seating area in an emergency.

(IFC 1013.1 2021)

At time of inspection the following was observed:

1. 1st floor outside above park structure entrance will need to show path of egress.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue	Provider Number 2491
Address 148 102ND AVE SE,	Approval Status Disapproved
City, State, Zip Bellevue, WA 98005	Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

16 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.

(IFC 1032.10.1 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Monthly 30-second activation testing had not been performed and documented

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

17 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual 90 minute power test had not been performed and documented

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

18 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Annual service report
2. Log of weekly inspections
3. Monthly 30-minute full load test
4. Diesel fuel testing

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

19 Security

Compressed gas containers, cylinders, tanks and systems shall be secured against accidental dislodgement and against access by unauthorized personnel in accordance with Sections 5303.5.1 through 5303.5.3.

(IFC 5303.5 2021)

At time of inspection the following was observed:

1. O2 tank found out of holder on the 4th floor in Health Services office.

20 NFPA 80 Fire /Smoke Dampers Inspection and Testing

19.4 Periodic Inspection and Testing.

19.4.1 Each damper shall be tested and inspected 1 year after installation.

19.4.1.1 The test and inspection frequency shall then be every 4 years, except in hospitals, where the frequency shall be every 6 years.

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Fire/smoke damper inspection will need to be performed and documented

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

At time of inspection the following was observed:

1. damper found on 2nd floor between corridor and activities office was not on report.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

21 NFPA 80 Fire Door Inspection and Testing

5.2.1 Inspection and Testing. Upon completion of the installation, door, shutters, and window assemblies shall be inspected and tested in accordance with 5.2.4.

5.2.4 Periodic Inspection and Testing.

5.2.4.1 Periodic inspections and testing shall be performed not less than annually.

5.2.2.4 A record of all inspections and testing shall be provided that includes, but is not limited to, the following information:

1. Date of inspection
2. Name of facility
3. Address of facility
4. Name of person(s) performing inspections and testing
5. Company name and address of inspecting company
6. Signature of inspector of record
7. Individual record of each inspected and tested fire door assembly
8. Opening identifier and location of each inspected and tested fire door assembly
9. Type and description of each inspected and tested fire door assembly
10. Verification of visual inspection and functional operation
11. Listing of deficiencies in accordance with 5.2.3, Section 5.3, and Section 5.4

And the following shall be checked:

1. Labels are clearly visible and legible
2. No open holes or breaks exist in surfaces of wither the door or frame
3. Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped.
4. The door, frame, hinges, hardware, and non combustible threshold are secured, aligned and in working order with no visible, signs of damage
5. No parts are missing or broken
6. Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7
7. The self-closing device is operational, that is, the active door completely closes when operated from the full open position
8. If a coordinator is installed, the inactive lead close before the active lead

The following deficiencies were cited as a result of this inspection:

At the time of inspection, the following paperwork was not provided:

1. Facility will need to identify and establish a schedule for inspection of Fire Doors. Annual inspection of fire doors will need to be performed and completed.

All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Aegis of Bellevue
Address 148 102ND AVE SE,
City, State, Zip Bellevue, WA 98005

Provider Number 2491
Approval Status Disapproved
Facility Type Residential Care

On 02/04/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
9. Latching hardware operates and secures the door when it is in the closed position 10. Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame 11. No field modification to the door assembly have been performed that void the label. 12. Meeting edge protection, gasketing and edge seals where required, are inspected to verify their presence and intertie 13. Signage affixed to a door meets the requirements listed in 4.1.4	

Next inspection scheduled on or after: 03/06/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Jim Nicholson
Print Name and Title

Maintenance Director

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(509) 406-7209

Signature