



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Village at Granite Falls
Address 302 N ALDER AVE ,
City, State, Zip Granite Falls, WA 98252

Provider Number 2499
Approval Status Approved
Facility Type Residential Care

On 06/02/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

Signature

Print Name and Title

Jeffrey Dunkin Maint Director

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037

Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Village at Granite Falls
Address 302 N ALDER AVE
City, State, Zip Granite Falls, WA 98252

Provider Number 2499
Approval Status Disapproved
Facility Type Residential Care

On 03/25/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

There is an open junction box in the ceiling near 230 exposing the inner electrical wiring.

2 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A.

(IFC 603.5.1, 2021)

There was multi-plug adapter that does not have over current protection in use ceiling near 231

3 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

1. There was an extension cord utilized as permanent wiring in hallway near 231
2. There was an extension cord utilized as permanent wiring in the beauty salon.

4 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility is unable to provide documentation that the annual fire door inspection has been completed.

This document was prepared by Residential Care Services for the Locator website



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Village at Granite Falls	Provider Number	2499
Address	302 N ALDER AVE ,	Approval Status	Disapproved
City, State, Zip	Granite Falls, WA 98252	Facility Type	Residential Care

On 03/25/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
5 Door Operation	
Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	Resident room 222 fire door would not close and latch from the fully open position.
6 Testing and Maintenance	
Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	As per documents provided the annual sprinkler inspection conducted on 5/7/2024 had deficiencies noted that have not been corrected.
7 Unobstructed and Unobscured	
Manual fire alarm boxes shall be provided with ready access, unobstructed, unobscured and visible at all times. (IFC 907.4.2.6 2021)	The manual pull station at the main entrance door was obstructed by a table.
8 Smoke Detector Sensitivity	
Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed. (IFC 907.8.3 2021)	Facility is unable to provide documentation for the required smoke detector sensitivity testing. Nuisance log has not been maintained.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Village at Granite Falls	Provider Number	2499
Address	302 N ALDER AVE ,	Approval Status	Disapproved
City, State, Zip	Granite Falls, WA 98252	Facility Type	Residential Care

On 03/25/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

9 Existing Buildings

On existing buildings, wherever the fire department connection is not visible to approaching fire apparatus, the fire department connection shall be indicated by an approved sign mounted on the street front or on the side of the building. Such sign shall have the letters "FDC" at least 6 inches (152 mm) high and words in letters at least 2 inches (51 mm) high or an arrow to indicate the location. All such signs shall be subject to the approval of the fire code official. (IFC 912.2.2 2021)	Fire department connection is not visible from the street, no signage is installed.
--	---

10 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Two carbon monoxide alarms did not operate when tested in room 232.
--	---

11 Emergency Power for Illumination - General

In the event of power supply failure in rooms and spaces that require two or more exits or access to exits, an emergency electrical system shall automatically illuminate all of the following areas: 1. Aisles 2. Corridors 3. Exit access stairways and ramps (IFC 1008.3.1 2021)	The emergency egress light near 232 would not illuminate when the test button was pressed. The emergency egress light in the north stairwell would not illuminate when the test button was pressed.
---	--

12 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired. (IFC 1032.10.1 2021)	Facility is unable to provide documentation for the monthly 30 second activation test for the emergency lights.
---	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Village at Granite Falls	Provider Number	2499
Address	302 N ALDER AVE ,	Approval Status	Disapproved
City, State, Zip	Granite Falls, WA 98252	Facility Type	Residential Care

On 03/25/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

13 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Facility is unable to provide documentation for the annual 90 minute power test for the emergency lights.

Next inspection scheduled on or after: 04/24/2025

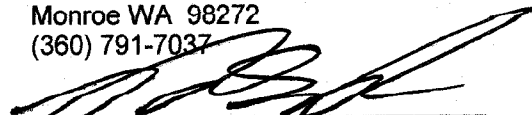
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Roxie Stormo / Executive Director
Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

This document was prepared by Residential Care Services for the Locator website.