



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Murano Senior Living
Address 620 TERRY AVE ,
City, State, Zip Seattle, WA 98104

Provider Number 2521
Approval Status Approved
Facility Type Residential Care

On 10/10/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

Signature

Everardo Procel / Maintenance Manager.
Print Name and Title

Deputy State Fire Marshal Arthur Jesse Ward
2803 156TH AVE SE
Bellevue WA 98007
(425) 401-7735

Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Murano Senior Living
Address 620 TERRY AVE ,
City, State, Zip Seattle, WA 98104

Provider Number 2521
Approval Status Disapproved
Facility Type Residential Care

On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Smoke Barriers

The fire-resistance rating and smoke-resistant characteristics of smoke barriers shall be maintained.

(IFC 701.3 2018)

Fifth floor main kitchen, dry goods is missing a ceiling tile

2 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2018 WAC 51-54A)

Facility is unable to provide documentation that the annual fire wall inspection has been completed.

3 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.

(IFC 703.1 2018)

Floor 21 electrical room has some fire caulking that needs to be done and there is a hole in the fire rated wall.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Murano Senior Living
Address 620 TERRY AVE ,
City, State, Zip Seattle, WA 98104

Provider Number 2521
Approval Status Disapproved
Facility Type Residential Care

On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

4 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80.
Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105.
Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2018)

Facility is unable to provide documentation that the annual fire door inspection has been completed.
NFPA 80 (2016)
5.2.3.5.2 As a minimum, the following items shall be verified:
(1) Labels are clearly visible and legible.
(2) No open holes or breaks exist in surfaces of either the door or frame.
(3) Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped.
(4) The door, frame, hinges, hardware, and noncombustible threshold are secured, aligned, and in working order with no visible signs of damage.
(5) No parts are missing or broken.
(6) Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7.
(7) The self-closing device is operational; that is, the active door completely closes when operated from the full open position.
(8) If a coordinator is installed, the inactive leaf closes before the active leaf.
(9) Latching hardware operates and secures the door when it is in the closed position.
(10) Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame.
(11)* No field modifications to the door assembly have been performed that void the label.
(12) Meeting edge protection, gasketing and edge seals, where required, are inspected to verify their presence and integrity.
(13) Signage affixed to a door meets the requirements listed in 4.1.4.

5 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2018)

Rated doors on the activity, rooms on floor two and three need to be self closing



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Murano Senior Living
Address 620 TERRY AVE ,
City, State, Zip Seattle, WA 98104

Provider Number 2521
Approval Status Disapproved
Facility Type Residential Care

On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Commercial Cooking Systems

The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fire-extinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, its listing and the manufacturer's installation instructions. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire extinguishing system. Signage shall indicate appliances from left to right, be durable and the size, color, and lettering shall be approved. Automatic fire-extinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
4. Dry-chemical extinguishing systems, NFPA 17.
5. Wet-chemical extinguishing systems, NFPA 17A.

Exception: Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.

(IFC 904.12 2015, 2018)

Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Murano Senior Living	Provider Number	2521
Address	620 TERRY AVE ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA 98104	Facility Type	Residential Care

On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2018)	1. Facility is unable to provide documentation for the monthly single or multi station smoke alarm testing. 2. At both fourth floor stairwell exit doors, the pull stations were covered up by a plant.
--	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Murano Senior Living
Address 620 TERRY AVE ,
City, State, Zip Seattle, WA 98104

Provider Number 2521
Approval Status Disapproved
Facility Type Residential Care

On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

8 Delayed Egress Locking System

The delayed egress locking system shall be installed and operated in accordance with all of the following:

1. The delay electronics of the delayed egress locking system shall deactivate upon actuation of the automatic sprinkler system or automatic fire detection system, allowing immediate, free egress.
2. The delay electronics of the delayed egress locking system shall deactivate upon loss of power controlling the lock or lock mechanism, allowing immediate free egress.
3. The delayed egress locking system shall have the capability of being deactivated at the fire command center and other approved locations.
4. An attempt to egress shall initiate an irreversible process that shall allow such egress in not more than 15 seconds when a physical effort to exit is applied to the egress side door hardware for not more than 3 seconds. Initiation of the irreversible process shall activate an audible signal in the vicinity of the door. Once the delay electronics have been deactivated, rearming the delay electronics shall be by manual means only.

Exception: Where approved, a delay of not more than 30 seconds is permitted on a delayed egress door.

5. The egress path from any point shall not pass through more than one delayed egress locking system.

Exceptions:

1. In Group I-2 or I-3 occupancies, the egress path from any point in the building shall pass through not more than two delayed egress locking systems provided that the combined delay does not exceed 30 seconds.
2. In Group I-1 or I-4 occupancies, the egress path from any point in the building shall pass through not more than two delayed egress locking systems provided that the combined delay does not exceed 30 seconds and the building is equipped throughout with an automatic sprinkler system in accordance with Section 903.3.1.1.

6. A sign shall be provided on the door and shall be located above and within 12 inches (305 mm) of the door exit hardware:

6.1. For doors that swing in the direction of egress, the sign shall read: PUSH UNTIL ALARM SOUNDS. DOOR CAN BE OPENED IN 15 [30] SECONDS.

1. Fourth floor stair to exit doors needs signage noting delayed egress
2. Fourth floor stair three path of egress was blocked by plants and chairs.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Murano Senior Living	Provider Number	2521
Address	620 TERRY AVE ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA 98104	Facility Type	Residential Care

On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
6.2. For doors that swing in the opposite direction of egress, the sign shall read: PULL UNTIL ALARM SOUNDS. DOOR CAN BE OPENED IN 15 [30] SECONDS. 6.3 The sign shall comply with the visual character requirements in ICC A117.1. Exception: Where approved, in Group I occupancies, the installation of a sign is not required where care recipients who, because of clinical needs, require restraint or containment as part of the function of the treatment area. 7. Emergency lighting shall be provided on the egress side of the door. 8. The delayed egress locking system units shall be listed in accordance with UL 294. (IFC 1010.1.9.8.1 2018)	

9 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods: 1. Securing containers, cylinders and tanks to a fixed object with one or more restraints. 2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks. 3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress. 4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use. Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing. (IFC 5303.5.3 2018)	Fifth floor main kitchen storage closet there was several high pressure gas cylinders not secured.
--	--



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Murano Senior Living
Address 620 TERRY AVE ,
City, State, Zip Seattle, WA 98104

Provider Number 2521
Approval Status Disapproved
Facility Type Residential Care

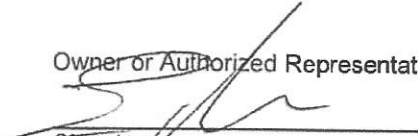
On 09/11/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

Next inspection scheduled on or after: 10/11/2023

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

ERIC PIEKARZ - GENERAL MANAGER
Print Name and Title

Deputy State Fire Marshal Arthur Jesse Ward
2803 156TH AVE SE
Bellevue WA 98007
(425) 401-7735

Jesse Ward

Digitally signed by Jesse Ward
Date: 2023.09.11 14:57:01 -07'00'

Signature

This document was prepared by Residential Care Services for the Locator website.