



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Tri-Cities Assisted Living	Provider Number	2549
Address	2000 22ND ,	Approval Status	Approved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 02/26/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

CHRIS CORNELLI S - MAINTENANCE DIRECTOR
Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121

Alan Harlan
Digitally signed by Alan Harlan
Date: 2026.02.26 13:10:01
+08'00'

Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Tri-Cities Assisted Living
Address 2000 22ND ,
City, State, Zip Pasco, WA 99301

Provider Number 2549
Approval Status Disapproved
Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

2 Burning Objects

Lighted matches, cigarettes, cigars, or other burning objects shall not be discarded in such a manner that could cause ignition of other combustible material.

(IFC 310.7 2021)

The following violation was observed:

- 1) Cigarettes are being discarded under and near wood bench by front entrance.
- 2) Cigarettes are being discarded into garbage can near smoking area

3 Ceiling Clearance

Storage shall be maintained 2 feet (610 mm) or more below the ceiling in nonsprinklered areas of buildings or not less than 18 inches (457 mm) below sprinkler head deflectors in sprinklered areas of buildings.

Exceptions:

1. The 2-foot (610 mm) ceiling clearance is not required for storage along walls in nonsprinklered areas of buildings.
2. The 18-inch (457 mm) ceiling clearance is not required for storage along walls in areas of buildings equipped with an automatic sprinkler system in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3.

(IFC 315.2.1 2021)

Corrected

4 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated..

(IFC 603.2 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Tri-Cities Assisted Living	Provider Number	2549
Address	2000 22ND ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	Corrected
--	-----------

6 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions. (IFC 703.1 2021)	The following location's had penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke: 1) 1st floor electrical room.(No key to access.) 2) 1st floor soiled linen room. (Spreay foam used.)
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Tri-Cities Assisted Living
Address 2000 22ND ,
City, State, Zip Pasco, WA 99301

Provider Number 2549
Approval Status Disapproved
Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Corrected

8 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The following fire doors would not latch from a fully opened position:

1) Room 127

9 Inspection, Testing and Maintenance

Fire protection and life safety systems shall be maintained in an operative condition at all times, and shall be replaced or repaired where defective. Nonrequired fire protection and life safety systems and equipment shall be inspected, tested and maintained or removed in accordance with Section 901.8.

(IFC 901.6 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Tri-Cities Assisted Living
Address 2000 22ND ,
City, State, Zip Pasco, WA 99301

Provider Number 2549
Approval Status Disapproved
Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

10 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	The facility was unable to provide documentation for the following: 1) The facility did not have a report for internal pipe inspection that was performed on 01 / 20 / 2025. 2) 4th quarter 2025 sprinkler inspection. All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.
--	--

11 Unobstructed and Unobscured

Portable fire extinguishers shall not be obstructed or obscured from view. In rooms or areas in which visual obstruction cannot be completely avoided, means shall be provided to indicate the locations of extinguishers. (IFC 906.6 2021)	Corrected
--	-----------

12 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Tri-Cities Assisted Living
Address 2000 22ND ,
City, State, Zip Pasco, WA 99301

Provider Number 2549
Approval Status Disapproved
Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

13 Unlatching

The unlatching of any door or leaf for egress shall require not more than one motion in a single linear or rotational direction to release all latching and all locking devices.

Exceptions:

1. Places of detention or restraint.
2. Where manually operated bolt locks are permitted by Section 1010.2.5.
3. Doors with automatic flush bolts as permitted by Section 1010.2.4, Item 4.
4. Doors from individual dwelling units and sleeping units of Group R occupancies as permitted by Section 1010.2.4, Item 5.

(IFC 1010.2.1 2021)

Corrected

14 Power Source

Exit signs shall be illuminated at all times. To ensure continued illumination for a duration of not less than 90 minutes in case of primary power loss, the sign illumination means shall be connected to an emergency power system provided from storage batteries, unit equipment or an on-site generator. The installation of the emergency power system shall be in accordance with Section 603. Group I-2, Condition 2 exit sign illumination shall not be provided by unit equipment batteries only.

Exception: Approved exit sign illumination types that provide continuous illumination independent of external power sources for a duration of not less than 90 minutes, in case of primary power loss, are not required to be connected to an emergency electrical system.

(IFC 1013.6.3 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Tri-Cities Assisted Living	Provider Number	2549
Address	2000 22ND ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

15 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required. (IFC 1203.4 2021)	Corrected
--	-----------

16 Procedures

Periodic inspection of fire extinguishers shall include a check of at least the following items: (1) Location in designated place (2) No obstruction to access or visibility (3) Operating instructions on nameplate legible and facing outward (4) Safety seals and tamper indicators not broken or missing (5) Fullness determined by weighing or "hefting" (6) Examination for obvious physical damage, corrosion, leakage, or clogged nozzle (7) Pressure gauge reading or indicator in the operable range or position (8) Condition of tires, wheels, carriage, hose, and nozzle checked (for wheeled units) (9) HMIS label in place. (NFPA Standard 10 Section 6.2.2)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Tri-Cities Assisted Living
Address 2000 22ND ,
City, State, Zip Pasco, WA 99301

Provider Number 2549
Approval Status Disapproved
Facility Type Residential Care

On 2/11/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

17 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state, at least twelve planned and unannounced fire drills shall be held every year. Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. A detailed written record of all fire drills shall be maintained and available for inspection at all times. When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms. Fire drills shall include the transmission of a fire alarm signal and simulation of emergency conditions. The fire alarm monitoring company shall be notified prior to the activation of the fire alarm system for drill purposes and again at the conclusion of the transmission and restoration of the fire alarm system to normal mode.

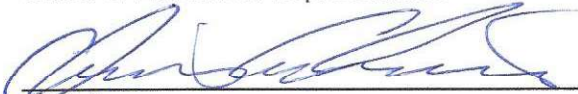
(WAC 212-12-044)

Corrected

Next inspection scheduled on or after: 3/13/2026

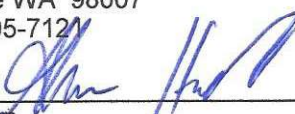
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


CHRIS CORNELIUS
Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121


Signature