




Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Fieldstone on Clear Creek	Provider Number	2606
Address	11353 NW Clear Creek RD NW,	Approval Status	Approved
City, State, Zip	Silverdale, WA	Facility Type	Residential Care

On 03/25/2026 the Office of the State Fire Marshal conducted an inspection at your facility.


All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

Erik Pease MAINT. Dir.
Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name	Fieldstone on Clear Creek	Provider Number	2606
Address	11353 NW Clear Creek RD NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA	Facility Type	Residential Care

On 02/09/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Hazard Abatement

601.2 Hazard abatement. Operations or conditions deemed unsafe or hazardous by the fire code official shall be abated. Equipment, appliances, materials and systems that are modified or damaged and constitute an electrical shock or fire hazard shall not be used.

601.2.1 Correction of unsafe conditions. The fire code official shall be authorized to require the owner, the owner's authorized agent, operator or occupant of a building or premises to abate or cause to be abated or corrected such unsafe operations or conditions either by repair, rehabilitation, demolition or other approved corrective action in compliance with this code.

Findings during the inspection were:

2 floor storage room on side of room 209 has an electrical outlet with a missing cover plate. Electrical hazards shall be abated.

2 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Findings during the inspection were:

3rd floor storage room on the side of room 309 has missing ceiling tiles.

3 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Findings during the inspection were:

Fire sprinkler system has outdated pressure gauges, gauges need to be tested or replaced.

Dining room has 6 missing escutcheon rings at sprinkler heads.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name	Fieldstone on Clear Creek	Provider Number	2606
Address	11353 NW Clear Creek RD NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA	Facility Type	Residential Care

On 02/09/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Findings during the inspection were:

Facility shall schedule automatic fire alarm system inspection semi-annually.

5 Security

Compressed gas containers, cylinders, tanks and systems shall be secured against accidental dislodgement and against access by unauthorized personnel in accordance with Sections 5303.5.1 through 5303.5.3.

(IFC 5303.5 2021)

Findings during the inspection were:

Room 428 on the 4th floor has 3 unsecured oxygen tanks.

6 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.

(2) A detailed written record of all fire drills shall be maintained and available for inspection.

(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

Findings during the inspection were:

Facility failed to provide documentation showing fire drills were conducted once per shift per quarter for the 2nd, 3rd, and 4th quarter of 2025.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Fieldstone on Clear Creek	Provider Number	2606
Address	11353 NW Clear Creek RD NW,	Approval Status	Disapproved
City, State, Zip	Silverdale, WA	Facility Type	Residential Care

On 02/09/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

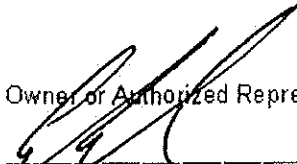
Code Requirement

Statement of Violation

Next inspection scheduled on or after: 03/12/2026


Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

ERIK PEASE MAINT. DIR.
Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature

This document was prepared by Residential Care Services for the Locator website.