



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Power Supply

Portable, electric space heaters shall be plugged directly into an approved receptacle.

(IFC 603.9.2, 2021)

2 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Kitchen cooking appliances that are gas and on wheels shall have strain protection added/maintain in kitchen

3 Clothes Dryer Exhaust Systems - Maintenance

610.1.2 Maintenance. The lint trap, mechanical and heating components, and the exhaust duct system of a clothes dryer shall be maintained in accordance with the manufacturer's operating instructions to prevent the accumulation of lint or debris that prevents the exhaust of air and products of combustion.

(IFC 610.1.2 - 2021)

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	The facility failed to provide annual inspection of fire resistance-rated construction
--	--

5 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	Facility failed to provide annual fire rated door inspection report that met NFPA 80 standards Fire doors throughout the building found to be out of compliance All fire doors shall be inspected and brought into compliance before reinspection Fire door shall have combustible items removed in excess of 5% of the door
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	Facility failed to provide the following items associated with the fire sprinkler system Deficiencies on the fire sprinkler inspection report from 03/15/2024 shall have documentation associated with the correction Facility failed to provide the following reports Annual full flow fire pump inspection or annual forward flow 5 year internal inspection 5 year FDC hydro static inspection report Fire sprinkler riser shall have hydraulic nameplate's that are legible Monthly fire pump inspection records shall be documented and provide
--	---

This document was prepared by Residential Care Services for the Locator website.



Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

7 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Automatic water mist systems, NFPA 750.
4. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
5. Dry-chemical extinguishing systems, NFPA 17.
6. Wet-chemical extinguishing systems, NFPA 17A.

EXCEPTIONS:

1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.
2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300.

(IFC 904.13 2021 WAC 51-54A)

The facility found to have replaced kitchen steamer, facility shall contact the City of Vancouver and Washington State Construction review services for permitting of appliances changes

A new heat survey shall be conducted due to appliance change
Commercial oven shall be 6 inch's inside the hood system

New signage shall be displayed on side of hood system with updated steamer once approval has been completed

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.

Records of compliance shall be maintained and shall be available to the authority having jurisdiction

This document was prepared by Residential Care Services for the Locator website.



Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

9 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

10 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Facility failed to provide monthly carbon monoxide detector testing
--	---

11 Illumination

Exit signs shall be internally or externally illuminated. Exception: Tactile signs required by Section 1013.4 need not be provided with illumination. (IFC 1013.3 2021)	
---	--

12 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes. (IFC 1031.10.2 2021)	Annual emergency light testing shall be completed on battery powered lights
---	---

13 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required. (IFC 1203.4 2021)	Facility shall provide an annual fuel testing of the generator A written schedule for routine maintenance and operational testing of the EPSS shall be established.
--	--

This document was prepared by Residential Care Services for the Locator website.



Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

14 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

Compressed cylinders in kitchen shall be properly secured

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 05/01/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

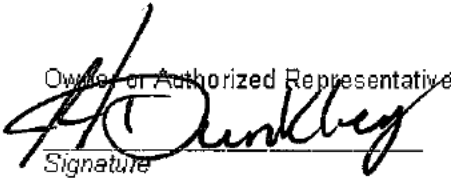
Code Requirement

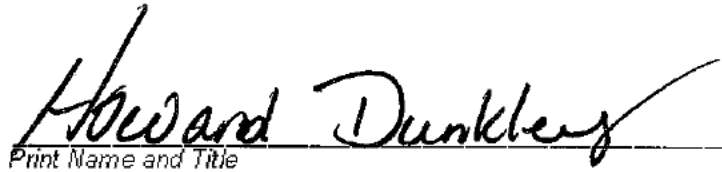
Statement of Violation

Next inspection scheduled on or after: 05/31/2025


Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

2 Working Space and Clearance

Working space and clearances. Working space around electrical equipment shall be provided in accordance with Section 110.26 of NFPA 70 for electrical equipment rated 1,000 volts or less, and Section 110.32 of NFPA 70 for electrical equipment rated over 1,000 volts. The minimum required working space shall be not less than 30 inches (762 mm) in width, 36 inches (914 mm) in depth and 78 inches (1981 mm) in height in front of electrical service equipment. Where the electrical service equipment is wider than 30 inches (762 mm), the minimum working space shall be not less than the width of the equipment. Storage of materials shall not be located within the designated working space.

(IFC 603.4, 2021)

3 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

4 Power Supply

Portable, electric space heaters shall be plugged directly into an approved receptacle.

(IFC 603.9.2, 2021)

Portable heater found plugged into powerstrip in room A-108



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Kitchen cooking appliances that are gas and on wheels shall have strain protection added/maintain in kitchen

6 Clothes Dryer Exhaust Systems - Maintenance

610.1.2 Maintenance. The lint trap, mechanical and heating components, and the exhaust duct system of a clothes dryer shall be maintained in accordance with the manufacturer's operating instructions to prevent the accumulation of lint or debris that prevents the exhaust of air and products of combustion.

(IFC 610.1.2 - 2021)

Cloth dryer shall be maintain in accordance with manufacture

7 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The facility failed to provide annual inspection of fire resistance rated construction

Holes in fire rated construction found in the following locations

Kitchen office
Memory care e-112 m-114
Atrium Enhanced care has none rated ceiling panel
Fire pump room has damaged drywall

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility failed to provide annual fire rated door inspection report that met NFPA 80 standards
Fire doors throughout the building found to be out of compliance

All fire doors shall be inspected and brought into compliance before reinspection

Fire door shall have combustible items removed in excess of 5% of the door

9 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Facility failed to provide the following items associated with the fire sprinkler system

Deficiencies on the fire sprinkler inspection report from 03/15/2024 shall have documentation associated with the correction

Facility failed to provide the following reports

Annual full flow fire pump inspection or annual forward flow
5 year internal inspection

5 year FDC hydro static inspection report

Fire sprinkler riser shall have hydraulic nameplate's that are legible

Monthly fire pump inspection records shall be documented and provided

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

10 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Automatic water mist systems, NFPA 750.
4. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
5. Dry-chemical extinguishing systems, NFPA 17.
6. Wet-chemical extinguishing systems, NFPA 17A.

EXCEPTIONS:

1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.
2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300.

(IFC 904.13 2021 WAC 51-54A)

The facility found to have replaced kitchen steamer, facility shall contact the City of Vancouver and Washington State Construction review services for permitting of appliances changes

A new heat survey shall be conducted due to appliance change
Commercial oven shall be 6 inch's inside the hood system

New signage shall be displayed on side of hood system with updated steamer once approval has been completed

Hood system pull station shall have carts removed that block it

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.
Records of compliance shall be maintained and shall be available to the authority having jurisdiction.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.

2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:

2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.

2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.

2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.

2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.

2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.

3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Fire extinguisher in kitchen office shall be properly hung

12 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Semi annual fire alarm inspection shall be completed

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

13 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2021 WAC)

14 Illumination

Exit signs shall be internally or externally illuminated.

Exception: Tactile signs required by Section 1013.4 need not be provided with illumination.

(IFC 1013.3 2021)

Facility failed to provide monthly carbon monoxide detector testing

15 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Annual emergency light testing shall be completed on battery powered lights

16 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Facility shall provide an annual fuel testing of the generator

A written schedule for routine maintenance and operational testing of the EPSS shall be established.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

17 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods: 1. Securing containers, cylinders and tanks to a fixed object with one or more restraints. 2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks. 3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress. 4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use. Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing. (IFC 5303.5.3 2021)	Compressed cylinders in kitchen shall be properly secured
---	--

18 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year. (1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. (2) A detailed written record of all fire drills shall be maintained and available for inspection. (3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.	
---	--



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

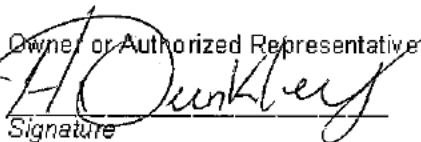
On 01/14/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation


Next inspection scheduled on or after: 02/13/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature


Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

Electrical cover missing in kitchen office

2 Working Space and Clearance

Working space and clearances. Working space around electrical equipment shall be provided in accordance with Section 110.26 of NFPA 70 for electrical equipment rated 1,000 volts or less, and Section 110.32 of NFPA 70 for electrical equipment rated over 1,000 volts. The minimum required working space shall be not less than 30 inches (762 mm) in width, 36 inches (914 mm) in depth and 78 inches (1981 mm) in height in front of electrical service equipment. Where the electrical service equipment is wider than 30 inches (762 mm), the minimum working space shall be not less than the width of the equipment. Storage of materials shall not be located within the designated working space.

(IFC 603.4, 2021)

Electrical panel shall have storage removed in loading dock near FACP room

3 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

Extension cords in resident room shall be not be used for more than 90 days.

Extension cords with multiplug outlet shall be removed

4 Power Supply

Portable, electric space heaters shall be plugged directly into an approved receptacle.

(IFC 603.9.2, 2021)

Portable heater found plugged into powerstrip in room A-108

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Kitchen cooking appliances that are gas and on wheels shall have strain protection added/maintain in kitchen

6 Clothes Dryer Exhaust Systems - Maintenance

610.1.2 Maintenance. The lint trap, mechanical and heating components, and the exhaust duct system of a clothes dryer shall be maintained in accordance with the manufacturer's operating instructions to prevent the accumulation of lint or debris that prevents the exhaust of air and products of combustion.

(IFC 610.1.2 - 2021)

Cloth dryer shall be maintain in accordance with manufacture

7 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The facility failed to provide annual inspection of fire resistance rated construction

Holes in fire rated construction found in the following locations

Kitchen office
Memory care e-112 m-114
Atrium Enhanced care has none rated ceiling panel
Fire pump room has damaged drywall

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility failed to provide annual fire rated door inspection report that met NFPA 80 standards
Fire doors throughout the building found to be out of compliance

All fire doors shall be inspected and brought into compliance before reinspection

Fire door shall have combustible items removed in excess of 5% of the door

9 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Facility failed to provide the following items associated with the fire sprinkler system

Deficiencies on the fire sprinkler inspection report from 03/15/2024 shall have documentation associated with the correction

Facility failed to provide the following reports

Annual full flow fire pump inspection or annual forward flow
5 year internal inspection

5 year FDC hydro static inspection report

Fire sprinkler riser shall have hydraulic nameplate's that are legible

Monthly fire pump inspection records shall be documented and provided

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

10 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Automatic water mist systems, NFPA 750.
4. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
5. Dry-chemical extinguishing systems, NFPA 17.
6. Wet-chemical extinguishing systems, NFPA 17A.

EXCEPTIONS:

1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.
2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300.

(IFC 904.13 2021 WAC 51-54A)

The facility found to have replaced kitchen steamer, facility shall contact the City of Vancouver and Washington State Construction review services for permitting of appliances changes

A new heat survey shall be conducted due to appliance change
Commercial oven shall be 6 inch's inside the hood system

New signage shall be displayed on side of hood system with updated steamer once approval has been completed

Hood system pull station shall have carts removed that block it

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.

Records of compliance shall be maintained and shall be available to the authority having jurisdiction.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Fire extinguisher in kitchen office shall be properly hung

12 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Semi annual fire alarm inspection shall be completed

HD



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir at the Quarry	Provider Number	2640
Address	415 SE 177TH AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98683	Facility Type	Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

13 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced.

(IFC 915.6 2021 WAC)

Facility failed to provide monthly carbon monoxide detector testing

14 Illumination

Exit signs shall be internally or externally illuminated.

Exception: Tactile signs required by Section 1013.4 need not be provided with illumination.

(IFC 1013.3 2021)

Exit sign leading out of Enhanced care at water leak found inoperable

15 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

Annual emergency light testing shall be completed on battery powered lights

16 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Facility shall provide an annual fuel testing of the generator

A written schedule for routine maintenance and operational testing of the EPSS shall be established.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

17 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

Compressed cylinders in kitchen shall be properly secured

18 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

- (1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.
- (2) A detailed written record of all fire drills shall be maintained and available for inspection.
- (3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

Fire drills shall be completed once per shift per quarter

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir at the Quarry
Address 415 SE 177TH AVE ,
City, State, Zip Vancouver, WA 98683

Provider Number 2640
Approval Status Disapproved
Facility Type Residential Care

On 11/27/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

Next inspection scheduled on or after: 12/27/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966

Signature

Print Name and Title

Howard Dunkley

This document was prepared by Residential Care Services for the Locator website.

HI