



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900


Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Approved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 05/06/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 03/12/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

2 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Facility failed to complete fire resistance rated construction inspection that includes the attic space. Facility shall provide listing of the assemblies installed throughout building



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 03/12/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

Next inspection scheduled on or after: 04/11/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Andrea Pineda, Executive Director
Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966

Nicholas D. Wolden
Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 09/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

2 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

3 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The facility failed to provide inventory and annual inspection of fire resistance rated construction

The following areas found to have holes and damage
Attic
Mechanical room by 327 found to have holes in wall
Soil utility floor 1 ECU laundry ceiling damaged
Main laundry room found to have hole in ceiling/and missing drop ceiling tiles

Provide cut sheet of listed repairs



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 09/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	When conducting a walk through verifying the fire door inspection report the following doors were found out of compliance Laundry by room 102 Room 103 Elevator 2 floor 1 and floor 3 broken hardware not latching Panic hardware found broken by room 328 and 228 elevator Room 365 laundry by 302 Elevator door 328
--	--

5 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	
--	--

6 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	The facility failed to provide the following reports Fire damper inspection report meeting NFPA 80 and 105
---	---

7 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	The facility failed to provide the following reports 10 year fire sprinkler head testing or replacement dry pendants 5 year FDC hydro testing Dirty sprinkler heads in Bistro above char broiler
--	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 09/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.

9 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.

(IFC 1032.10.1 2021)

10 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

The facility failed to provide the following reports
Annual emergency lighting inspection report



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 09/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Carbon Monoxide Alarms

Existing Group I or Group R occupancies shall be provided with single station carbon monoxide alarms in accordance with Section 915.4.3. An inspection will occur when alterations, repairs or additions requiring a permit occur, or when one or more sleeping rooms are added or created. The carbon monoxide alarms shall be listed as complying with UL 2034 and be installed and maintained in accordance with NFPA 72 and the manufacturer's instructions.

EXCEPTIONS: 1. For other than R-2 occupancies, if the building does not contain a fuel-burning appliance, a fuelburning fireplace, or an attached garage.

2. Work involving the exterior surfaces of dwellings, such as the replacement of roofing or siding, or the addition or replacement of windows or doors, or the addition of a porch or deck, or electrical permits.

3. Installation, alteration or repairs of noncombustion plumbing or mechanical systems.

4. Sleeping units or dwelling units in I and R-1 occupancies and R-2 college dormitories, hotel, DOC prisons and work releases and assisted living facilities and residential treatment facilities licensed by the state of Washington which do not themselves contain a fuel-burning appliance, a fuel-burning fireplace, or have an attached garage, need not be provided with carbon monoxide alarms provided that:

4.1. The sleeping units or dwelling unit is not adjacent to any room which contains a fuel-burning appliance, a fuel-burning fireplace, or an attached garage; and

4.2. The sleeping units or dwelling unit is not connected by duct work or ventilation shafts with a supply or return register in the same room to any room containing a fuel-burning appliance, a fuel-burning fireplace, or to an attached garage; and

4.3. The building is provided with a common area carbon monoxide detection system.

5. An open parking garage, as defined in the International Building Code, or enclosed parking garage ventilated in accordance with Section 404 of the



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 09/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

International Mechanical Code shall not be considered an attached garage.

(IFC 1103.9 2018)

12 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Generator fuel testing failed/has not been repaired yet

13 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 09/23/2025 the Office of the State Fire Marshal conducted an inspection at your facility.


Code Requirement

Statement of Violation

Next inspection scheduled on or after: 10/23/2025

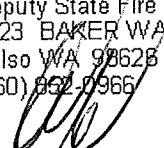
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Andrea Pineda Executive Director
Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."	
---	--

2 Ceiling Clearance

Storage shall be maintained 2 feet (610 mm) or more below the ceiling in nonsprinklered areas of buildings or not less than 18 inches (457 mm) below sprinkler head deflectors in sprinklered areas of buildings. Exceptions: 1. The 2-foot (610 mm) ceiling clearance is not required for storage along walls in nonsprinklered areas of buildings. 2. The 18-inch (457 mm) ceiling clearance is not required for storage along walls in areas of buildings equipped with an automatic sprinkler system in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3. (IFC 315.2.1 2021)	Corrected
---	-----------

3 Means of Egress - Storage in Buildings

Combustible materials shall not be stored in exits or enclosures for stairways and ramps. Combustible materials in the means of egress during construction, demolition, remodeling or alterations shall comply with Section 3311.3. (IFC 315.3.2 2021)	Corrected
---	-----------

4 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5. (IFC 315.2.3 2021)	Corrected
--	-----------



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes. (IFC 603.2.2, 2021)	Corrected
---	-----------

6 Working Space and Clearance

Working space and clearances. Working space around electrical equipment shall be provided in accordance with Section 110.26 of NFPA 70 for electrical equipment rated 1,000 volts or less, and Section 110.32 of NFPA 70 for electrical equipment rated over 1,000 volts. The minimum required working space shall be not less than 30 inches (762 mm) in width, 36 inches (914 mm) in depth and 78 inches (1981 mm) in height in front of electrical service equipment. Where the electrical service equipment is wider than 30 inches (762 mm), the minimum working space shall be not less than the width of the equipment. Storage of materials shall not be located within the designated working space. (IFC 603.4, 2021)	Corrected
--	-----------

7 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle. Exceptions: 1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment. 2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices. (IFC 603.5.2, 2021)	Corrected
---	-----------



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

Corrected

9 Prohibited Areas

Corrected

10 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Strain protection found missing for gas cooking appliances on wheels



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The facility failed to provide inventory and annual inspection of fire resistance rated construction

The following areas found to have holes and damage
Attic

Mechanical room by 327 found to have holes in wall

Soil utility floor 1 ECU laundry ceiling damaged

Main laundry room found to have hole in ceiling/and missing drop ceiling tiles

12 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

The facility failed to provide the following reports

Annual inspection of fire doors

The following doors found out of compliance due to excessive gaps

Stairwell door at room 365

Room 359

Room 103

Room 102

Laundry room by room 102

Room 314

Items found on fire doors in the following locations:

Room 316

Panic hardware found broken by room 328 and 228 elevator



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

13 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	The following door fail to be self closing Laundry room by room 317 fails to be self closing Laundry room by 302 Stairwell by room 236
--	---

14 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	The facility failed to provide the following reports Fire damper inspection report
---	---

15 Restricted Occupancies

Natural cut trees shall be prohibited in the following occupancies: 1. Group I; and 2. R-2 occupancies providing licensed care to clients in one of the categories listed in the International Building Code, Section 310.1, licensed by Washington state. (IFC 806.1.1, 2021 WAC 51-54A)	Corrected
--	-----------

16 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	The facility failed to provide the following reports 10 year fire sprinkler head testing or replacement dry pendants 5 year FDC hydro testing Dirty sprinkler heads in Bistro above char broiler
--	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

17 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows: 1. Carbon dioxide extinguishing systems, NFPA 12. 2. Automatic sprinkler systems, NFPA 13. 3. Automatic water mist systems, NFPA 750. 4. Foam-water sprinkler system or foam-water spray systems, NFPA 16. 5. Dry-chemical extinguishing systems, NFPA 17. 6. Wet-chemical extinguishing systems, NFPA 17A. EXCEPTIONS: 1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code. 2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300. (IFC 904.13 2021 WAC 51-54A)	Corrected
--	------------------



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

18 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Hood suppression system found tagged non complaint in main kitchen

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.

19 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

20 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Corrected
--	-----------

21 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed. (IFC 907.8.3 2021)	05/23/2025 Corrected
--	----------------------

22 Illumination

Exit signs shall be internally or externally illuminated. Exception: Tactile signs required by Section 1013.4 need not be provided with illumination. (IFC 1013.3 2021)	Corrected
---	-----------

23 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired. (IFC 1032.10.1 2021)	The facility failed to provide the following reports Monthly emergency lighting inspection report
---	--



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

24 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

The facility failed to provide the following reports

Annual emergency lighting inspection report



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

25 Carbon Monoxide Alarms

Existing Group I or Group R occupancies shall be provided with single station carbon monoxide alarms in accordance with Section 915.4.3. An inspection will occur when alterations, repairs or additions requiring a permit occur, or when one or more sleeping rooms are added or created. The carbon monoxide alarms shall be listed as complying with UL 2034 and be installed and maintained in accordance with NFPA 72 and the manufacturer's instructions.

EXCEPTIONS: 1. For other than R-2 occupancies, if the building does not contain a fuel-burning appliance, a fuelburning fireplace, or an attached garage.

2. Work involving the exterior surfaces of dwellings, such as the replacement of roofing or siding, or the addition or replacement of windows or doors, or the addition of a porch or deck, or electrical permits.

3. Installation, alteration or repairs of noncombustion plumbing or mechanical systems.

4. Sleeping units or dwelling units in I and R-1 occupancies and R-2 college dormitories, hotel, DOC prisons and work releases and assisted living facilities and residential treatment facilities licensed by the state of Washington which do not themselves contain a fuel-burning appliance, a fuel-burning fireplace, or have an attached garage, need not be provided with carbon monoxide alarms provided that:

4.1. The sleeping units or dwelling unit is not adjacent to any room which contains a fuel-burning appliance, a fuel-burning fireplace, or an attached garage; and

4.2. The sleeping units or dwelling unit is not connected by duct work or ventilation shafts with a supply or return register in the same room to any room containing a fuel-burning appliance, a fuel-burning fireplace, or to an attached garage; and

4.3. The building is provided with a common area carbon monoxide detection system.

5. An open parking garage, as defined in the International Building Code, or enclosed parking garage ventilated in accordance with Section 404 of the

Carbon monoxide detectors shall be added/maintained as required



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

International Mechanical Code shall not be considered an attached garage.

(IFC 1103.9 2018)

26 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The facility failed to provide the following reports
Annual generator fuel testing

27 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

Unsecured compressed oxygen cylinders found in room 255 and kitchen



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

28 Alcohol-based hand rubs classified as Class I or II liquids.

The use of wall-mounted dispensers containing alcohol-based hand rubs classified as Class I or II liquids shall be in accordance with all of the following:

1. The maximum capacity of each dispenser shall be 68 ounces (2 L).
2. The minimum separation between dispensers shall be 48 inches (1219 mm).
3. The dispensers shall not be installed above below or closer than 1 inch to a electrical receptacle, switch, appliance, device or other ignition source. The wall space between the dispenser and the floor or intervening counter top shall be free of electrical receptacles, switch's, appliances, devices or other ignition source. directly adjacent to, directly above or below an electrical receptacle, switch, appliance, device or other ignition source. The wall space between the dispenser and the floor shall remain clear and unobstructed.
4. Dispensers shall be mounted so that the bottom of the dispenser is a minimum of 42 inches (1067 mm) and a maximum of 48 inches (1219 mm) above the finished floor.
5. Dispensers shall not release their contents except when the dispenser is manually activated. Facilities shall be permitted to install and use automatically activated "touch free" alcohol-based hand-rub dispensing devices with the following requirements:
 - 5.1. The facility or persons responsible for the dispensers shall test the dispensers each time a new refill is installed in accordance with the manufacturers care and use instructions.
 - 5.2. Dispensers shall be designed and must operate in a manner that ensures accidental or malicious activations of the dispensing device are minimized. At a minimum, all devices subject to or used in accordance with this section shall have the following safety features:
 - 5.2.1. Any activations of the dispenser shall only occur when an object is placed within 4 inches (98 mm) of the

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

sensing device.

5.2.2. The dispenser shall not dispense more than the amount required for hand hygiene consistent with label instructions as regulated by the United States Food and Drug Administration (USFDA).

5.2.3. An object placed within the activation zone and left in place will cause only one activation.

6. Storage and use of alcohol-based hand rubs shall be in accordance with the applicable provisions of Sections 5704 and 5705.

7. Dispensers installed in occupancies with carpeted floors shall only be allowed in smoke compartments or fire areas equipped throughout with an approved automatic sprinkler system in accordance with Section 903.3.1.1 or 903.3.1.2.

(IFC 5705.5 2012)

29 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.

(2) A detailed written record of all fire drills shall be maintained and available for inspection.

(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 07/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement


Statement of Violation

Next inspection scheduled on or after: 08/28/2025


Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 867-0866


Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

2 Ceiling Clearance

Storage shall be maintained 2 feet (610 mm) or more below the ceiling in nonsprinklered areas of buildings or not less than 18 inches (457 mm) below sprinkler head deflectors in sprinklered areas of buildings.

Exceptions:

1. The 2-foot (610 mm) ceiling clearance is not required for storage along walls in nonsprinklered areas of buildings.
2. The 18-inch (457 mm) ceiling clearance is not required for storage along walls in areas of buildings equipped with an automatic sprinkler system in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3.

(IFC 315.2.1 2021)

Facility failed to maintain 18 inches of clearance around sprinkler head in room 314

3 Means of Egress - Storage in Buildings

Combustible materials shall not be stored in exits or enclosures for stairways and ramps. Combustible materials in the means of egress during construction, demolition, remodeling or alterations shall comply with Section 3311.3.

(IFC 315.3.2 2021)

Storage shall be removed from stairwells though the building
Stairwell by room 344

4 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5.

(IFC 315.2.3 2021)

Main electrical room found to have storage

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol

Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir of Glenwood Place

Provider Number 2645

Address 5500 82ND AVE ,

Approval Status Disapproved

City, State, Zip Vancouver, WA 98662

Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes.

(IFC 603.2.2, 2021)

Electrical light switch cover found broken in storage room across from room 364

Electrical cover broken memory care hallway

Parking garage elevator machine room elevator cover off exposing electrical

6 Working Space and Clearance

Working space and clearances. Working space around electrical equipment shall be provided in accordance with Section 110.26 of NFPA 70 for electrical equipment rated 1,000 volts or less, and Section 110.32 of NFPA 70 for electrical equipment rated over 1,000 volts. The minimum required working space shall be not less than 30 inches (762 mm) in width, 36 inches (914 mm) in depth and 78 inches (1981 mm) in height in front of electrical service equipment. Where the electrical service equipment is wider than 30 inches (762 mm), the minimum working space shall be not less than the width of the equipment. Storage of materials shall not be located within the designated working space.

(IFC 603.4, 2021)

Storage found in front of electrical panels in the following locations:

Electrical room across from room 364
Main kitchen

7 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle.

Exceptions:

1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment.

2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices.

(IFC 603.5.2, 2021)

Powerstrip plugged into powerstrip in room 308



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

8 Extension Cords

Extension cords. Extension cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors..

(IFC 603.6 2021)

CUE third floor found to have extension cord for permanent wiring

9 Prohibited Areas

RCC office found to have heater within 3 feet of combustibles

10 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Strain protection found missing for gas cooking appliances on wheels

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The facility failed to provide inventory and annual inspection of fire resistance rated construction

The following areas found to have holes and damage
Attic
Mechanical room by 327 found to have holes in wall
Soil utility floor 1 ECU laundry ceiling damaged
Main laundry room found to have hole in ceiling/and missing drop ceiling tiles

12 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

The facility failed to provide the following reports

Annual inspection of fire doors

The following doors found out of compliance due to excessive gaps

Stairwell door at room 365
Room 359
Room 103
Room 102
Laundry room by room 102
Room 314

Items found on fire doors in the following locations:
Room 316

Panic hardware found broken by room 328 and 228 elevator



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir of Glenwood Place

Provider Number 2645

Address 5500 82ND AVE ,

Approval Status Disapproved

City, State, Zip Vancouver, WA 98662

Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

13 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The following door fail to be self closing

Laundry room by room 317 fails to be self closing
Laundry room by 302
Stairwell by room 236

14 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.

(IFC 706.1 2018)

The facility failed to provide the following reports

Fire damper inspection report

15 Restricted Occupancies

Natural cut trees shall be prohibited in the following occupancies:

1. Group I; and
2. R-2 occupancies providing licensed care to clients in one of the categories listed in the International Building Code, Section 310.1, licensed by Washington state.

(IFC 806.1.1 2021 WAC 51-54A)

Room 237 found to have cut branch's in corridor



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

16 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The facility failed to provide the following reports

10 year fire sprinkler head testing or replacement dry pendants
5 year FDC hydro testing

Quarterly fire sprinkler inspection reports for first quarter of 2025 and third quarter of 2024

Excessive dust found on sprinkler head in laundry room by room 302

Dirty sprinkler heads in Bistro above char broiler

Fire sprinkler contractor on site without certification

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir of Glenwood Place

Provider Number 2645

Address 5500 82ND AVE ,

Approval Status Disapproved

City, State, Zip Vancouver, WA 98662

Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

17 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Automatic water mist systems, NFPA 750.
4. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
5. Dry-chemical extinguishing systems, NFPA 17.
6. Wet-chemical extinguishing systems, NFPA 17A.

EXCEPTIONS:

1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.
2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300.

(IFC 904.13 2021 WAC 51-54A)

Facility failed to provide signage on kitchen hood suppression systems memory care



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir of Glenwood Place

Address 5500 82ND AVE ,

City, State, Zip Vancouver, WA 98662

Provider Number 2645

Approval Status Disapproved

Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

18 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Hood suppression system found tagged non complaint in main kitchen

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.

19 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

Fire extinguisher found dented in bistro kitchen



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

20 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.
(IFC 907.8 2021)

The facility failed to provide the following reports
Semi annual fire alarm inspection report

Fire alarm system in trouble at time of inspection
2 smoke detectors failed and have not been replaced

21 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.
(IFC 907.8.3 2021)

The facility failed to provide the following reports
Sensitivity testing report

22 Illumination

Exit signs shall be internally or externally illuminated.

Exception: Tactile signs required by Section 1013.4 need not be provided with illumination.
(IFC 1013.3 2021)

Exit sign first floor north central stairwell inoperational

23 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired.
(IFC 1032.10.1 2021)

The facility failed to provide the following reports
Monthly emergency lighting inspection report



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98662	Facility Type	Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

24 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

The facility failed to provide the following reports

Annual emergency lighting inspection report

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

25 Carbon Monoxide Alarms

Existing Group I or Group R occupancies shall be provided with single station carbon monoxide alarms in accordance with Section 915.4.3. An inspection will occur when alterations, repairs or additions requiring a permit occur, or when one or more sleeping rooms are added or created. The carbon monoxide alarms shall be listed as complying with UL 2034 and be installed and maintained in accordance with NFPA 72 and the manufacturer's instructions.

EXCEPTIONS: 1. For other than R-2 occupancies, if the building does not contain a fuel-burning appliance, a fireplace, or an attached garage.

2. Work involving the exterior surfaces of dwellings, such as the replacement of roofing or siding, or the addition or replacement of windows or doors, or the addition of a porch or deck, or electrical permits.

3. Installation, alteration or repairs of noncombustion plumbing or mechanical systems.

4. Sleeping units or dwelling units in I and R-1 occupancies and R-2 college dormitories, hotel, DOC prisons and work releases and assisted living facilities and residential treatment facilities licensed by the state of Washington which do not themselves contain a fuel-burning appliance, a fuel-burning fireplace, or have an attached garage, need not be provided with carbon monoxide alarms provided that:

4.1. The sleeping units or dwelling unit is not adjacent to any room which contains a fuel-burning appliance, a fuel-burning fireplace, or an attached garage; and

4.2. The sleeping units or dwelling unit is not connected by duct work or ventilation shafts with a supply or return register in the same room to any room containing a fuel-burning appliance, a fuel-burning fireplace, or to an attached garage; and

4.3. The building is provided with a common area carbon monoxide detection system.

5. An open parking garage, as defined in the International Building Code, or enclosed parking garage ventilated in accordance with Section 404 of the

Carbon monoxide detectors shall be added/maintained as required



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir of Glenwood Place

Address 5500 82ND AVE ,

City, State, Zip Vancouver, WA 98662

Provider Number 2645

Approval Status Disapproved

Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

International Mechanical Code shall not be considered an attached garage.

(IFC 1103.9 2018)

26 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

The facility failed to provide the following reports

Annual generator fuel testing

Missing monthly generator testing for May and June

Missing weekly generator testing

27 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

Unsecured compressed oxygen cylinders found in room 255 and kitchen



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Cogir of Glenwood Place

Address 5500 82ND AVE ,

City, State, Zip Vancouver, WA 98662

Provider Number 2645

Approval Status Disapproved

Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

28 Alcohol-based hand rubs classified as Class I or II liquids.

The use of wall-mounted dispensers containing alcohol-based hand rubs classified as Class I or II liquids shall be in accordance with all of the following:

1. The maximum capacity of each dispenser shall be 68 ounces (2 L).
2. The minimum separation between dispensers shall be 48 inches (1219 mm).
3. The dispensers shall not be installed above below or closer than 1 inch to a electrical receptacle, switch, appliance, device or other ignition source. The wall space between the dispenser and the floor or intervening counter top shall be free of electrical receptacles, switch's, appliances, devices or other ignition source. directly adjacent to, directly above or below an electrical receptacle, switch, appliance, device or other ignition source. The wall space between the dispenser and the floor shall remain clear and unobstructed.
4. Dispensers shall be mounted so that the bottom of the dispenser is a minimum of 42 inches (1067 mm) and a maximum of 48 inches (1219 mm) above the finished floor.
5. Dispensers shall not release their contents except when the dispenser is manually activated. Facilities shall be permitted to install and use automatically activated "touch free" alcohol-based hand-rub dispensing devices with the following requirements:
 - 5.1. The facility or persons responsible for the dispensers shall test the dispensers each time a new refill is installed in accordance with the manufacturers care and use instructions.
 - 5.2. Dispensers shall be designed and must operate in a manner that ensures accidental or malicious activations of the dispensing device are minimized. At a minimum, all devices subject to or used in accordance with this section shall have the following safety features:
 - 5.2.1. Any activations of the dispenser shall only occur when an object is placed within 4 inches (98 mm) of the

ABHR in main laundry room found directly over electrical



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

sensing device.

5.2.2. The dispenser shall not dispense more than the amount required for hand hygiene consistent with label instructions as regulated by the United States Food and Drug Administration (USFDA).

5.2.3. An object placed within the activation zone and left in place will cause only one activation.

6. Storage and use of alcohol-based hand rubs shall be in accordance with the applicable provisions of Sections 5704 and 5705.

7. Dispensers installed in occupancies with carpeted floors shall only be allowed in smoke compartments or fire areas equipped throughout with an approved automatic sprinkler system in accordance with Section 903.3.1.1 or 903.3.1.2.

(IFC 5705.5 2012)

29 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state and inspected by the state fire marshal's office, at least twelve planned and unannounced fire drills shall be held every year.

(1) Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions.

(2) A detailed written record of all fire drills shall be maintained and available for inspection.

(3) When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms.

The facility failed to provide the following reports

Facility failed to activate the fire alarm system during fire drills
Fire drills reports are unclear of when drills are completed



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA 98662

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 05/20/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

Next inspection scheduled on or after: 06/19/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Dustin Morgan Maintenance Director
Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966

Nicholas D. Wolden
Signature

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 01/21/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."

2 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

The facility failed to provide inventory and annual inspection of fire resistance rated construction

3 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name Cogir of Glenwood Place
Address 5500 82ND AVE ,
City, State, Zip Vancouver, WA

Provider Number 2645
Approval Status Disapproved
Facility Type Residential Care

On 01/21/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.

(IFC 706.1 2018)

corrected

5 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

corrected

6 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

corrected

7 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes.

(IFC 1031.10.2 2021)

corrected

8 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

corrected



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cogir of Glenwood Place	Provider Number	2645
Address	5500 82ND AVE ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA	Facility Type	Residential Care

On 01/21/2025 the Office of the State Fire Marshal conducted an inspection at your facility.


Code Requirement

Statement of Violation

Next inspection scheduled on or after: 02/20/2025


Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Zachary Gonzales / Maintenance Director 1/21/26
Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature

This document was prepared by Residential Care Services for the Locator website.