



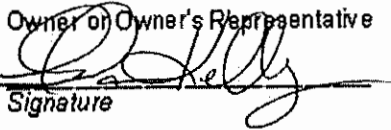
Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Fieldstone Cooper Point - Bldg 2	Provider Number	2688
Address	810 SW Fieldstone DR , BLDG 2	Approval Status	Approved
City, State, Zip	Olympia, WA 98502	Facility Type	Residential Care

On 05/07/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

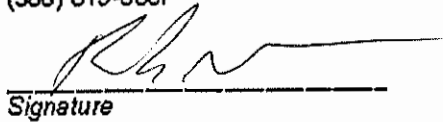
All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

Shannon Kelly Maint. Director
Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Fieldstone Cooper Point - Bldg 2	Provider Number	2504
Address	810 SW Fieldstone DR , BLDG 2	Approval Status	Disapproved
City, State, Zip	Olympia, WA 98502	Facility Type	Residential Care

On 03/06/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Application and Use

603.5.2 Application and use. Relocatable power taps and current taps shall be directly connected to a permanently installed receptacle.

Exceptions:

1. Where approved for use in a Group A occupancy or in a meeting room in a Group B occupancy, not more than five relocatable power taps shall be permitted to be connected together or connected to an extension cord for temporary use to supply power to electronic equipment.

2. Current taps and relocatable power taps shall not be required to connect directly to a permanently installed receptacle outlet where used for 90 days or less for the purpose of testing the performance of such devices.

(IFC 603.5.2, 2021)

Findings during inspection were:

2nd floor activity room had a power strip plugged into a power block in the back left corner of room.

2 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Findings during inspection were:

Pressure gauges in stairwells fire sprinkler pipes are over 5 years old, from 2017.

3 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2021)

Findings during inspection were:

Facility failed to provide annual generator inspection report.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Fieldstone Cooper Point - Bldg 2	Provider Number	2504
Address	810 SW Fieldstone DR , BLDG 2	Approval Status	Disapproved
City, State, Zip	Olympia, WA 98502	Facility Type	Residential Care

On 03/06/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement


Statement of Violation

Next inspection scheduled on or after: 04/06/2025


Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Raul Murcia
PO BOX 42642
Olympia WA 98504
(360) 819-0067


Signature

This document was prepared by Residential Care Services for the Locator website.