



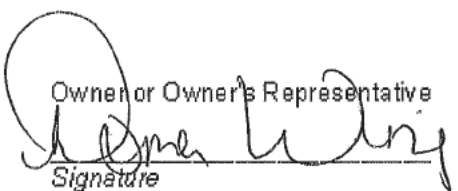
Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Chehalis West Retirement Center Inc	Provider Number	000783
Address	478 NW QUINCY PL ,	Approval Status	Approved
City, State, Zip	Chehalis, WA	Facility Type	Residential Care

On 05/01/2026 the Office of the State Fire Marshal conducted an inspection at your facility.


All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature


Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Chehalis West Retirement Center Inc	Provider Number	000783
Address	478 NW QUINCY PL ,	Approval Status	Disapproved
City, State, Zip	Chehalis, WA	Facility Type	Residential Care

On 02/27/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A. (IFC 0603.5.1, 2021)	None approved multi plug adapter in room 41
--	---

2 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions. (IFC 606.4 2021)	Facility failed to connect strain protection in kitchen cooking appliances
--	--

3 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	Holes in maintenance office around conduct Broken ceiling access panel in clean utility room
---	---

4 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	Facility failed to provide the following items reports: 5 year FDC hydro static inspection 5 year internal report
--	---



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name Chehalis West Retirement Center Inc
Address 478 NW QUINCY PL ,
City, State, Zip Chehalis, WA

Provider Number 000783
Approval Status Disapproved
Facility Type Residential Care

On 02/27/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

5 Commercial Cooking Systems

904.13 Commercial cooking systems. The automatic fire-extinguishing system for commercial cooking systems shall be of a type recognized for protection of commercial cooking equipment and exhaust systems of the type and arrangement protected. Preengineered automatic dry- and wet-chemical extinguishing systems shall be tested in accordance with UL 300 and listed and labeled for the intended application. Other types of automatic fireextinguishing systems shall be listed and labeled for specific use as protection for commercial cooking operations. The system shall be installed in accordance with this code, NFPA 96, its listing and the manufacturer's installation instructions. Additional protection is not required for ductwork beyond 75 feet when hood suppression system complies with UL 300. Signage shall be provided on the exhaust hood or system cabinet, indicating the type and arrangement of cooking appliances protected by the automatic fire-extinguishing system. Signage shall indicate appliances from left to right, be durable, and the size, color, and lettering shall be approved. Automatic fireextinguishing systems of the following types shall be installed in accordance with the referenced standard indicated, as follows:

1. Carbon dioxide extinguishing systems, NFPA 12.
2. Automatic sprinkler systems, NFPA 13.
3. Automatic water mist systems, NFPA 750.
4. Foam-water sprinkler system or foam-water spray systems, NFPA 16.
5. Dry-chemical extinguishing systems, NFPA 17.
6. Wet-chemical extinguishing systems, NFPA 17A.

EXCEPTIONS:

1. Factory-built commercial cooking recirculating systems that are tested in accordance with UL 710B and listed, labeled and installed in accordance with Section 304.1 of the International Mechanical Code.
2. Protection of duct systems beyond 75 feet when the commercial kitchen exhaust hood is protected by a system listed in accordance with UL 300.

(IFC 904.13 2021 WAC 51-54A)

Kitchen signage shall be updated due to new cooking appliances



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

Business Name	Chehalis West Retirement Center Inc	Provider Number	000783
Address	478 NW QUINCY PL ,	Approval Status	Disapproved
City, State, Zip	Chehalis, WA	Facility Type	Residential Care

On 02/27/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Fusible Link Maintenance

Fixed temperature-sensing elements shall be maintained to ensure proper operation of the system.

(IFC 904.6.2 2021)

Heat survey shall be completed due to new cooking appliances

7 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed.


(IFC 907.8.3 2021)

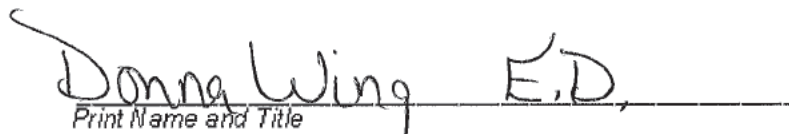
Smoke detectors that failed sensitivity testing shall be replaced

Next inspection scheduled on or after: 03/29/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature