



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Hearthstone Moses Lake	Provider Number	2524
Address	905 S PIONEER WAY ,	Approval Status	Approved
City, State, Zip	Moses Lake, WA 98837	Facility Type	Residential Care

On 10/29/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

Gauri Ahmann
Signature

Laurie Ahmann, Exec. Dir.
Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121

Alan Harlan
Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Hearthstone Moses Lake	Provider Number	2524
Address	905 S PIONEER WAY ,	Approval Status	Disapproved
City, State, Zip	Moses Lake, WA 98837	Facility Type	Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared."	On 10/06/2025 an unannounced Fire and Life Safety Code re-inspection was conducted at Brookdale Hearthstone Moses Lake by a representative of the Washington State Patrol, State Fire Marshal's Office to determine compliance with all applicable codes. The following deficiencies were cited as a result of this inspections.
---	--

2 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes. (IFC 603.2.2, 2021)	Corrected
---	-----------

3 Relocatable power taps and current taps

Relocatable power taps and current taps. The construction and use of current taps and relocatable power taps shall be in accordance with NFPA 70 and this code. (IFC 603.5, 2021)	Corrected
--	-----------

4 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	Facility was unable to provide documentation that the annual inspection of fire-resistance rated construction had been performed. All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Hearthstone Moses Lake	Provider Number	2524
Address	905 S PIONEER WAY ,	Approval Status	Disapproved
City, State, Zip	Moses Lake, WA 98837	Facility Type	Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Penetrations - Maintaining Protection

Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions. (IFC 703.1 2021)	The following violation was observed: Throughout facility large holes behind AC units in rooms.
---	--

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	Corrected
--	-----------

7 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Hearthstone Moses Lake
Address 905 S PIONEER WAY ,
City, State, Zip Moses Lake, WA 98837

Provider Number 2524
Approval Status Disapproved
Facility Type Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

8 Inspection, Testing and Maintenance

Fire protection and life safety systems shall be maintained in an operative condition at all times, and shall be replaced or repaired where defective. Nonrequired fire protection and life safety systems and equipment shall be inspected, tested and maintained or removed in accordance with Section 901.8. (IFC 901.6 2021)	Corrected
---	-----------

9 Standards.

Sprinkler systems shall be designed and installed in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3 and other chapters of this code, as applicable. (IFC 903.3.1)	The following violation was observed: Was unable to locate calculation plate on riser. Calculation plates have been installed, but not filled out.
--	--

10 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Hearthstone Moses Lake
Address 905 S PIONEER WAY ,
City, State, Zip Moses Lake, WA 98837

Provider Number 2524
Approval Status Disapproved
Facility Type Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

11 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10.

Exceptions:

1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies.
2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met:
 - 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed.
 - 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal.
 - 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment.
 - 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed.
 - 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10.
3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations.

(IFC 906.2 2021)

The following violation was observed:

- 1) Annual fire extinguisher Servicing had been performed.. (NFPA 10. 7.3)

12 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Hearthstone Moses Lake	Provider Number	2524
Address	905 S PIONEER WAY ,	Approval Status	Disapproved
City, State, Zip	Moses Lake, WA 98837	Facility Type	Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

13 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Corrected
--	-----------

14 Activation Test

Emergency lighting equipment shall be tested monthly for a duration of not less than 30 seconds. The test shall be performed manually or by an automated self-testing and self-diagnostic routine. Where testing is performed by self-testing and self-diagnostics, a visual inspection of the emergency lighting equipment shall be conducted monthly to identify any equipment displaying a trouble indicator or that has become damaged or otherwise impaired. (IFC 1032.10.1 2021)	Corrected
---	-----------

15 Power Test

Battery-powered emergency lighting equipment shall be tested annually by operating the equipment on battery power for not less than 90 minutes. (IFC 1031.10.2 2021)	Corrected
---	-----------

16 Reliability

Required exit accesses, exits and exit discharges shall be continuously maintained free from obstructions or impediments to full instant use in the case of fire or other emergency when the building area served by the means of egress is occupied. An exit or exit passageway shall not be used for any purpose that interferes with a means of egress. (IFC 1032.2 2021)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Brookdale Hearthstone Moses Lake	Provider Number	2524
Address	905 S PIONEER WAY ,	Approval Status	Disapproved
City, State, Zip	Moses Lake, WA 98837	Facility Type	Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
17 Circuit identification and Accessibility	
10.6.5.2 Circuit Identification and Accessibility. 10.6.5.2.1 The location of the branch circuit disconnecting means shall be permanently identified at the control unit. 10.6.5.2.2 System circuit disconnecting means shall be permanently identified as to its purpose in accordance with the following: (1) "FIRE ALARM" for fire alarm systems (2) "EMERGENCY COMMUNICATIONS" for emergency communications systems (3) "FIRE ALARM/ECS" for combination fire alarm and emergency communications systems 10.6.5.2.3 For fire alarm and/or signaling systems, the circuit disconnecting means shall have a red marking. 10.6.5.2.4 The red marking shall not damage the overcurrent protective devices or obscure the manufacturer's markings. 10.6.5.2.5 The circuit disconnecting means shall be accessible only to authorized personnel. 10.6.5.3 Mechanical Protection. The branch circuit(s) and connections shall be protected against physical damage. 10.6.5.4 Circuit Breaker Lock. Where a circuit breaker is the disconnecting means, a listed breaker locking device shall be installed. 10.6.5.5 Overcurrent Protection. An overcurrent protective device of suitable current-carrying capacity that is capable of interrupting the maximum short-circuit current to which it can be subject shall be provided in each ungrounded conductor. (NFPA 72 10.6.5.2)	Corrected

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Brookdale Hearthstone Moses Lake
Address 905 S PIONEER WAY ,
City, State, Zip Moses Lake, WA 98837

Provider Number 2524
Approval Status Disapproved
Facility Type Residential Care

On 10/6/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

18 Fire Drills

In all Group I, Group E, and Group R2 Occupancies licensed by the state, at least twelve planned and unannounced fire drills shall be held every year. Drills shall be conducted quarterly on each shift in Group I and Group R2, Occupancies and monthly in Group E Occupancies to familiarize personnel with signals and emergency action required under varied conditions. A detailed written record of all fire drills shall be maintained and available for inspection at all times. When drills are conducted between 9:00 p.m. and 6:00 a.m., a coded announcement may be used instead of audible alarms. Fire drills shall include the transmission of a fire alarm signal and simulation of emergency conditions. The fire alarm monitoring company shall be notified prior to the activation of the fire alarm system for drill purposes and again at the conclusion of the transmission and restoration of the fire alarm system to normal mode.

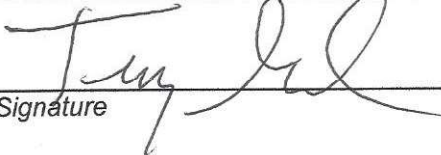
(WAC 212-12-044)

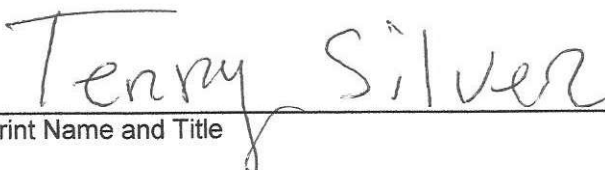
Corrected

Next inspection scheduled on or after: 11/5/2025

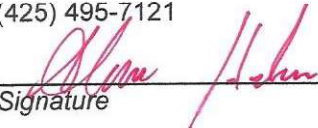
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121


Signature