



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Blossom Creek Senior Alzheimer Comm	Provider Number	2721
Address	1740 MADISON ST ,	Approval Status	Disapproved
City, State, Zip	Wenatchee, WA 98801	Facility Type	Residential Care

On 03/17/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically.

(IFC 705.2.4 2021)

The following violation was observed:

-MC #1 and MC #2 doors failed to fully close and latch when released from the fully open position. (Corrected)

2 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

The following violation was observed:

-The facility failed to provide documentation of the annual forward flow testing on the sprinkler system within the past twelve months. (Violation remains)

3 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

The following violation was observed:

-The facility was unable to provide documentation of the semi-annual fire alarm system inspection and testing within the past twelve months. (Corrected)



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Blossom Creek Senior Alzheimer Comm	Provider Number	2721
Address	1740 MADISON ST ,	Approval Status	Disapproved
City, State, Zip	Wenatchee, WA 98801	Facility Type	Residential Care

On 03/17/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

4 Delayed Egress Locking System

The delayed egress locking system shall be installed and operated in accordance with all of the following:

1. The delay electronics of the delayed egress locking system shall deactivate upon actuation of the automatic sprinkler system or automatic fire detection system, allowing immediate, free egress.
2. The delay electronics of the delayed egress locking system shall deactivate upon loss of power controlling the lock or lock mechanism, allowing immediate free egress.
3. The delayed egress locking system shall have the capability of being deactivated at the fire command center and other approved locations.
4. An attempt to egress shall initiate an irreversible process that shall allow such egress in not more than 15 seconds when a physical effort to exit is applied to the egress side door hardware for not more than 3 seconds. Initiation of the irreversible process shall activate an audible signal in the vicinity of the door. Once the delay electronics have been deactivated, rearming the delay electronics shall be by manual means only.
Exception: Where approved , a delay of not more than 30 seconds is permitted on a delayed egress door.
5. The egress path from any point shall not pass through more than one delayed egress locking system.
Exceptions:
 1. In Group I-1, Condition 2, Group I-2 or I-3 occupancies, the egress path from any point in the building shall pass through not more than two delayed egress locking systems provided that the combined delay does not exceed 30 seconds.
 2. In Group I-1, Condition 1 or Group I-4 occupancies, the egress path from any point in the building shall pass through not more than two delayed egress locking systems provided that the combined delay does not exceed 30 seconds and the building is equipped throughout with an automatic sprinkler system in accordance with Section 903.3.1.1.
6. A sign shall be provided on the door and shall be located above and within 12 inches (305 mm) of the door exit hardware:

The following violations were observed:

- The delayed egress system was not activating at Door #6. (Corrected)
- The delayed egress system was not unlatching at MC Door #2 after activation. (Corrected)



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Blossom Creek Senior Alzheimer Comm	Provider Number	2721
Address	1740 MADISON ST ,	Approval Status	Disapproved
City, State, Zip	Wenatchee, WA 98801	Facility Type	Residential Care


On 03/17/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

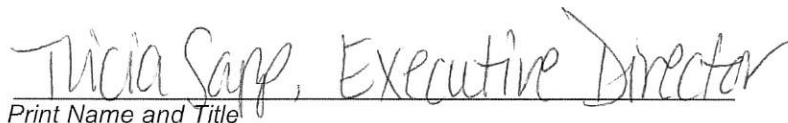
Code Requirement	Statement of Violation
Exception: Where approved , in Group I occupancies, the installation of a sign is not required where care recipients who, because of clinical needs, require restraint or containment as part of the function of the treatment area. 6.1. For doors that swing in the direction of egress, the sign shall read: "PUSH UNTIL ALARM SOUNDS. DOOR CAN BE OPENED IN 15 [30] SECONDS." 6.2. For doors that swing in the opposite direction of egress, the sign shall read: "PULL UNTIL ALARM SOUNDS. DOOR CAN BE OPENED IN 15 [30] SECONDS." 6.3. The sign shall comply with the visual character requirements in ICCA117.1. 7. Emergency lighting shall be provided on the egress side of the door. 8. The delayed egress locking system units shall be listed in accordance with UL 294. (IFC 1010.2.13.1 2021)	

Next inspection scheduled on or after: 04/16/2026

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Andrea Ely
2715 RUDKIN RD
Union Gap WA
(509) 531-3384

Digitally signed by
Andrea Ely
Date: 2026.03.17
13:07:27 -07'00'

Signature