




Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Washington Odd Fellows Home (BH)	Provider Number	000125
Address	534 BOYER ,	Approval Status	Approved
City, State, Zip	Walla Walla, WA 99362	Facility Type	Residential Care

On 07/19/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

EVP Facilities
Print Name and Title

Deputy State Fire Marshal Doug DeGraff
143302 E Law Lane
Kennewick WA 98007
(509) 531-3384


Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Washington Odd Fellows Home (BH)

Provider Number 000125

Address 534 BOYER ,

Approval Status Disapproved

City, State, Zip Walla Walla, WA 99362

Facility Type Residential Care

On 05/25/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2018)

Documentation reveals the fire doors are past due for the annual inspection (05/31/2022).

2 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2009, 2012, 2015, 2018)

1. Documentation reveals that the fire sprinkler system is past due for 5 year testing (04/2018).
2. A new duct was installed in the scullery completely blocking the sprinkler spray pattern.

3 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

(IFC 1203.4 2018)

The facility is unable to produce documentation of the current annual service/test of the generator.

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Washington Odd Fellows Home (BH)	Provider Number	000125
Address	534 BOYER ,	Approval Status	Disapproved
City, State, Zip	Walla Walla, WA 99362	Facility Type	Residential Care


On 05/25/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

Next inspection scheduled on or after: 06/24/2023

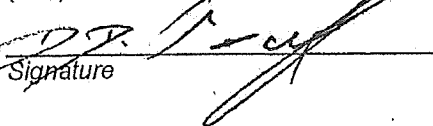
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

PETE HARSIN EVP Facilities
Print Name and Title

Deputy State Fire Marshal Doug DeGraff
143302 E Law Lane
Kennewick WA 98007
(509) 531-3384


Signature

This document was prepared by Residential Care Services for the Locator website.