



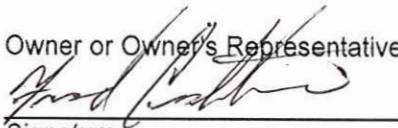
Washington State Patrol  
Fire Protection Bureau  
Phone: (360) 596-3900

|                         |                            |                        |                  |
|-------------------------|----------------------------|------------------------|------------------|
| <b>Business Name</b>    | Maple Glen Assisted Living | <b>Provider Number</b> | 2655             |
| <b>Address</b>          | 1700 N 13TH LOOP RD ,      | <b>Approval Status</b> | Approved         |
| <b>City, State, Zip</b> | Shelton, WA 98584          | <b>Facility Type</b>   | Residential Care |

On 04/17/2025 the Office of the State Fire Marshal conducted an inspection at your facility.


All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative

  
Signature

  
Print Name and Title

Deputy State Fire Marshal Raul Murcia  
PO BOX 42642  
Olympia WA 98504  
(360) 819-0067

  
Signature

**Right of appeal.** Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol  
Fire Protection Bureau  
Phone: (360) 596-3900

|                         |                            |                        |                  |
|-------------------------|----------------------------|------------------------|------------------|
| <b>Business Name</b>    | Maple Glen Assisted Living | <b>Provider Number</b> | 2655             |
| <b>Address</b>          | 1700 N 13TH LOOP RD ,      | <b>Approval Status</b> | Disapproved      |
| <b>City, State, Zip</b> | Shelton, WA 98584          | <b>Facility Type</b>   | Residential Care |

On 02/13/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Ceiling Clearance

Storage shall be maintained 2 feet (610 mm) or more below the ceiling in nonsprinklered areas of buildings or not less than 18 inches (457 mm) below sprinkler head deflectors in sprinklered areas of buildings.  
Exceptions:  
1. The 2-foot (610 mm) ceiling clearance is not required for storage along walls in nonsprinklered areas of buildings.  
2. The 18-inch (457 mm) ceiling clearance is not required for storage along walls in areas of buildings equipped with an automatic sprinkler system in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3.  
(IFC 315.2.1 2021)

Findings during inspection were:

Facility failed to maintain activities storage room on second floor by room 228, less than 18 inches of clearance from sprinkler head.

2 Equipment Rooms

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5.  
(IFC 315.2.3 2021)

Findings during inspection were:

Facility failed to maintain electrical/mechanical room on 1st floor by room 104, combustible material not allowed.

3 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.  
(IFC 903.5 2021)

Findings during inspection were:

Facility failed to provide documentation showing fire department connection five-year hydrostatic test.

Kitchen has sprinkler heads that are loaded with debris.

4 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.  
(IFC 904.13.5.2 2021)

Findings during inspection were:

Facility failed to provide second inspection report that kitchen is being serviced twice a year.



Washington State Patrol  
Fire Protection Bureau  
Phone: (360) 596-3900

|                         |                            |                        |                  |
|-------------------------|----------------------------|------------------------|------------------|
| <b>Business Name</b>    | Maple Glen Assisted Living | <b>Provider Number</b> | 2655             |
| <b>Address</b>          | 1700 N 13TH LOOP RD ,      | <b>Approval Status</b> | Disapproved      |
| <b>City, State, Zip</b> | Shelton, WA 98584          | <b>Facility Type</b>   | Residential Care |

On 02/13/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

**5 Inspection, Testing and Maintenance**

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.  
(IFC 907.8 2021)

Findings during inspection were:


Facility failed to provide annual inspection report for automatic fire alarm system. ✓

Next inspection scheduled on or after: 03/20/2025

**Right of appeal.** Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

  
Signature

  
Print Name and Title

Deputy State Fire Marshal Raul Murcia  
PO BOX 42642  
Olympia WA 98504  
(360) 819-0067

  
Signature