



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name NorthCare Pasco	Provider Number 2666
Address 5921 ROAD 60 ,	Approval Status Approved
City, State, Zip Pasco, WA 99301	Facility Type Residential Care

On 1/5/2026 the Office of the State Fire Marshal conducted an inspection at your facility.

All violations noted during previous related inspection(s) have been corrected.

Owner, or Owner's Representative

Celina Martinez
Signature

Celina Martinez, Manager
Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121

Alan Harlan
Signature

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Admin - (ITM) Inspection, Testing, & Maintenance

Any citation that requires inspection, testing, or maintenance (ITM) is required to have the testing completed, paper results delivered, and any deficiencies found during the ITM corrected before the citation is cleared.	On 10/08/2025 an unannounced Fire and Life Safety Code re-inspection was conducted at NorthCare Pasco by a representative of the Washington State Patrol, State Fire Marshal's Office to determine compliance with all applicable codes. The following deficiencies were cited as a result of this inspections.
--	---

2 Working Space and Clearance

Working space and clearances. Working space around electrical equipment shall be provided in accordance with Section 110.26 of NFPA 70 for electrical equipment rated 1,000 volts or less, and Section 110.32 of NFPA 70 for electrical equipment rated over 1,000 volts. The minimum required working space shall be not less than 30 inches (762 mm) in width, 36 inches (914 mm) in depth and 78 inches (1981 mm) in height in front of electrical service equipment. Where the electrical service equipment is wider than 30 inches (762 mm), the minimum working space shall be not less than the width of the equipment. Storage of materials shall not be located within the designated working space. (IFC 603.4, 2021)	Corrected
--	-----------

3 Listing

603.5.1 Listing. Relocatable power taps shall be listed in accordance with UL 1363. Current taps shall be listed and labeled in accordance with UL 498A. (IFC 603.5.1, 2021)	Corrected
---	-----------

4 Cleaning

Hoods, grease-removal devices, fans, ducts and other appurtenances shall be cleaned at intervals as required by Sections 606.3.3.1 through 606.3.3.3. (IFC 606.3.3 2021)	Corrected
---	-----------



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	Corrected
--	-----------

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	The following violation was observed: The Following doors had magnetic holders holding door open that are not attached to fire system. Building A 1) Room 09 2) Room 16 3) Room 01 Building B 1) Room 02 2) Room 15 Building D 1) Room 13 Educated facility staff on hold open devices on doors.
--	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Door Operation

Swinging fire doors shall close from the full-open position and latch automatically. (IFC 705.2.4 2021)	The following violation was observed: In Building A following doors would not latch from a fully opened position. 1) Room 09 2) Room 16
--	--

8 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	Facility was unable to provide documentation that the 4 year fire/smoke damper inspection had been performed. The facility is documenting the inspection of the damper, but is not checking to the operation of dampener. Scheduled for December. All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected
---	--

9 Testing and Maintenance

	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

10 Portable Fire Extinguishers - General Requirements

Portable fire extinguishers shall be selected, installed and maintained in accordance with this section and NFPA 10. Exceptions: 1. The distance of travel to reach an extinguisher shall not apply. The travel distance to reach an extinguisher shall not apply to the spectator seating portions of Group A-5 occupancies. 2. Thirty-day inspections shall not be required and maintenance shall be allowed to be once every three years for dry-chemical or halogenated agent portable fire extinguishers that are supervised by a listed and approved electronic monitoring device, provided that all of the following conditions are met: 2.1. Electronic monitoring shall confirm that extinguishers are properly positioned, properly charged and unobstructed. 2.2. Loss of power or circuit continuity to the electronic monitoring device shall initiate a trouble signal. 2.3. The extinguishers shall be installed inside of a building or cabinet in a noncorrosive environment. 2.4. Electronic monitoring devices and supervisory circuits shall be tested every 3 years when extinguisher maintenance is performed. 2.5. A written log of required hydrostatic test dates for extinguishers shall be maintained by the owner to verify that hydrostatic tests are conducted at the frequency required by NFPA 10. 3. In Group I-3, portable fire extinguishers shall be permitted to be located at staff locations. (IFC 906.2 2021)	Corrected
---	------------------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

11 Smoke Detector Sensitivity

Smoke detector sensitivity shall be checked within one year after installation and every alternate year thereafter. After the second calibration test, where sensitivity tests indicate that the detector has remained within its listed and marked sensitivity range (or 4-percent obscuration light grey smoke, if not marked), the length of time between calibration tests shall be permitted to be extended to a maximum of 5 years. Where the frequency is extended, records of detector-caused nuisance alarms and subsequent trends of these alarms shall be maintained. In zones or areas where nuisance alarms show any increase over the previous year, calibration tests shall be performed. (IFC 907.8.3 2021)	The facility failed to provide documentation that a sensitivity test had been performed. All inspection reports must verify that the system has no deficiencies, or document that all deficiencies have been corrected
--	---

12 Maintenance

Carbon monoxide alarms and carbon monoxide detection systems shall be maintained in accordance with NFPA 72. Carbon monoxide alarms and carbon monoxide detectors that become inoperable or begin producing end-of-life signals shall be replaced. (IFC 915.6 2021 WAC)	Corrected
--	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

13 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods: 1. Securing containers, cylinders and tanks to a fixed object with one or more restraints. 2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks. 3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress. 4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use. Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing. (IFC 5303.5.3 2021)	Corrected
---	------------------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

14 Circuit Identification and Accessibility

10.6.5.2 Circuit Identification and Accessibility. 10.6.5.2.1 The location of the branch circuit disconnecting means shall be permanently identified at the control unit. 10.6.5.2.2 System circuit disconnecting means shall be permanently identified as to its purpose in accordance with the following: (1) "FIRE ALARM" for fire alarm systems (2) "EMERGENCY COMMUNICATIONS" for emergency communications systems (3) "FIRE ALARM/ECS" for combination fire alarm and emergency communications systems 10.6.5.2.3 For fire alarm and/or signaling systems, the circuit disconnecting means shall have a red marking. 10.6.5.2.4 The red marking shall not damage the overcurrent protective devices or obscure the manufacturer's markings. 10.6.5.2.5 The circuit disconnecting means shall be accessible only to authorized personnel. 10.6.5.3 Mechanical Protection. The branch circuit(s) and connections shall be protected against physical damage. 10.6.5.4 Circuit Breaker Lock. Where a circuit breaker is the disconnecting means, a listed breaker locking device shall be installed. 10.6.5.5 Overcurrent Protection. An overcurrent protective device of suitable current-carrying capacity that is capable of interrupting the maximum short-circuit current to which it can be subject shall be provided in each ungrounded conductor. (NFPA 72 10.6.5.2)	Corrected
---	-----------

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	NorthCare Pasco	Provider Number	2666
Address	5921 ROAD 60 ,	Approval Status	Disapproved
City, State, Zip	Pasco, WA 99301	Facility Type	Residential Care

On 10/8/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

Next inspection scheduled on or after: 11/7/2025

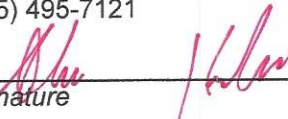
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Kelsie Blanco Admit
Print Name and Title

Deputy State Fire Marshal Alan Harlan
2803 156TH AVE SE
Bellevue WA 98007
(425) 495-7121


Signature

This document was prepared by Residential Care Services for the Locator website.