



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Provider Number 000784
11613 SE 7TH ST ,	Approval Status Disapproved
City, State, Zip Vancouver, WA 98684	Facility Type Residential Care

On 05/16/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

1 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space. (IFC 701.6 2021)	Upon inspection of fire resistance rated construction it was found the the corridors failed to be rated. The City of Vancouver has been contacted and will be leading the permit process and construction inspection for the repairs needed. Upon completion the State Fire Marshal Office shall be notified
---	---

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Provider Number 000784
11613 SE 7TH ST,	Approval Status Disapproved
City, State, Zip Vancouver, WA 98684	Facility Type Residential Care

On 05/16/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement	Statement of Violation
2 Inspection and Maintenance	
Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified. (IFC 705.2 2021)	Fire door shall have inspection and repairs completed


Next inspection scheduled on or after: 06/15/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0866


Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	11613 SE 7TH ST ,	Provider Number 000784
City, State, Zip	Vancouver, WA 98684	Approval Status Disapproved
		Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

1 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Upon inspection of fire resistance rated construction it was found the the corridors failed to be rated. The City of Vancouver has been contacted and will be leading the permit process and construction inspection for the repairs needed. Upon completion the State Fire Marshal Office shall be notified

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	11613 SE 7TH ST ,	Provider Number 000784
City, State, Zip	Vancouver, WA 98684	Approval Status Disapproved
		Facility Type Residential Care

On 03/20/2025 the Office of the State Fire Marshal conducted a re-inspection at your facility. Listed below are violations that have not been corrected.

Code Requirement

Statement of Violation

Next inspection scheduled on or after: 04/19/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966

Signature



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cascade Retirement Inn	Provider Number	000784
Address	11613 SE 7TH ST ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98684	Facility Type	Residential Care

On 01/28/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

1 Capacity Exceeding 1.5 Cubic Yards

Dumpsters and containers with an individual capacity of 1.5 cubic yards [40.5 cubic feet (1.15 m3)] or more shall not be stored in buildings or placed within 5 feet (1524 mm) of combustible walls, openings or combustible roof eave lines. Exceptions: 1. Dumpsters or containers that are placed inside buildings in areas protected by an approved automatic sprinkler system installed throughout in accordance with Section 903.3.1.1, 903.3.1.2 or 903.3.1.3. 2. Storage in a structure shall not be prohibited where the structure is of Type I or IIA construction, located not less than 10 feet (3048 mm) from other buildings and used exclusively for dumpster or container storage. 3. Dumpsters or containers that are located adjacent to buildings where the exterior area is protected by an approved automatic sprinkler system. (IFC 304.3.3 2021)	Multiple dumpsters found with 5 feet of building eave outside laundry area without sprinkler protection
--	---

2 Clearance From Ignition Sources

Clearance between ignition sources, such as luminaries, heaters, flame-producing devices and combustible materials, shall be maintained in an approved manner. (IFC 0305.1 2021)	Combustible items found placed against heater in room 152
---	---

3 Open electrical terminations

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes. (IFC 603.2.2, 2021)	Electrical cover in kitchen found missing
---	---



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name Cascade Retirement Inn
Address 11613 SE 7TH ST ,
City, State, Zip Vancouver, WA 98684

Provider Number 000784
Approval Status Disapproved
Facility Type Residential Care

On 01/28/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

4 Appliance Connection to Building Piping

Gas-fired commercial cooking appliances installed on casters and appliances that are moved for cleaning and sanitation purposes shall be connected to the piping system with an appliance connector listed as complying with ANSI Z21.69/CSA 6.16. The commercial cooking appliance connector installation shall be configured in accordance with the manufacturer's installation instructions. Movement of appliances with casters shall be limited by a restraining device installed in accordance with the connector and appliance manufacturer's instructions.

(IFC 606.4 2021)

Strain protection failed to be maintained in Kitchen for wheeled appliances

5 Owner's Responsibility

The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.

(IFC 701.6 2021)

Facility has a scheduled fire door inspection scheduled
Items on fire doors shall be removed in excess of 5% coverage

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name Cascade Retirement Inn
Address 11613 SE 7TH ST ,
City, State, Zip Vancouver, WA 98684

Provider Number 000784
Approval Status Disapproved
Facility Type Residential Care

On 01/28/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

6 Inspection and Maintenance

Opening protectives in fire-resistance-rated assemblies shall be inspected and maintained in accordance with NFPA 80. Opening protectives in smoke barriers shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Openings in smoke partitions shall be inspected and maintained in accordance with NFPA 105. Fire doors and smoke and draft control doors shall not be blocked, obstructed, or otherwise made inoperable. Fusible links shall be replaced promptly whenever fused or damaged. Opening protectives and smoke and draft control doors shall not be modified.

(IFC 705.2 2021)

Facility failed to provide annual fire resistance rated construction inspection. Facility shall provide a inventory of fire ire resistance rated construction inspection.

7 Restricted Occupancies

Natural cut trees shall be prohibited in the following occupancies:

1. Group I; and
2. R-2 occupancies providing licensed care to clients in one of the categories listed in the International Building Code, Section 310.1, licensed by Washington state.

(IFC 806.1.1 2015, 2018 WAC 51-54A)

Live wreath found on fire door room 426

8 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.

(IFC 903.5 2021)

Main drain on wet fire sprinkler fire sprinkler riser in kitchen found leaking
Facility failed to provide quarterly fire sprinkler inspection report

9 Extinguishing System Service

Automatic fire-extinguishing systems shall be serviced not less frequently than every six months and after activation of the system. Inspection shall be by qualified individuals, and a certificate of inspection shall be forwarded to the fire code official upon completion.

(IFC 904.13.5.2 2021)

Instructions shall be provided to new employees on hiring and to all employees annually on the use of portable fire extinguishers and the manual actuation of the fire-extinguishing system.
Records of compliance shall be available be provided.

10 Portable Fire Extinguishers - General Requirements

Fire sprinkler in kitchen found blocked by cart



Washington State Patrol
Fire Protection Bureau

Phone: (360) 596-3900

This document was prepared by Residential Care Services for the Locator website.

Business Name	Cascade Retirement Inn	Provider Number	000784
Address	11613 SE 7TH ST ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98684	Facility Type	Residential Care

On 01/28/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement

Statement of Violation

11 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained.

(IFC 907.8 2021)

Facility shall provide semi annual fire alarm inspection report

12 Exit Sign Illumination

The face of an exit sign illuminated from an external source shall have an intensity of not less than 5 foot-candles (54 lux).

(IFC 1013.6.2 2021)

Exit sign in club room failed to be illuminated

13 Securing Compressed Gas Containers, Cylinders and Tanks

Compressed gas containers, cylinders and tanks shall be secured to prevent falling caused by contact, vibration or seismic activity. Securing of compressed gas containers, cylinders and tanks shall be by one of the following methods:

1. Securing containers, cylinders and tanks to a fixed object with one or more restraints.
2. Securing containers, cylinders and tanks on a cart or other mobile device designed for the movement of compressed gas containers, cylinders or tanks.
3. Nesting of compressed gas containers, cylinders and tanks at container filling or servicing facilities or in sellers' warehouses not open to the public. Nesting shall be allowed provided that the nested containers, cylinders or tanks, if dislodged, do not obstruct the required means of egress.
4. Securing of compressed gas containers, cylinders and tanks to or within a rack, framework, cabinet or similar assembly designed for such use.

Exception: Compressed gas containers, cylinders and tanks in the process of examination, filling, transport or servicing.

(IFC 5303.5.3 2021)

Unsecured oxygen in room 152



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Cascade Retirement Inn	Provider Number	000784
Address	11613 SE 7TH ST ,	Approval Status	Disapproved
City, State, Zip	Vancouver, WA 98684	Facility Type	Residential Care

On 01/28/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

Next inspection scheduled on or after: 02/27/2025

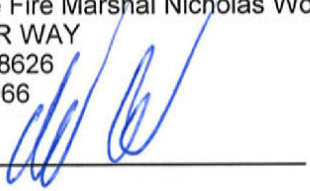
Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature

Chelsea Stearns Executive Director
Print Name and Title

Deputy State Fire Marshal Nicholas Wolden
1823 BAKER WAY
Kelso WA 98626
(360) 852-0966


Signature

This document was prepared by Residential Care Services for the Locator website.